Date Received 4/27/87

MECK COUNTY DEPARTMENT OF ENVIRONMENTAL HEALTH RECEIVED APR 1 1987

APT No. 12247

T. C. No. 221-031-13

Map Date

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH

APPLICATION FOR SOIL INVESTIGATION

1) NAME OF OWNER Huneycutt (LAST) Pauline (FIRST) Y. (MIDDLE)

2) ADDRESS OF OWNER P. O. Box 293, Pineville, NC ZIP 28134

3) PHONE NO. Home 889-4226 Office


4) LOCATION OF PROPERTY Eastside Lake View Drive (STREET OR COUNTY ROAD) Tax Code 221-031-13

5) SUBDIVISION None LOT NO. BLOCK NO.

MAP BOOK NO. PAGE NO.

6) DEED REFERENCE: DEED BOOK 995 PAGE NO. 265

Application is hereby made to the Mecklenburg County Department of Environmental Health for the conduct of a soil investigation and an on site inspection of the lot hereinabove described for the purpose of determining if the lot is suitable for the installation of an individual septic tank wastewater treatment system with subsurface, soil absorption, effluent discharge.

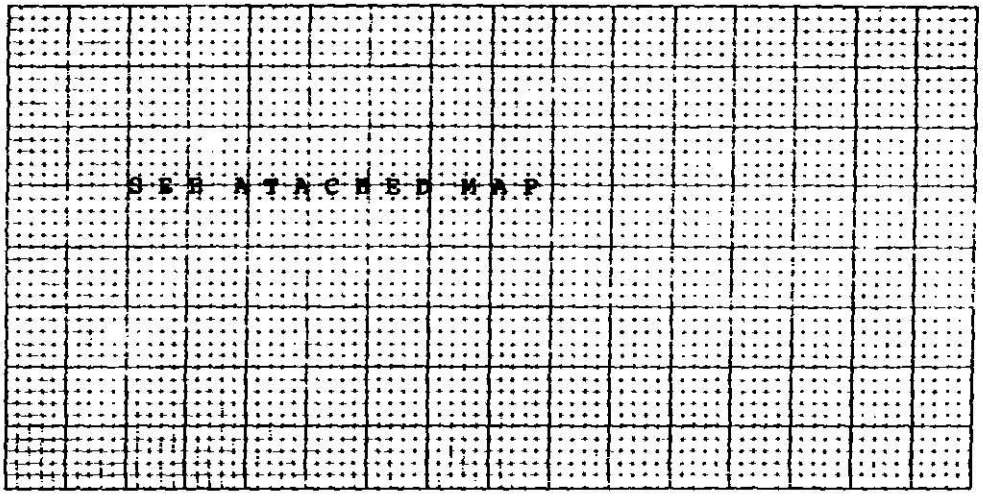

7) ACCURATELY DIAGRAM & DIMENSION LOT

Pauline Y. Huneycutt
OWNER

EHD-5-76

Environmental Health Department's Copy

SOIL INVESTIGATION REPORT

Date of Investigation April 26, 1971 **APT NO.** 12442

Owner Carlisle H. Hunnycutt T.C. 221-03-13

Location of Property Eastside Lakeview Dr.

Soil Suitability Ratings

Soil Properties	Soil 1	Soil 2	Soil 3	Soil 4
1. Soil Series	Wilkes gullied	Mecklenburg	Cecil	
2. Soil Slope	unsuitable complex 36pos	Suitable 6-12%	Suitable 10-15%	
3. Soil Depth	unsuitable ± 20"	suitable 45"	Suitable 7+0"	
4. Soil Texture	unsuitable 2-1 E mond. Clay	unsuitable 2-1 E mond. Clay	Provisionally suitable Clay	
5. Soil Structure	unsuitable Massive	unsuitable Massive	Provisionally suitable Blocky	
6. Restrictive Horizons				
7. Soil Drainage	unsuitable Potential lateral water Movement	Suitable water Table 70'	Suitable water Table 76'	
8. Soil Permeability (Percolation Rate)	unsuitable slow 72:00 min/in	unsuitable slow 72:00 min/in	Provisionally suitable Moderate 60 Min/in	
9. Other			Inadequate if Acceptable	Area Soil
10. Overall Rating	unsuitable	unsuitable	unsuitable	

Recommendations Removed. Based on this investigation, ~~there~~ there is not an adequate area of provisionally suitable soil on the lot for the installation of a septic tank system.


See Diagram on back

William R. Martin
Soil Scientist

WEC

3/26/75
RED 559

DIAGRAM OF PROPERTY

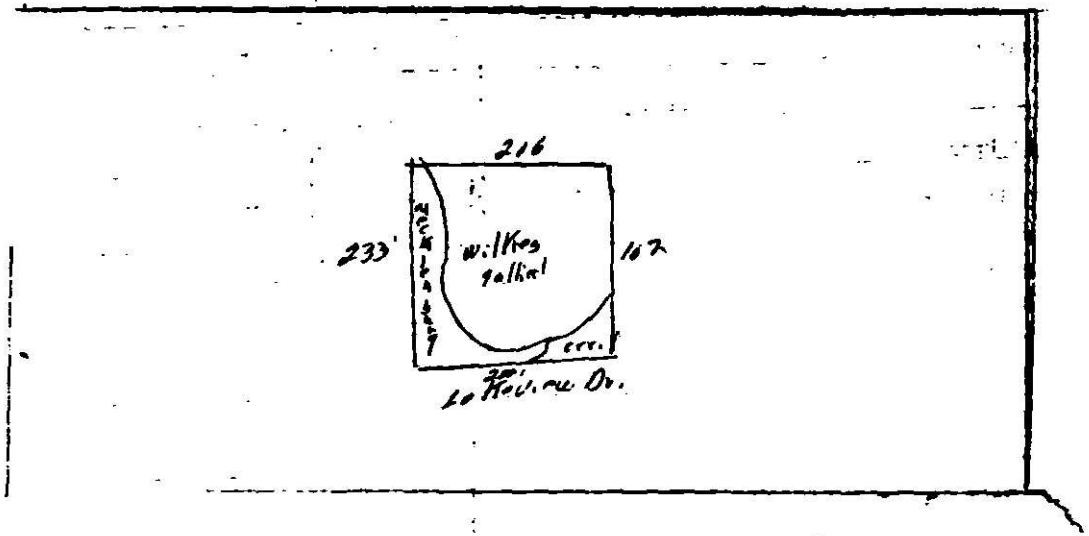

3/10/75

[illegible]539

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH
1200 BLYTHE BOULEVARD
CHARLOTTE, NORTH CAROLINA 28203

DATE ISSUED
1. 4-28-77
2. _____
3. _____

SOIL INVESTIGATION REPORT
INDIVIDUAL SEPTIC TANK SYSTEM
WITH SUBSURFACE,
SOIL ABSORPTION,
EFFLUENT DISCHARGE

SIP NO. 12247
T.C. MAP NO. 221-031-13
MAP DATE _____

NAME OF OWNER Huneycutt, Pauline Y.

ADDRESS OF OWNER P.O. Box 293, Pineville, N.C. 28134

LOCATION OF LOT Eastside Lake View Dr

The lot described above is not recommended for the installation of an individual septic tank system with subsurface, soil absorption, effluent discharge due to the following:

Soil Permeability Unsuitable

Percolation rate in excess of 200 min/in.

John R. Ackisson

John R. Ackisson, Environmentalist
On Premises Waste Disposal Section

JRA: glr

(Stencil No.)
EHD 389
8/74

FORM NO.
T-11-8-21-74