Date Received 5/9/77

MECK. COUNTY DEPT. OF ENVIRONMENTAL HEALTH
MAY 9 1977

APT No. 12388

T. C. No. 023-082-16

Map Date

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH

APPLICATION FOR SOIL INVESTIGATION

1) NAME OF OWNER GRIFFIN (LAST) JOHN (FIRST) L (MIDDLE)

2) ADDRESS OF OWNER RT 9 Box 217E CHARLOTTE NC ZIP 28208

3) PHONE NO Home 399-3948 Office


4) LOCATION OF PROPERTY MT. HOLLY-HUNTERSVILLE RD (STREET OR COUNTY ROAD)

5) SUBDIVISION LOT NO BLOCK NO.

MAP BOOK NO 2528 PAGE NO 465

6) DEED REFERENCE DEED BOOK 2808 PAGE NO 12

Application is hereby made to the Mecklenburg County Department of Environmental Health for the conduct of a soil investigation and an on-site inspection of the lot hereinabove described for the purpose of determining if the lot is suitable for the installation of an individual septic tank wastewater treatment system with subsurface soil absorption effluent discharge.

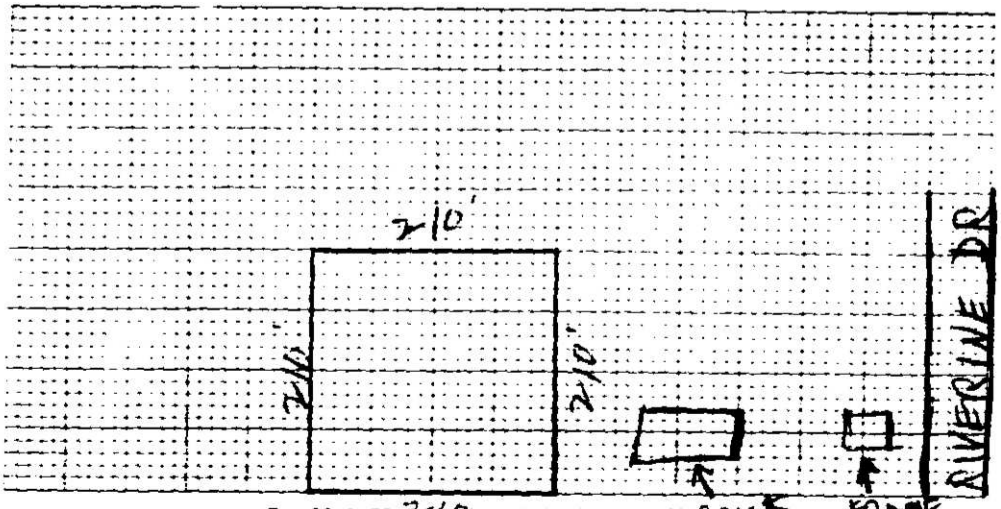

7) ACCURATELY DIAGRAM & DIMENSION LOT

OAKDALE RD.

TURN RIGHT ON → MT HOLLY HUNTERSVILLE RD.

John L Griffin
OWNER

EHD-5-76

Environmental Health Department's Copy

SOIL INVESTIGATION REPORT

Date of Investigation May 13 1977 APT NO. 12366

Owner John L Taylor Tax 023-[illegible]

Location of Property NW Kelly Martinsville Rd.

Soil Suitability Ratings

Soil Properties	Soil 1	Soil 2	Soil 3	Soil 4
1. Soil Series	Helena	[illegible]		
2. Soil Slope	Suitable 0-2%	Suitable 6-20%		
3. Soil Depth	Suitable 40"	Unsuitable 24"		
4. Soil Texture	unsuitable 2:1 Expanding clay	unsuitable 2:1 expanding clay		
5. Soil Structure	unsuitable Massive	unsuitable Massive		
6. Restrictive Horizons				
7. Soil Drainage	unsuitable Perched water table	unsuitable Seasonal high water Movement		
8. Soil Permeability (Percolation Rate)	unsuitable Slow 72+ min/in	unsuitable Slow 72+ min/in		
9. Other		Soil underlain by weathered Rock at Depth 36"		
10. Overall Rating	unsuitable	unsuitable		

Remarks Recommendations Based on the investigation, the soil will not be considered suitable for installation of septic tank system.


[illegible] William R. Marlin

[illegible]

WRM

3[illegible]25
[illegible]339

DIAGRAM OF PROPERTY

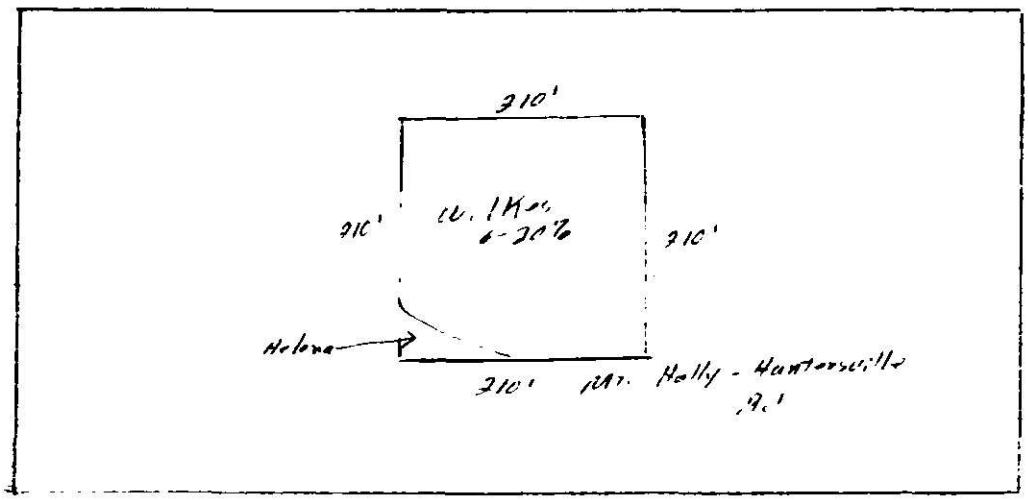

3/18/75
EHD 539

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH
1200 BLYTHE BOULEVARD
CHARLOTTE NORTH CAROLINA 28203

DATE ISSUED
1. 5-18-77
2. _____
3. _____

SITE EVALUATION FOR
INDIVIDUAL SEPTIC TANK SYSTEM
WITH SUBSURFACE,
[illegible]
EFFLUENT IRRIGATION

SEC. I. 12308
P.C. ID 023-087-16
LOT [illegible]

NAME OF OWNER Griffin, John L.

ADDRESS OF OWNER [illegible], Box 217 E, Charlotte, NC 28208

LOCATION OF LOT [illegible]t. Holly-Huntersville Road

[illegible] lot described above is not recommended for the installation of an individual septic tank system with subsurface, soil absorption, effluent irrigation due to the following:

Soil Permeability Unsuitable.

Percolation rate in excess of 200 min/in.

John R. Adkisson, Environmentalist
On Premises Waste Disposal Section

JRA: glr

(Stencil No.)
ENV 398
9/74

[illegible]

Date Received 2/21/79

Send [illegible] Reports

MECK COUNTY DEPARTMENT OF
RECEIVED
FEB 21 1979
ENVIRONMENTAL HEALTH

APT No. 12388

T. C. No 023-082-16

Map Date 1/3/79

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH

APPLICATION FOR SOIL INVESTIGATION

1) NAME OF OWNER GRIFFIN (LAST) JOHN (FIRST) L (MIDDLE)

2) ADDRESS OF OWNER RT. 9 BOX 81E CHARLOTTE, NC ZIP 28208

3) PHONE NO Home 399-3948 Office SAME


4) LOCATION OF PROPERTY HUNTERSVILLE — MT. HOLLY RD. (STREET OR COUNTY ROAD)

5) SUBDIVISION LOT NO BLOCK NO

MAP BOOK NO 2528 PAGE NO 465

6) DEED REFERENCE DEED BOOK 2208 PAGE NO 12

Application is hereby made to the Mecklenburg County Department of Environmental Health for the conduct of a soil investigation on the property described above for the purpose of determining if the soil is suitable for the installation of a septic tank wastewater treatment system with subsurface absorption lines.

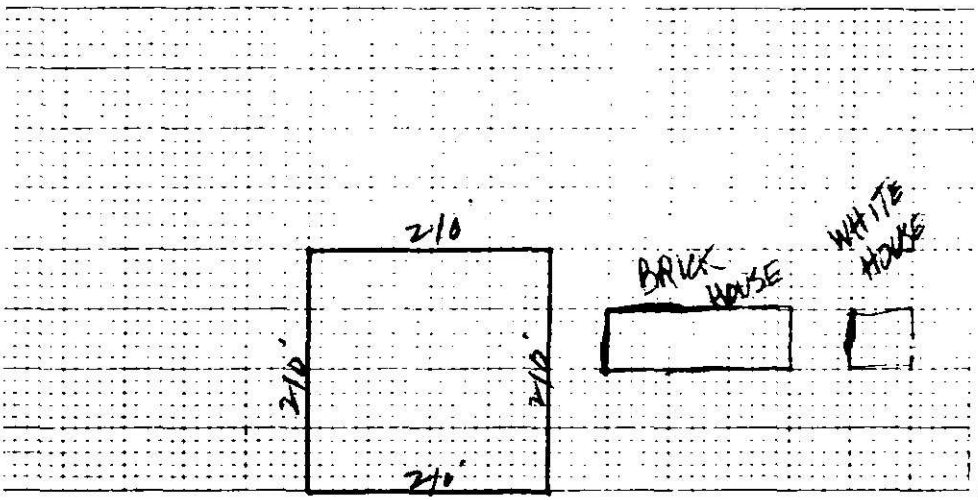

7) ACCURATELY DIAGRAM & DIMENSION LOT

MT. HOLLY - HUNTERSVILLE RD.

OAKDALE RD.

RIVER

OWNER John L Griffin

EHDIS '76

Environmental Health Department's Copy