Date Received 2/12/80

APT No. 16611

T. C. No. 0139-25-15

Map Date

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH

APPLICATION FOR SOIL INVESTIGATION

1) NAME OF OWNER Civil Realty
LAST FIRST MIDDLE

2) ADDRESS OF OWNER [illegible] 13054 Charl NC ZIP 28278

3) PHONE NO. Home 535-0509 Office 5


4) LOCATION OF PROPERTY Barclay Lane
STREET OR COUNTY ROAD

5) SUBDIVISION Hollendale Acres LOT NO 1 BLOCK NO. 3

MAP BOOK NO PAGE NO

6) DEED REFERENCE DEED BOOK PAGE NO

Application is hereby made to the Mecklenburg County Department of Environmental Health for the conduct of a soil investigation and an on site inspection of the lot hereinabove described for the purpose of determining if the lot is suitable for the installation of an individual septic tank wastewater treatment system with subsurface, soil absorption, effluent discharge

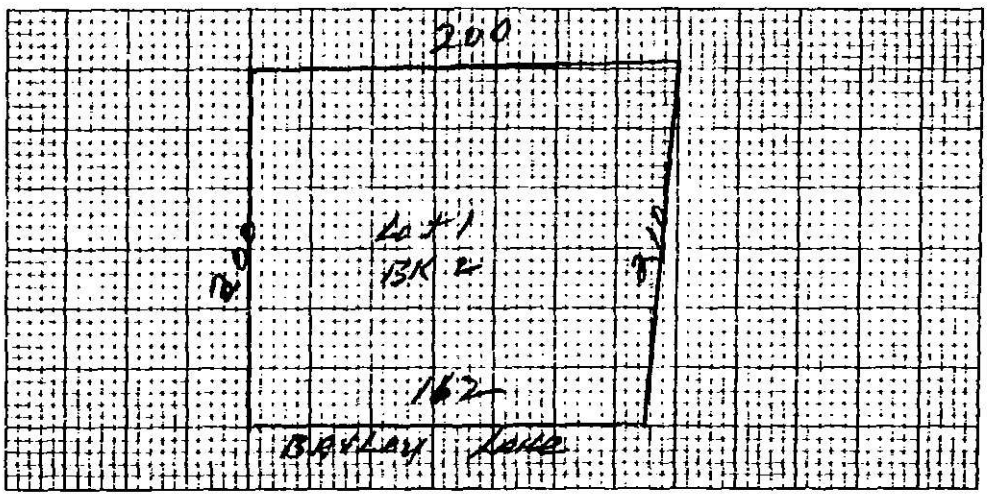

7) ACCURATELY DIAGRAM & DIMENSION LOT

J. M. Civil
OWNER

EHD-5-76

Environmental Health Department's Copy

NORTH CAROLINA
DEPARTMENT OF HUMAN RESOURCES
DIVISION OF HEALTH SERVICES
RALEIGH, NORTH CAROLINA

APPENDIX
SITE EVALUATION

S.I.R. No. 16611
T.C. No. PO 139-275-15

(Ground Absorption Sewage Disposal)

OWNER: CIVIL REALTY
ADDRESS: PO BOX 18054
COUNTY: MECK 28218
LOCATION OF SITE: BAYLEY LANE Lot 1 Block 2
VAGABOND RD.

DATE REQUESTED: 2-12-80
PLAT NO:
LOT SIZE: 35,000 ±

FACTORS	AREA 1	AREA 2	AREA 3	AREA 4
1. SLOPE (%)	S (PS) U — Level	S PS (U) — Complex Slopes	S PS U	S PS U
2. SOIL TEXTURE (12-36 inches) Sandy, Loamy, Clayey (Note 2:1 Clay)	S (PS) U — Clayey	S PS (U) — Clayey To Saprolite	S PS U	S PS U
3. SOIL STRUCTURE (12-36 inches)	S (PS) U — Blocky	S PS (U) — Blocky To Massive	S PS U	S PS U
4. SOIL DEPTH (inches)	S (PS) U — 48	S PS (U) — <48	S PS U	S PS U
5. RESTRICTIVE HORIZONS (inches) (Impervious strata, Rock)	S (PS) U — NONE	S PS (U) — Saprolite	S PS U	S PS U
6. SOIL DRAINAGE/GROUNDWATER (external and internal)	S (PS) U — Adequate	S PS (U) — Slow	S PS U	S PS U
7. SOIL PERMEABILITY (percolation rate)	S (PS) U — Moderate	S PS (U) — Slow	S PS U	S PS U
8. OTHER (specify)	S PS U	S PS U	S PS U	S PS U
9. SITE CLASSIFICATION	P. Suitable	Unsuitable		
10. SOIL SERIES	Cecil	Eroded Cecil (Deep Dilolas)		

S - Suitable PS - Provisionally Suitable U - Unsuitable


** See Diagram on Back (includes: soil areas, property lines, roads, streams, gullies, wet areas, fill areas, wells, water bodies, slope)

Recommendations/Comments: Small Area of Uneroded Cecil May Not Be Useable Due To Slope + Position on The Lot.

Described By: Willard Ramsey
Title: Soil Scientist I
Date: 2-20-80

DHS Form 2601
Sanitation
EHD 539 (2/80)

2

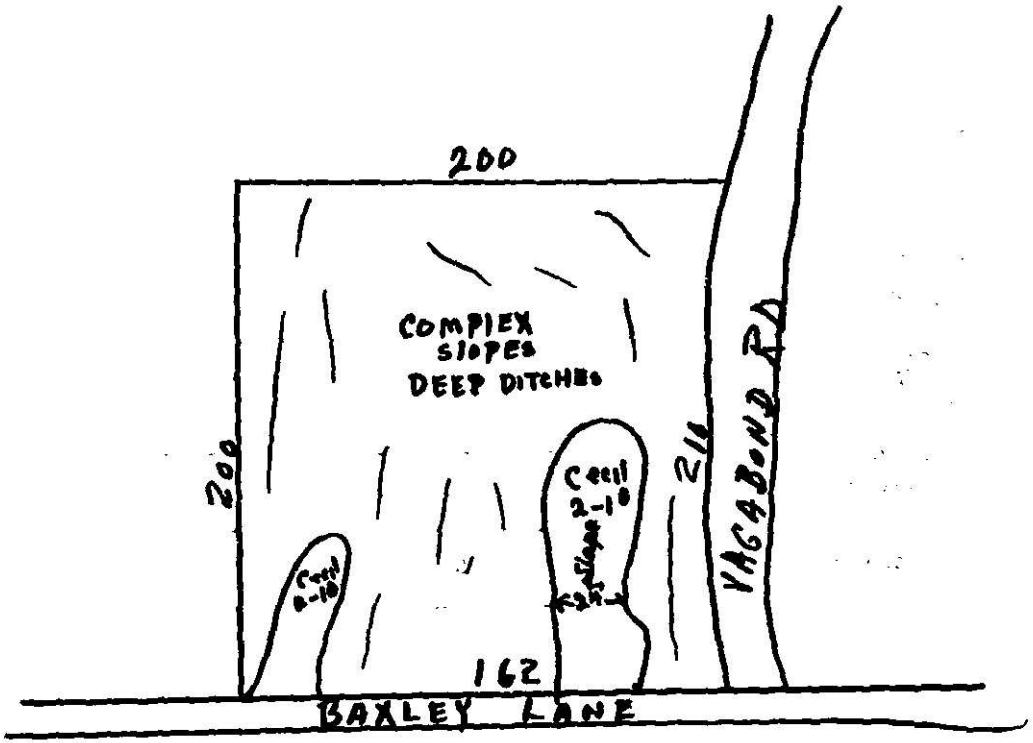
200
COMPLEX
SLOPES
DEEP DITCHES
200
211
Cecil
2-10
Cecil
2-10
VAGABOND RD
162
BAXLEY LANE

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH
1200 BLYTHE BOULEVARD
CHARLOTTE NORTH CAROLINA 28203

SITE INVESTIGATION REPORT
INDIVIDUAL SEPTIC TANK SYSTEM
WITH SUBSURFACE,
SOIL ABSORPTION,
EFFLUENT DISCHARGE

S.I.R. # 16611

T.C. # po 139-275-15

DATE February 26, 1980

NAME OF OWNER Civil Realty Co.

ADDRESS OF OWNER PO Box 18054, Charlotte, NC 28218

LOCATION OF LOT corner: Baxley Lane and Vagabond Road, Lot 1, Blk. 2

As determined under the Rules and Regulations promulgated by the Commission for Health Services, Division of Health Services, North Carolina Department of Human Resources, Raleigh, North Carolina, the soils on the lot described above were found to be unsuitable for the installation of an individual septic tank - soil absorption system, due to the following reason:

Limited area of provisionally suitable soils.

Please submit plot plans of proposed location of residence and septic tank system.

John R. Adkisson

John R. Adkisson, Environmentalist