Date Received 1/7/80

MECK COUNTY DEPARTMENT OF
RECEIVED
JAN 7 19[illegible]
ENVIRONMENTAL HEALTH

APT No. 16422

T. C No. 109-262-18

Map Date 1/3/79

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH

APPLICATION FOR SOIL INVESTIGATION

1) NAME OF OWNER Yetter (LAST), Lawrence R. & Charlotte L. (FIRST, MIDDLE)

2) ADDRESS OF OWNER Box 417, 14 Barton Rd, Asheville, NC (ZIP) 28802

3) PHONE NO Home (607) 625-3982 Office (607) 582-2121, Ext 5181


4) LOCATION OF PROPERTY 1700 Marlwood Circle, Charlotte NC (STREET OR COUNTY ROAD)

5) SUBDIVISION Marlwood Acres LOT NO 12 BLOCK NO A

MAP BOOK NO 7 PAGE NO 77

6) DEED REFERENCE DEED BOOK 3137 PAGE NO 67
4231 227, 228 10 Sept '79

Application is hereby made to the Mecklenburg County Department of Environmental Health for the conduct of a soil investigation on the lot hereinabove described for the purpose of determining if the lot is suitable for the installation of an individual septic tank wastewater treatment system with subsurface soil absorption effluent discharge.

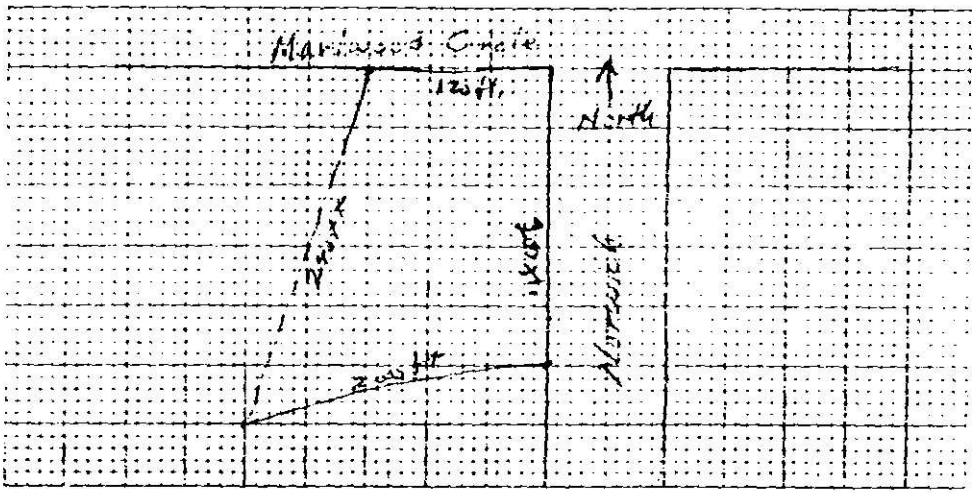

7) ACCURATELY DIAGRAM & DIMENSION LOT
We don't have the exact dimensions, but this is as close as I know.

Lawrence R. Yetter
OWNER

EHD-5-76

Environmental Health Department's Copy

S.I.R. NO. 16422

NORTH CAROLINA
DEPARTMENT OF HUMAN RESOURCES
DIVISION OF HEALTH SERVICES
RALEIGH, NORTH CAROLINA

APPENDIX II
SITE EVALUATION

T.C. # 104-262-18

(Ground Absorption Sewage Disposal)

OWNER: Lawrence & Charlotte Jeter
ADDRESS: Box 417 14 Burton Rd, Saxapahaw, NC 27332
COUNTY:
LOCATION OF SITE: 1700 Rockwood Circle

DATE REQUESTED:
PLAT NO.: Lot 12 - Block A
LOT SIZE: 35,200

FACTORS	AREA 1	AREA 2	AREA 3	AREA 4
1. SLOPE (%)	(S) PS 2-8% U	S complex PS slopes (U)	S PS U	S PS U +
2. SOIL TEXTURE (12-36 in.) (Sandy, loamy, clayey, Note 2:1, Clay)	S PS 2-1 (U) Clay *	S PS 2-1 (U) Clay	S PS U	S PS U
3. SOIL STRUCTURE (12.36 in.) (Clayey Soils)	S PS Massive (U)	S PS Massive (U)	S PS U	S PS U
4. SOIL DEPTH (In.)	S PS 48" (U)	S PS 48" (U)	S PS U	S PS U
5. RESTRICTIVE HORIZONS (In.) (Imprevious Strata, Rock)	(S) None PS U	(S) None PS U	S PS U	S PS U
6. SOIL DRAINAGE/GROUNDWATER (External & Internal)	S Seasonal PS perched water table (U)	S Seasonal PS perched water Table (U)	S PS U	S PS U
7. SOIL PERMEABILITY (Percolation Rate)	S PS U.Slow (U)	S PS U.Slow (U)	S PS U	S PS U
8. OTHER (Specify)	S PS U	S PS U	S PS U	S PS U
9. SITE CLASSIFICATION	~~suitable~~ unsuitable	unsuitable		
SOIL SERIES	Iredell	Enoree/Iredell Drag Area		

S - Suitable PS - Provisionally Suitable U - Unsuitable

* See Diagram on Back (Include: Soil areas, property lines, roads, streams, gullies, wet areas, fill areas, wells, water bodies, slope patterns, etc)


Recommendations/Comments:

Described By: William A. Marlin

Title: Soil Scientist Date: 1-15-80

DHS Form 2601 (2/77)
Sanitation

2

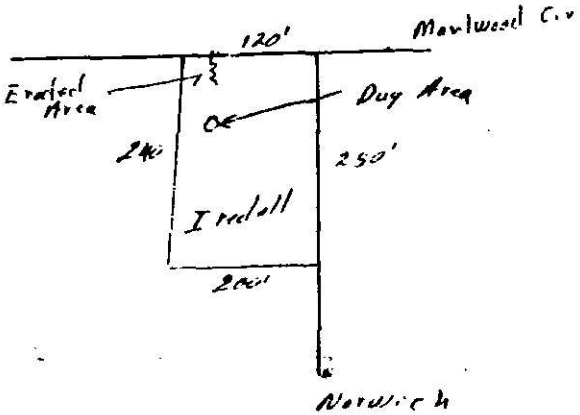
120'
Mawlwood Cir
Graded Area
Dug Area
24'
250'
Irdell
200'
Norwich

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH
1200 BLYTHE BOULEVARD
CHARLOTTE NORTH CAROLINA 28203

SITE INVESTIGATION REPORT
INDIVIDUAL SEPTIC TANK SYSTEM
WITH SUBSURFACE,
SOIL ABSORPTION,
EFFLUENT DISCHARGE

S.I.R. # 16422

T.C. # 109-262-18

DATE January 16, 1980

NAME OF OWNER Yetter, Lawrence R. and Charlotte I.

ADDRESS OF OWNER PO Box 417, 19 Barton Rd., Apalachia, N.Y. 13732

LOCATION OF LOT 1700 MARLWOOD CIRCLE, Marlwood Acres, Lot 12, Blk. A

As determined under the Rules and Regulations promulgated by the Commission for Health Services, Division of Health Services, North Carolina Department of Human Resources, Raleigh, North Carolina, the soils on the lot described above were found to be unsuitable for the installation of an individual septic tank - soil absorption system, due to the following reason:

Soil Structure Massive

Soil Drainage/Groundwater Unsuitable

Soil Permeability Unsuitable

John R. Adkisson, Environmentalist