

13328 SAGE THRASHER LN

19936135

1/9/2008

duponbj

Groundwater and Wastewater Services File Imaging Project
May 2007
Barcode Font = IDAutomationHC39M

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID # PO 199-371-03
Lot #: 177, alternate drainfield site
File #: 5769B
Code: 1

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

Owner: The Sanctuary at Lake Wylie
Applicant: Toney C. Jacobs
Address: 10933 Ballantyne Crossing Ave., Charlotte, N. C. 28277
Date Evaluated: 6/14/2005
Proposed Facility: Residence
Design Flow (.1949): 600gpd
Property Size: .3a inv.
Location of Site: Sage Thrasher Lane
Property Recorded:
Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [x] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 .1941 Structure/ Texture	.1941 Consistence Mineralogy	OTHER PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
1	LS, 5	0-11	GR/CL	FR/SEXP/SS/SP	>48" TO SOIL WETNESS	48	N/A	NONE	PS, IV
		11-48	SBK/C	FI/SEXP/S/P					.3GPD/FT^2
2	"	0-9	GR/CL	FR/SEXP/SS/SP	"	"	"	"	"
		9-48	SBK/C	FI/SEXP/S/P					
3	"	0-11	GR/CL	FR/SEXP/SS/SP	"	"	"	"	"
		11-48	SBK/C	FI/SEXP/S/P					

Description	Initial System	Repair System
Available Space (.1945)	PS	PS
System Type(s)		
Site LTAR	.3GPD/FT^2	.3GPD/FT^2


Other Factors (.1946):
Site Classification (.1948): PROVISIONALLY SUITABLE
Evaluated By: W. R. Martin, LSS, 6/16/2005 W. R. Martin
Others Present:

COMMENTS:
100% repair, alternate site located in COS across Sage Thrasher Lane

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Food Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace		CL-Clay Loam		
FP-Flood Plain		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

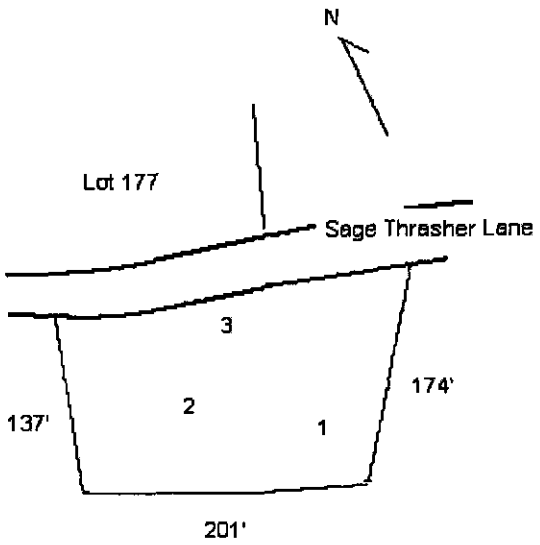

CONDITIONS OF IMPROVEMENT PERMIT

Permit Number: **5769B** Tax Number: **199-371-03**

- The IMPROVEMNET PERMIT is subject to revocation if site plans or the intended use change. There is to be **NO** grading, filling, or disturbance of *the soil in the area* of the septic tank system or repair area.
- CONSTRUCTION AUTHORIZATION must be obtained prior to receiving a Building Permit. The Construction Authorization is **NOT** transferable. Do not clear, grade, fill or disturb soil prior to obtaining a Construction Authorization.
- Domestic-type wastewater only. No industrial process wastewater may be discharged into the system.

Basement: ☒ Yes ☐ No ☐ Partial Basement

Primary Wastewater System

Type: ☐ I ☐ II ☒ III ☐ IV ☐ V ☐ VI

☐ Conventional
☐ Prefabricated, permeable block panel system
☐ Shallow Placed Conventional
☐ Low Pressure Pipe
☐ Large Diameter Pipe
☐ Fill
☐ Other
☒ Innovative or Experimental:

0.3 Long-term acceptance rate (GPD/ft^2)	600 Max gallons/day wastewater flow	1500 Absorption Area (ft^2)	9 Trench spacing (min. on centers) (ft)
Serviced by private well: ☐ Yes ☒ No	1500 Gallon septic tank	500 Total trench length (ft)	24 Maximum trench depth (in) (At least 12" of provisionally suitable soil must remain between trench bottom and unsuitable soil conditions.)
5 Bedrooms in residence	1500 Gallon pump tank	na Depth of stone (in)	

Any surface water present: **No** Type: Minimum separation distance (ft):

Additional conditions: **Install according to plans on file submitted by *Toney Jacobs and Associates*. Revised 6/13/05 Lot #177**

Repair Area System

Type: ☐ I ☐ II ☒ III ☐ IV ☐ V ☐ VI

☐ Conventional
☐ Prefabricated, permeable block panel system
☐ Shallow Placed Conventional
☐ Low Pressure Pipe
☐ Large Diameter Pipe
☐ Fill
☐ Other
☒ Innovative or Experimental:

1500 Absorption Area (ft^2) 500 Total trench length (ft)	na Depth of stone (in)	9 Trench spacing (min. on centers) (ft)	24 Maximum trench depth (in)

The undersigned, an authorized agent of the MECKLENBURG COUNTY HELTH DEPARTMENT, certifies that the Department has approved the Request for the Job Location contained in this document. The approval is granted in accordance with the provisions of Laws and Rules For Sewage, Treatment and Disposal in effect at the time of issuance of the permit and is subject to the following provisions:

*** No work shall be conducted on the septic tank system until an Installation, Construction, Alteration and/or Repair Approval is granted by this Department.

*** This Improvement permit is transferable.

6/22/05
DENR Authorized Agent Date

6-23-05
Owner/Agent Signature Date

MECKLENBURG COUNTY
HEALTH DEPARTMENT
ENVIRONMENTAL HEALTH DIVISION
c/o HAL MARSHALL CTR.
SUITE 211
700 N. TRYON ST.
CHARLOTTE, NC 28202
(704) 336-5103

NORTH CAROLINA DEPARTMENT OF
ENVIRONMENTAL, HEALTH, AND
NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

S&ME

Date: June 13, 2005

To: Mr. David Cornelius, R.S.
Mecklenburg County Env. Health Dept.

From: Paul G. Penninger, LSS
Toney C. Jacobs, LSS

RE: Request for an Improvement Permit for Lot 177 at The Sanctuary:
MCHD File #5769B (revision from Feb. 2, 2005 proposed system)

The Sanctuary at Lake Wylie is requesting an Improvement Permit for the above referenced lot. **This lot will utilize an off-site septic area for the septic system drainfield.** Mr. Bill Marlin has evaluated the soils (see attached MCHD soil sheets) and S&ME, Inc. has flagged the system and repair on the septic area. The septic lines have been located by the surveyor and are shown on the attached maps. The attached sketch and specifications are not an Improvement Permit and are intended only to assist the MCHD in permitting the referenced lot at The Sanctuary.

We understand that a building permit cannot be issued until your office issues an Authorization to Construct (ATC). The buyer will apply for the ATC. If the buyer's house pad does not fit in the "building envelope" shown on the Improvement Permit, we understand that the proposed system may have to be modified prior to your office issuing the ATC. **No grading shall take place on the lot prior to obtaining the ATC from the MCHD.**

Tri-County Wastewater (TCWW) is under contract to supply maintenance services for each septic system installed at The Sanctuary. TCWW will have a list of preferred septic contractors for the subdivision and will also have requirements for septic system installation that are greater than the MCHD and State requirements. It will be the responsibility of TCWW to enforce any requirements above State requirements or the MCHD conditions on the Improvement Permit.

Please review the attached system sketch and design specifications for the Improvement Permit. Any additions or revisions you feel are necessary can be made on the Improvement Permit. Please call in you have and questions or comments.


S&ME, Inc.
105-D Denver Business Park Dr.
Mooresville, North Carolina 28115-7926

(704) 662-8625
(704) 662-8735 fax
www.smeinc.com

Design Specifications for Lot 177 at The Sanctuary
MCHD File # 5769B

Daily Design Flow:	600 gpd
Number Bedrooms:	5 bedroom
Basement or Crawl Space:	Basement
Septic Tank Size:	1500 gal
Pump Tank Size:	1500 gal
Primary System Loading Rate:	**0.3 gpd/ft^2**
Primary System:	**25% reduction**
Number and length of laterals:	4 @ 125 ft.
Total ft. of primary system:	500 ft.
Flow Rate through system:	22 gpm – use ½ in. SCH 80 taps with 2 ft. head pressure on pressure manifold (5.5 gpm per tap)
Pump Requirements:	to be calculated by installer when specific house and pump tank locations are available
Dosing Volume:	approx. 270 gal. – 2.2 doses/day at design flow
Depth of effluent pumped per dose:	calculated to specific tank by measure or dealer engineering specifications (1 cubic ft. of water equals 7.48 gal.)
Check Valve:	yes
Siphon break hole:	no
Repair System Loading Rate:	**0.3 gpd/ft^2**
Repair System:	**25% reduction**
Total ft. of repair	600 ft.

Notes: This lot utilizes an off-site septic area for the drainfield. (revision to Feb. 2, 2005 plan with system on-site)

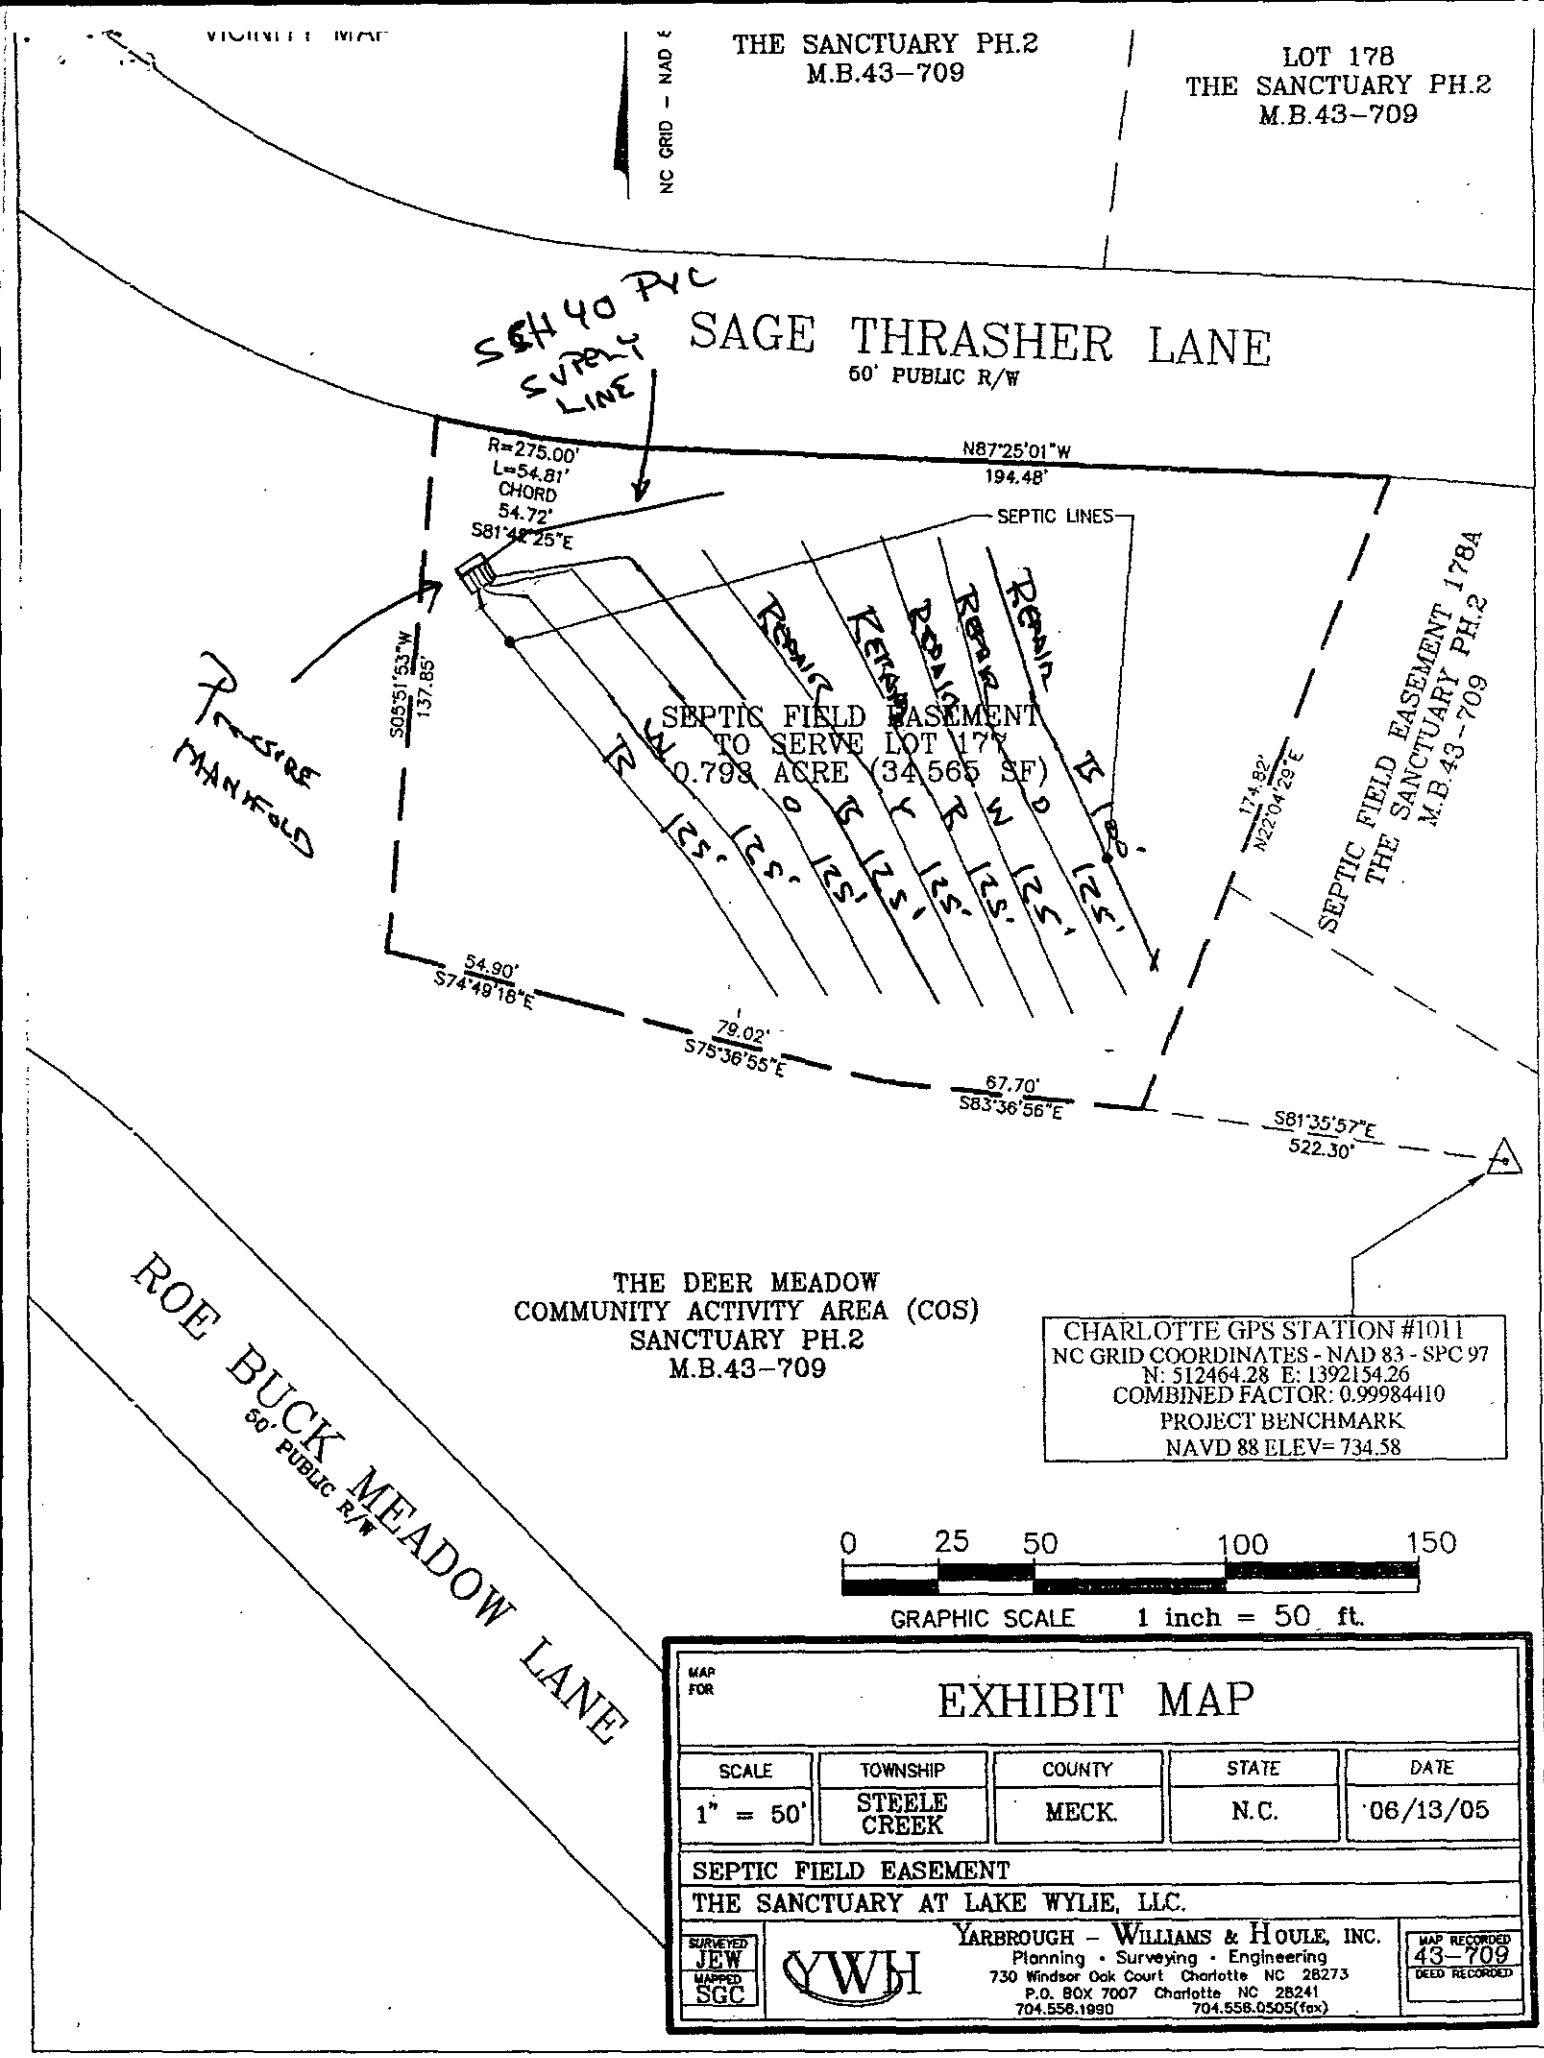

MAP FOR

EXHIBIT MAP

SCALE	TOWNSHIP	COUNTY	STATE	DATE
1" = 50'	STEELE CREEK	MECK.	N.C.	06/13/05

SEPTIC FIELD EASEMENT


THE SANCTUARY AT LAKE WYLIE, LLC.

SURVEYED JEW
MAPPED SGC

YWH

YARBROUGH – WILLIAMS & HOULE, INC.
Planning · Surveying · Engineering
730 Windsor Oak Court Charlotte NC 28273
P.O. BOX 7007 Charlotte NC 28241
704.556.1990 704.556.0505(fax)

MAP RECORDED 43–709
DEED RECORDED

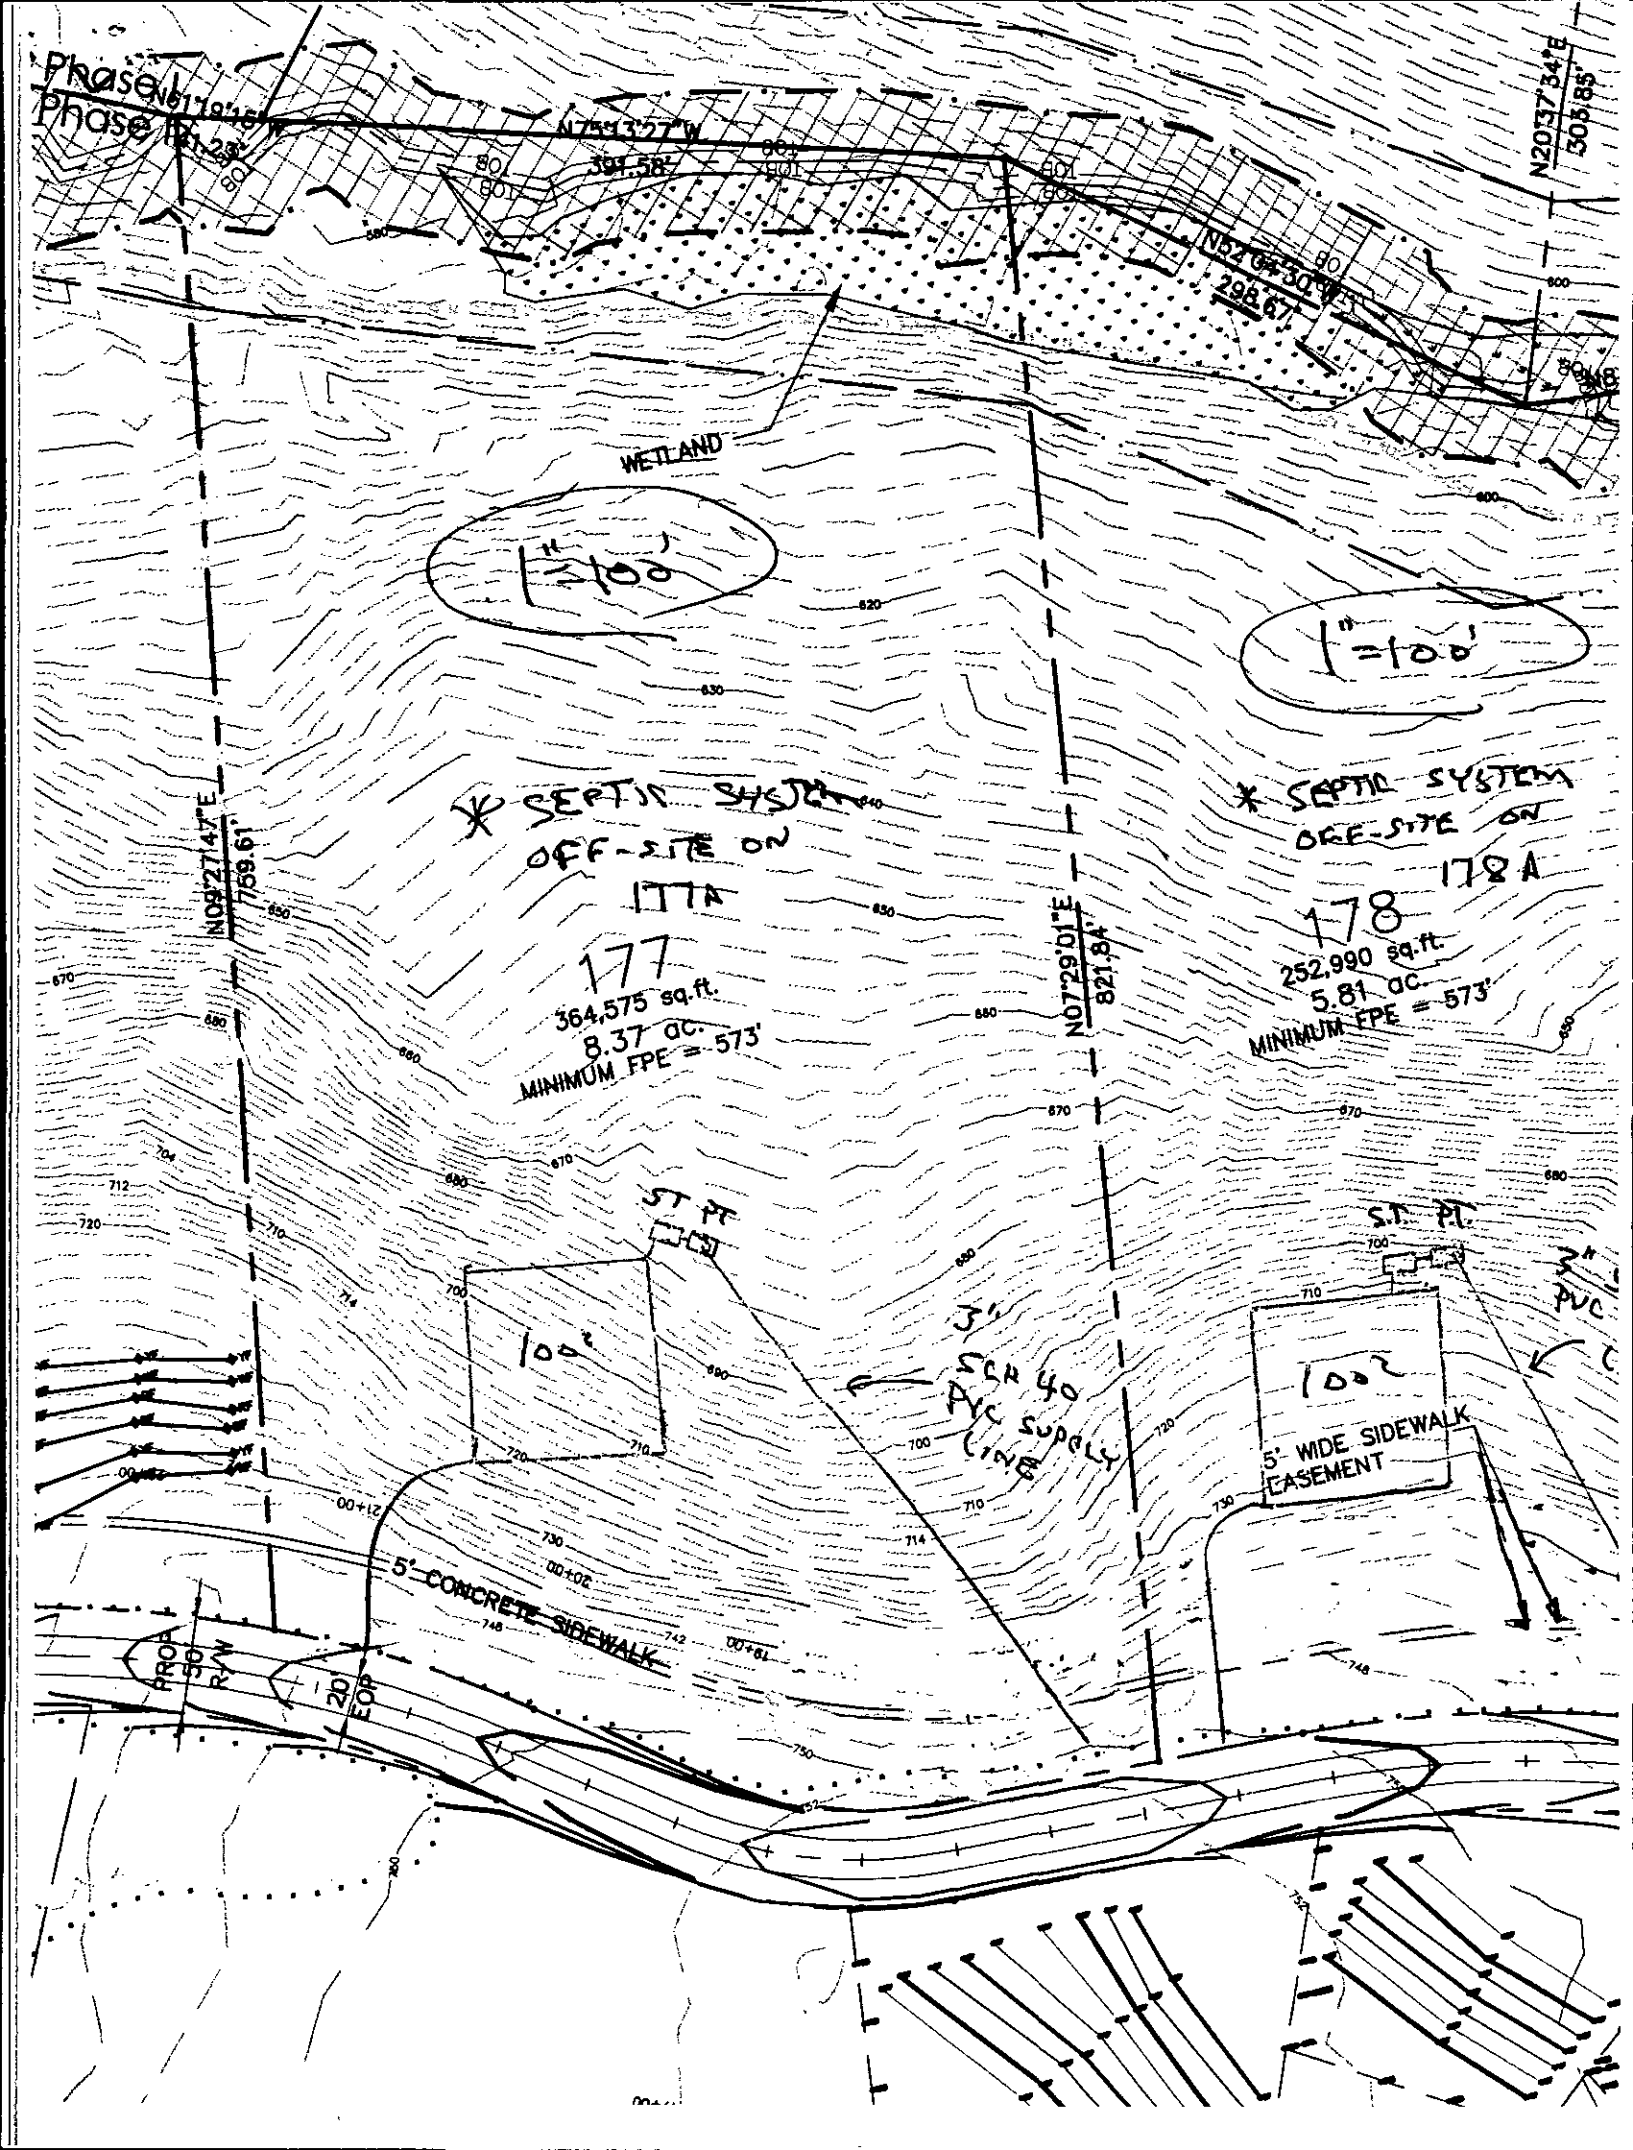
Phase I
Phase IX
N75°13'27"W
391.58'
N52°04'30"W
298.67'
N20°37'34"E
305.85'
WETLAND
1"=100'
1"=100'
* SEPTIC SYSTEM OFF-SITE ON 177A
177
364,575 sq.ft.
8.37 ac.
MINIMUM FPE = 573'
* SEPTIC SYSTEM OFF-SITE ON 178A
178
252,990 sq.ft.
5.81 ac.
MINIMUM FPE = 573'
N09°27'47"E
769.61'
N07°29'01"E
821.84'
S.T. PT.
S.T. PT.
10ø
10ø
3" SCH 40 PVC SUPPLY LINE
5' WIDE SIDEWALK EASEMENT
5' CONCRETE SIDEWALK
PROP 50' R/W
20' EOP

FEE: 200 Chg 1756 — 200.00 5/27/05 Check 8921

DATE: 1/13/05

APPLICATION FOR IMPROVEMENT PERMIT
FOR RESIDENTIAL SITE
INDIVIDUAL WATER AND WASTEWATER
SYSTEMS PROGRAM

CKA
Change Septic location
[ ] CRT

TYPE APPLICATION: ___ NEW SYSTEM ___ EXPANSION/ ALTERATION OF EXISTING SYSTEM ___ REPAIR OF EXISTING SYSTEM

NORTH CAROLINA
DEPARTMENT OF ENVIRONMENT,
HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

FILE #: 37698

PROPERTY INFORMATION (FROM ENGINEERING FORM) FOR JOB LOCATION:

TAX/PARCEL NUMBER: 199-371-03 & 02

STREET ADDRESS: Island Point Rd

SUBDIVISION OR MOBILE HOME PARK NAME: The Sanctuary At Lake Wylie, LLC II

LOT NUMBER: 177

TYPE OF BUILDING (CHECK ONE):

___ SINGLE MOBILE HOME(S)
___ DOUBLE WIDE (D)
___ HOUSE (H)
___ MODULAR HOME (M)
___ MULTIPLE FAMILY (U)
___ OTHER (O)

TOWNSHIP (CHECK ONE):

✓ 0 MECKLENBURG
___ 1 CHARLOTTE
___ 2 DAVIDSON
___ 3 CORNELIUS
___ 4 PINEVILLE
___ 5 MATTHEWS
___ 6 HUNTERSVILLE
___ 7 MINT HILL

HEATED SQUARE FOOTAGE:

NUMBER OF BEDROOMS:

NUMBER OF OCCUPANTS:

CLOSING DATE _____

FOUNDATION FOR RESIDENCE:

___ WITHOUT BASEMENT
___ ON SLAB
___ CRAWL SPACE
___ WITH BASEMENT /PLUMBING
___ WITH BASEMENT /NO PLUMBING

IF EXPANSION/ALTERATION OF EXISTING SYSTEM, DESCRIBE THE PROPOSED BUILDING ADDITION:

WILL THERE BE A HOME BUSINESS IN THE RESIDENCE: ___ YES ✓ NO TYPE: _____

WATER SUPPLY (CHECK ONE):

___ COMMUNITY (C)
___ SHARED WELL (S)
✓ MUNICIPAL (M)
___ OTHER 'SPRINGS' (O)
___ PRIVATE WELL (P)

IF ANY OF THE FOLLOWING ARE LOCATED ON THE PROPERTY, PLEASE SHOW LOCATION ON PLAT:

BURIED CABLES, LANDFILLS, STUMPHOLES	___ YES ✓ NO	WELL, SPRINGS OR WATERLINES	___ YES ✓ NO
EXISTING WASTEWATER SYSTEMS	___ YES ✓ NO	DESIGNATED WETLANDS	___ YES ✓ NO
EASTMENTS OR RIGHT-OF-WAYS	✓ YES ___ NO		

PROPERTY OWNER:

NAME: (LAST) The Sanctuary at Lake Wylie, LLC (FIRST) (MI)

ADDRESS: 10933 Ballantyne Crossing Ave

CITY: Charlotte STATE: NC ZIP: 28277

DAYTIME PHONE: 704 544-0201 ext 226

LEGAL AGENT FOR PROPERTY OWNER, IF APPLICABLE:

NAME: (LAST) Jacobs (FIRST) Tonya (MI) C

DAYTIME PHONE: 704 583-6905

m 704 582 9219

WHAT DATE WAS THE PROPERTY ORIGINALLY DEEDED AND RECORDED? _____

An Improvement Permit is subject to suspension or revocation if site plans or the intended use change or if information submitted in this application is falsified or changed. The undersigned, owner, or legal agent for the owner, of the property described above as the "Job Location" has read the foregoing application, acknowledges that the contents of same are true, and authorizes agents of the Mecklenburg County Health Department to enter onto the property for the purpose of processing this request.

SIGNED: Tonya C Jacobs, CPSS (Agent) DATE: 11/2/04

MECKLENBURG COUNTY HEALTH DEPARTMENT
ENVIRONMENTAL HEALTH DIVISION
c/o HAL MARSHALL CTR., SUITE 211, 700 N. TRYON ST., CHARLOTTE, N.C. 28202., (704) 336-5102

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID # PO 199-371-03
Lot #: 177, alternate drainfield site
File #: 5769B
Code: 1

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Owner: The Sanctuary at Lake Wylie
Address: 10933 Ballantyne Crossing Ave., Charlotte, N. C. 28277
Proposed Facility: Residence Design Flow (.1949): 600gpd
Location of Site: Sage Thrasher Lane
Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [x] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

Applicant: Toney C. Jacobs
Date Evaluated: 6/14/2005
Property Size: .3a inv.
Property Recorded:

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 .1941 Structure/ Texture	SOIL MORPHOLOGY .1941 .1941 Consistence Mineralogy	OTHER PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
1	LS, 5	0-11	GR/CL	FR/SEXP/SS/SP	>48" TO SOIL WETNESS	48	N/A	NONE	PS, IV .3GPD/FT^2
		11-48	SBK/C	FI/SEXP/S/P					
2	"	0-9	GR/CL	FR/SEXP/SS/SP	"	"	"	"	"
		9-48	SBK/C	FI/SEXP/S/P					
3	"	0-11	GR/CL	FR/SEXP/SS/SP	"	"	"	"	"
		11-48	SBK/C	FI/SEXP/S/P					

Description	Initial System	Repair System
Available Space (.1945)	PS	PS
System Type(s)		
Site LTAR	.3GPD/FT^2	.3GPD/FT^2


Other Factors (.1946):
Site Classification (.1948): PROVISIONALLY SUITABLE
Evaluated By: W. R. Marlin, LSS, 6/16/2005. W. R. Marlin
Others Present:

COMMENTS:
100% repair, alternate site located in COS across Sage Thrasher Lane

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Food Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace		CL-Clay Loam		
FP-Flood Plain		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

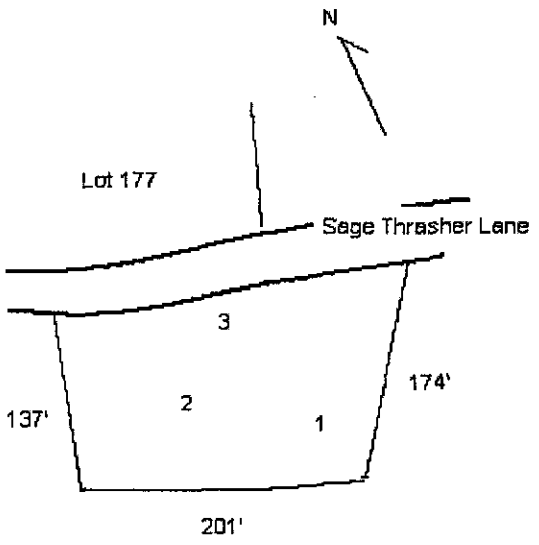

FEE: 200 Chk 1756 — 200.00 5/27/05 Check 8921

DATE: 1/13/05

APPLICATION FOR IMPROVEMENT PERMIT
FOR RESIDENTIAL SITE
INDIVIDUAL WATER AND WASTEWATER
SYSTEMS PROGRAM

OKA
Change Septic location
1 1 CRT

TYPE APPLICATION: ___ NEW SYSTEM ___ EXPANSION/ ALTERATION OF EXISTING SYSTEM ___ REPAIR OF EXISTING SYSTEM

NORTH CAROLINA
DEPARTMENT OF ENVIRONMENT,
HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

FILE #: 5769B

PROPERTY INFORMATION (FROM ENGINEERING FORM) FOR JOB LOCATION:

TAX/PARCEL NUMBER: 199-371-03 & 02

STREET ADDRESS: Island Point Rd

SUBDIVISION OR MOBILE HOME PARK NAME: The Sanctuary at Lake Wylie, LLC II

LOT NUMBER: 177

TYPE OF BUILDING (CHECK ONE):

___ SINGLE MOBILE HOME(S)
___ DOUBLE WIDE (D)
___ HOUSE (H)
___ MODULAR HOME (M)
___ MULTIPLE FAMILY (U)
___ OTHER (O)

TOWNSHIP (CHECK ONE):

✓ 0 MECKLENBURG
___ 1 CHARLOTTE
___ 2 DAVIDSON
___ 3 CORNELIUS
___ 4 PINEVILLE
___ 5 MATTHEWS
___ 6 HUNTERSVILLE
___ 7 MINT HILL

HEATED SQUARE FOOTAGE:

NUMBER OF BEDROOMS:

NUMBER OF OCCUPANTS:

CLOSING DATE _____

FOUNDATION FOR RESIDENCE:

___ WITHOUT BASEMENT
___ ON SLAB
___ CRAWL SPACE
___ WITH BASEMENT /PLUMBING
___ WITH BASEMENT /NO PLUMBING

IF EXPANSION/ALTERATION OF EXISTING SYSTEM, DESCRIBE THE PROPOSED BUILDING ADDITION:

WILL THERE BE A HOME BUSINESS IN THE RESIDENCE: ___ YES ✓ NO TYPE: _____

WATER SUPPLY (CHECK ONE):

___ COMMUNITY (C)
✓ MUNICIPAL (M)
___ PRIVATE WELL (P)
___ SHARED WELL (S)
___ OTHER 'SPRINGS' (O)

IF ANY OF THE FOLLOWING ARE LOCATED ON THE PROPERTY, PLEASE SHOW LOCATION ON PLAT:

BURIED CABLES, LANDFILLS, STUMPHOLES	___ YES ✓ NO	WELL, SPRINGS OR WATERLINES	___ YES ✓ NO
EXISTING WASTEWATER SYSTEMS	___ YES ✓ NO	DESIGNATED WETLANDS	___ YES ✓ NO
EASTMENTS OR RIGHT-OF-WAYS	✓ YES ___ NO		

PROPERTY OWNER:

NAME: (LAST) The Sanctuary at Lake Wylie, LLC (FIRST) (MI)

ADDRESS: 10933 Ballantyne Crossing Ave

CITY: Charlotte STATE: NC ZIP: 28277

DAYTIME PHONE: (704) 544-0201 ext 226

LEGAL AGENT FOR PROPERTY OWNER, IF APPLICABLE:

NAME: (LAST) Jacobs (FIRST) Tonay (MI) C

DAYTIME PHONE: 704 663-6965

m 704 582 9219

WHAT DATE WAS THE PROPERTY ORIGINALLY DEEDED AND RECORDED? _____

An Improvement Permit is subject to suspension or revocation if site plans or the intended use change or if information submitted in this application is falsified or changed. The undersigned, owner, or legal agent for the owner, of the property described above as the "Job Location" has read the foregoing application, acknowledges that the contents of same are true, and authorizes agents of the Mecklenburg County Health Department to enter onto the property for the purpose of processing this request.

SIGNED: Tonay C Jacobs, CPSS (Agent) DATE: 11/24/04

MECKLENBURG COUNTY HEALTH DEPARTMENT
ENVIRONMENTAL HEALTH DIVISION
c/o HAL MARSHALL CTR., SUITE 211, 700 N. TRYON ST., CHARLOTTE, N.C. 28202., (704) 336-5102

MECKLENBURG COUNTY
LAND USE AND ENVIRONMENTAL SERVICES
Payment Receipt

Receipt Information

Date: 05/27/05
Receipt #: 34853
Check / Auth #: CHECK 8921
Received By: AIDOOJK

Amount: 200.00
Tendered: 200.00
Returned: 200.00

Account Information

Account #: 200000
Contractor: S&ME
Attn:
Address: 3718 OLD BATTLEGROUND ROAD
Address:
City/State/Zip: GREENSBORO, NC 27410

Item	Description	Permit#	Quantity	Unit Price	Total Price
0701	Improvment Permit App-Residen ISLAND POINT ROAD -LOT 177		1	200.00	200.00

----------Outstanding Balances----------

Month-To-Date	Prior Month	30 Days	60 Days	90 Days	Balance

CONDITIONS OF IMPROVEMENT PERMIT

Permit Number: **5769B** Tax Number: **199-371-03**

- The IMPROVEMNET PERMIT is subject to revocation if site plans or the intended use change. There is to be **NO** grading, filling, or disturbance of the soil in the area of the septic tank system or repair area.
- CONSTRUCTION AUTHORIZATION must be obtained prior to receiving a Building Permit. The Construction Authorization is **NOT** transferable. Do not clear, grade, fill or disturb soil prior to obtaining a Construction Authorization.
- Domestic-type wastewater only. No industrial process wastewater may be discharged into the system.

Basement: ☒ Yes ☐ No ☐ Partial Basement

Primary Wastewater System

Type: ☐ I ☐ II ☒ III ☐ IV ☐ V ☐ VI

☐ Conventional
☐ Prefabricated, permeable block panel system
☐ Shallow Placed Conventional
☐ Low Pressure Pipe
☐ Large Diameter Pipe
☐ Fill
☐ Other
☒ Innovative or Experimental:

0.3 Long-term acceptance rate (GPD/ft^2)	600 Max gallons/day wastewater flow	1500 Absorption Area (ft^2)	9 Trench spacing (min. on centers) (ft)
Serviced by private well: ☐ Yes ☒ No	1500 Gallon septic tank	500 Total trench length (ft)	24 Maximum trench depth (in) (At least 12" of provisionally suitable soil must remain between trench bottom and unsuitable soil conditions.)
5 Bedrooms in residence	1500 Gallon pump tank	na Depth of stone (in)	

Any surface water present: **No** Type: Minimum separation distance (ft):

Additional conditions: **Install according to plans on file submitted by Toney Jacobs and Associates. Lot #177**

Repair Area System

Type: ☐ I ☐ II ☒ III ☐ IV ☐ V ☐ VI

☐ Conventional
☒ Prefabricated, permeable block panel system
☐ Shallow Placed Conventional
☒ Low Pressure Pipe
☐ Large Diameter Pipe
☐ Fill
☐ Other
☐ Innovative or Experimental:

1000 Absorption Area (ft^2) 333 Total trench length (ft)	na Depth of stone (in)	8 Trench spacing (min. on centers) (ft)	24 Maximum trench depth (in)

The undersigned, an authorized agent of the MECKLENBURG COUNTY HELTH DEPARTMENT, certifies that the Department has approved the Request for the Job Location contained in this document. The approval is granted in accordance with the provisions of Laws and Rules For Sewage, Treatment and Disposal in effect at the time of issuance of the permit and is subject to the following provisions:

*** No work shall be conducted on the septic tank system until an Installation, Construction, Alteration and/or Repair Approval is granted by this Department.

*** This Improvement permit is transferable.

DENR Authorized Agent Date 3/15/05

Owner/Agent Signature Date 3-15-05

MECKLENBURG COUNTY
HEALTH DEPARTMENT
ENVIRONMENTAL HEALTH DIVISION
c/o HAL MARSHALL CTR.
SUITE 211
700 N. TRYON ST.
CHARLOTTE, NC 28202
(704) 336-5103

NORTH CAROLINA DEPARTMENT OF
ENVIRONMENTAL, HEALTH, AND
NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: PO 199-371-03
Lot #: 177
File #: 5769B
Code: 1

ACS

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Owner: The Sanctuary at Lake Wylie
Applicant: Toney Jacobs
Address: 10933 Ballantyne Crossing Ave., Charlotte, N. C. 28277
Date Evaluated: 12/30/2004
Proposed Facility: Residence
Design Flow (.1949): 600gpd
Property Size: 1.0a inv.
Location of Site: Sage Thrasher Lane
Property Recorded:
Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [x] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 .1941 Structure/ Texture	.1941 Consistence Mineralogy	OTHER PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
1	HS, 20	0-7	GR/SCL	FR/SEXP/SS/SP	>48" TO SOIL WETNESS	48	N/A	NONE	PS, IV .3GPD/FT^2
		7-48	SBK/C	FI/SEXP/S/P					
2	LS, 15	0-8	GR/SCL	FR/SEXP/SS/SP	"	"	"	"	"
		8-48	SBK/C	FI/SEXP/S/P					
3	LS, 10	0-9	GR/SCL	FR/SEXP/SS/SP	>50" TO SOIL WETNESS	50	"	"	"
		9-50	SBK/C	FI/SEXP/S/P					
4	LS, 8	0-6	GR/SCL	FR/SEXP/SS/SP	>48" TO SOIL WETNESS	48	"	"	"
		6-48	SBK/C	FI/SEXP/S/P					

Description	Initial System	Repair System
Available Space (.1945)	PS	PS
System Type(s)		
Site LTAR	.3GPD/FT^2	.3GPD/FT^2


Other Factors (.1946):
Site Classification (.1948): PROVISIONALLY SUITABLE
Evaluated By: W. R. Marlin, LSS, 1/4/2005.
Others Present:

COMMENTS:
100% repair

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace		CL-Clay Loam		
FP-Flood Plain		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

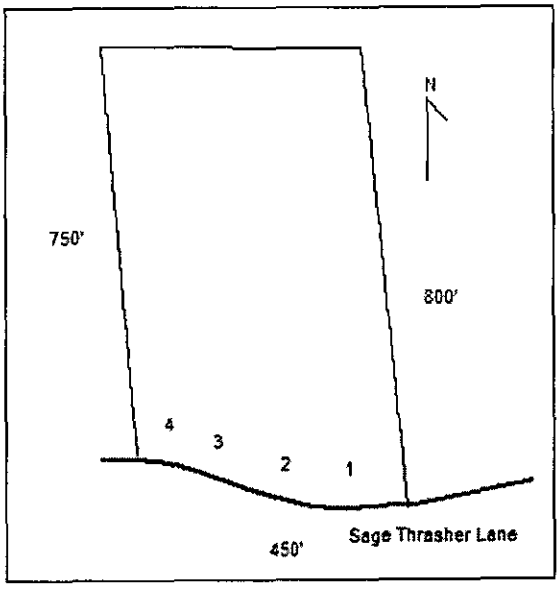

TONEY C. JACOBS & ASSOCIATES, INC.

Consulting Soil Scientists

Licensed by the North Carolina Board for Licensing of Soil Scientists

Certified by the American Registry of Certified Professionals in Agronomy, Crops and Soils

168 Broadbill Drive
Mooresville, NC 28117
Phone (704) 663-6905
Fax (704) 662-9845 E-mail jacobs@i-america.net

February 2, 2005

To: Mr. David Cornelius, R.S.
Mecklenburg County Env. Health Dept.

From : Toney C. Jacobs
Paul G. Penninger

RE: Request for an Improvement Permit for lot 177 at The Sanctuary:
MCHD file # 5769B

Crescent Resources is requesting an Improvement Permit for lot **177** at The Sanctuary Subdivision for a **5** bedroom, basement home. Mr. Bill Marlin of the MCHD evaluated the soils on 1- 4-05 and determined the septic area is PS at an 0.3 gpd/ft^2 LTAR. Toney C. Jacobs and Associates, Inc. has flagged a 25% reduction septic system and PPBPS repair on the lot, as shown on the attached sketch.

We understand a building permit cannot be issued until your office issues an Authorization to Construct (ATC). The buyer of the lot will apply for the ATC. If the buyer's house pad does not fit in the "building envelope" shown on the Improvement Permit, we understand the proposed system may have to be modified prior to your office issuing the ATC. **No grading shall take place on lot prior to obtaining the ATC from the MCHD.**

Tri-County Wastewater (TCWW) is under contract to supply maintenance services for each septic system installed at The Sanctuary. TCWW will have a list of preferred septic contractors for the subdivision and will also have requirements for the installation of the septic systems that are greater that the state requirements. It will be the responsibility of TCWW to enforce any requirements above state requirements or the conditions on the Improvement Permit or ATC.

Please review the attached system sketch and design specifications for the Improvement Permit. Please call if you have and questions, comments, or corrections.

Design Specifications for Lot 177 at

The Sanctuary, MCHD File # 5769B

System Type:	primary: repair:	pressure manifold , 25% reduction LP PPBPS
Daily design flow:		600 gpd
Septic tank size:		1500 gal. (2 compartments)
Pumping tank size:		1500 gal.
Effluent loading rate:		0.3 gpd/ft^2 for primary and repair
Number and length of laterals:		3 @ 167 ft. 25% reduction
Flow rate through the system:		16.5 gpm –use ½ in. SCH 80 taps with 2 ft. head pressure on pressure manifold (5.5 gpm per tap)
Pump requirements:		to be calculated by installer or owners agent when specific house and pump tank location are available
Dosing volume:		approx. 270 gal. – 2.2 doses/day at design flow
Depth of water pumped per dose:		calculated to specific tank by measure or dealer engineering specifications (1 cubic ft. of water equals 7.48 gal.)
Check valve:		YES
Siphon break hole:		No

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: PO 199-371-03
Lot #: 177
File #: 5769B
Code: 1

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Owner: The Sanctuary at Lake Wylie
Applicant: Toney Jacobs
Address: 10933 Ballantyne Crossing Ave., Charlotte, N. C. 28277
Date Evaluated: 12/30/2004
Proposed Facility: Residence
Design Flow (.1949): 600gpd
Property Size: 1.0a inv.
Location of Site: Sage Thrasher Lane
Property Recorded:
Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [x] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 .1941 Structure/ Texture	.1941 Consistence Mineralogy	OTHER PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
1	HS, 20	0-7	GR/SCL	FR/SEXP/SS/SP	>48" TO SOIL WETNESS	48	N/A	NONE	PS, IV
		7-48	SBK/C	FI/SEXP/S/P					.3GPD/FT^2
2	LS, 15	0-8	GR/SCL	FR/SEXP/SS/SP	"	"	"	"	"
		8-48	SBK/C	FI/SEXP/S/P					
3	LS, 10	0-9	GR/SCL	FR/SEXP/SS/SP	>50" TO SOIL WETNESS	50	"	"	"
		9-50	SBK/C	FI/SEXP/S/P					
4	LS, 8	0-6	GR/SCL	FR/SEXP/SS/SP	>48" TO SOIL WETNESS	48	"	"	"
		6-48	SBK/C	FI/SEXP/S/P					

Description	Initial System	Repair System
Available Space (.1945)	PS	PS
System Type(s)		
Site LTAR	.3GPD/FT^2	.3GPD/FT^2


Other Factors (.1946):
Site Classification (.1948): PROVISIONALLY SUITABLE
Evaluated By: W. R. Marlin, LSS, 1/4/2005.
Others Present:

COMMENTS:
100% repair

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace		CL-Clay Loam		
FP-Flood Plain		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

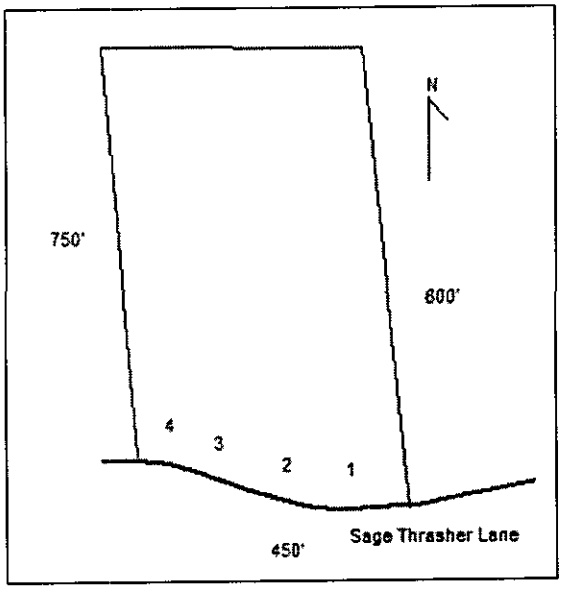

PROTECTED CORRIDOR 200' MAX.

Phase I
Phase II

N20°13'W
42.57'

N75°33'27"W
391.58'

N62°04'50"W
298.67'

N20°37'34"E
303.85'

N18°21'32"W
140.67'

WETLAND

N09°27'47"E
759.61'

ST. PT.

177
364,565 sq.ft.
8.37 ac.
MINIMUM FPE = 573'

N07°29'01"E
821.84'

2" SCH 40 PVC SUPPLY LINE

178
252,984 sq.ft.
5.81 ac.
MINIMUM FPE = 573'

N15°36'00"E
898.64'

40' SIDE SETBACK (TYP.)

DRIVE

PROP. 30' R/W

20' EOP

ADDITIONAL REPAIR

160' REPAIR

100' FRONT SETBACK (TYP.)

167' REPAIR

200' REPAIR

250' REPAIR

170'

N54°16'05"W
90.20'

L=130.18'
R=225.00

L=159.10'
R=275.00

N87°25'01"W
194.48'

Pressure Manifold

Primary System uses 3 Line at 167'

Primary Field uses 3 Lines at 170'

L=520.34'
R=625.00

Additional Repair

L=472.32'
R=575.00

L=306.33'
R=225.00

COS
15.67 AC

Roe Buck Meadow Lane

L=238.25'
R=175.00

N44°12'47"W
205.75'

100' FRONT SETBACK (TYP.)

L=337.49'
R=726.11

L=361.36'
R=776.01

SEE CHAPTER 1 FOR BOUNDARY INFORMATION

5' WIDE SIDEWALK EASEMENT

TRUNCATED DOMES CMLD DET. 10.35B AT 16

Primary Field uses 3 Lines

Flying

N24°27'33"E

N67°33'23"E

15+00

+32.08

+92.08

L=218.13'
R=625.00

N63°24'27"

450'

Primary Field uses 3 Lines

Additional Repair

2" SCH 40 PVC SUPPLY LINE

Repair

Repair


Pressure Manifold


2" SCH 40 PVC SUPPLY LINE

Primary Field uses 3 Lines at 170'

SL 2009-406
Effective Aug 5, 2009

REVISED **SL 2010-177**
HOUSE BILL 683
Effective 2 August 2010

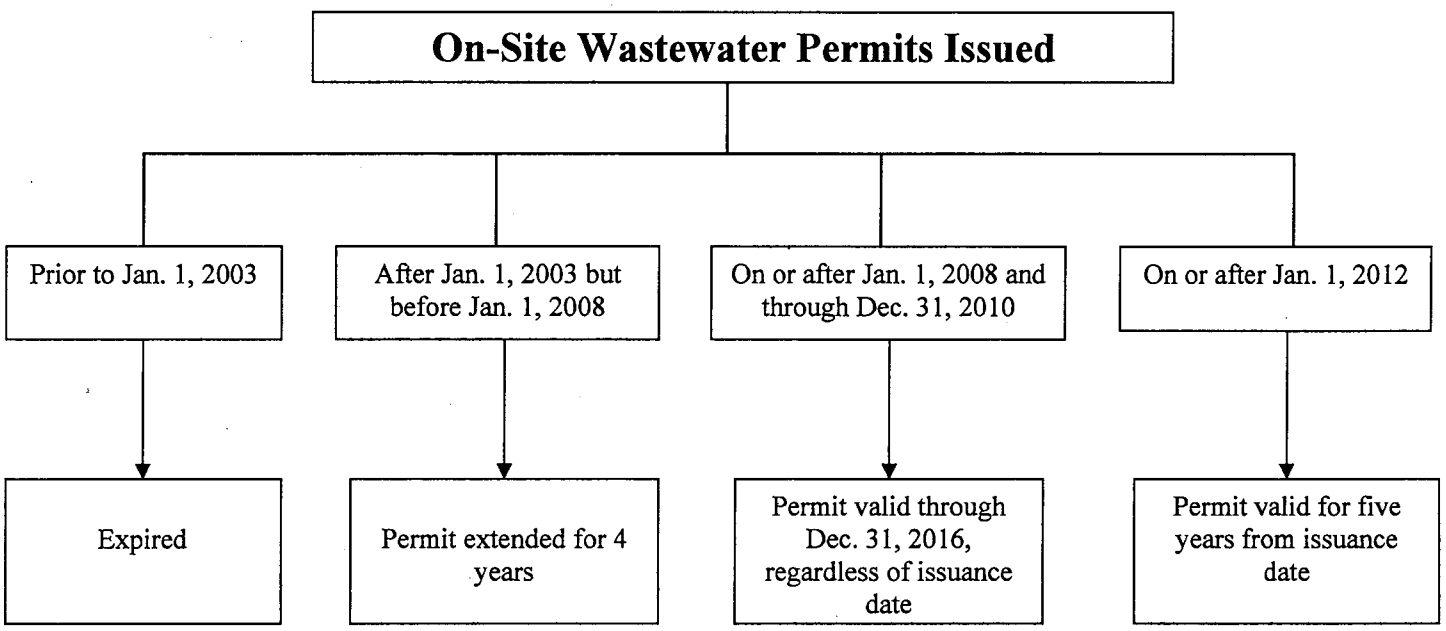

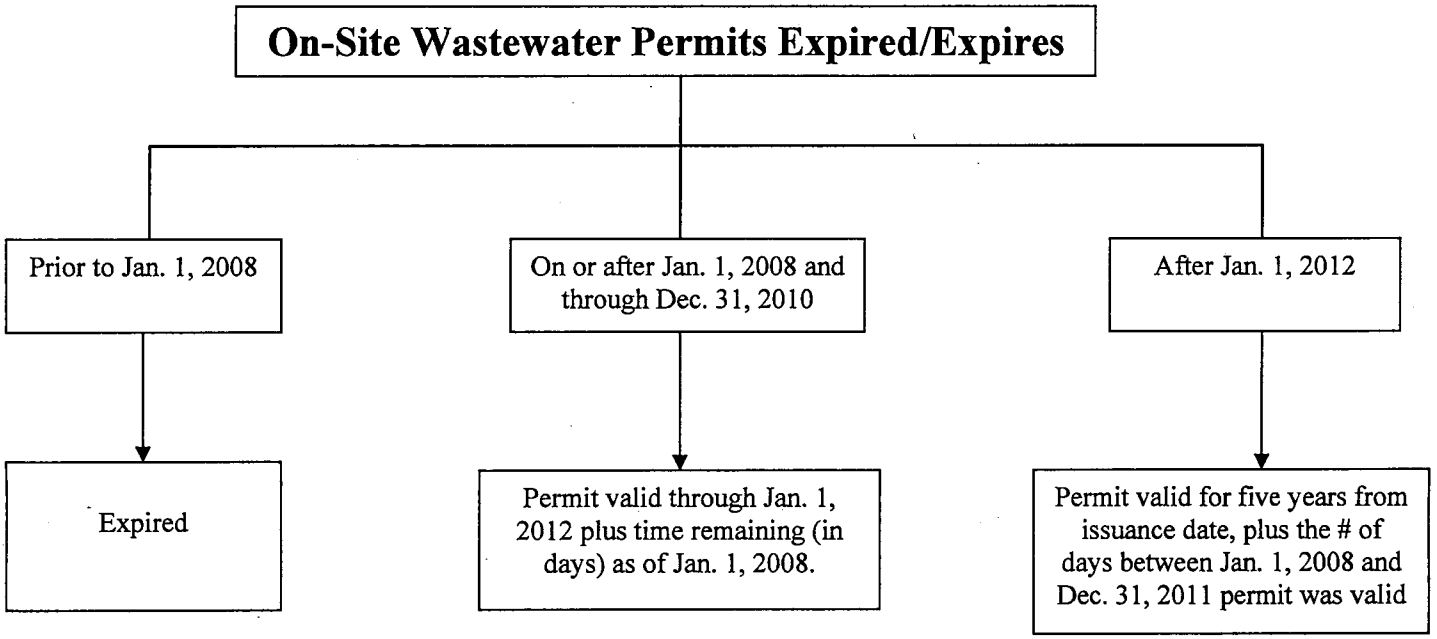

Craig, Gwen

From: Corbitt, Lisa
Sent: Thursday, June 02, 2011 7:12 PM
To: Randall, Kelly; Craig, Gwen
Subject: Permit extentions

I took this home to look at it and I handed it to Matt and he figured it out in about 2 minutes.

I was reading it wrong. The permit will expire june 2014. We can talk about it Monday but go ahead and call them back. Gwen place a note in the file.

MiA

241-6729 ~

302-1982

① is permit still valid w/extension by Senate appears to be extended Bill through 12/31/11

② if so can changes be made

Wait for Kelly to look at 6/14/11