Date Received 8-16-79

MECK COUNTY DEPARTMENT OF
RECEIVED
OCT 4 1979
ENVIRONMENTAL HEALTH

APT No. 16203

T. C. No. 113-181-07

Map Date

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH

APPLICATION FOR SOIL INVESTIGATION

1) NAME OF OWNER Reid (LAST) Edwin (FIRST) (MIDDLE)

2) ADDRESS OF OWNER [illegible] ZIP 37207

3) PHONE NO Home 528-3223 Office 329-[illegible]


4) LOCATION OF PROPERTY 4132 MT OLIVE [illegible] (STREET OR COUNTY ROAD)

5) SUBDIVISION _____ LOT NO _____ BLOCK NO 31

MAP BOOK NO 113 PAGE NO 18

6) DEED REFERENCE DEED BOOK 1960 PAGE NO [illegible]

Application is hereby made to the Mecklenburg County Department of Environmental Health for the conduct of a soil investigation and an on site inspection of the lot hereinabove described for the purpose of determining if the lot is suitable for the installation of an individual septic tank wastewater treatment system with subsurface, soil absorption, effluent discharge.

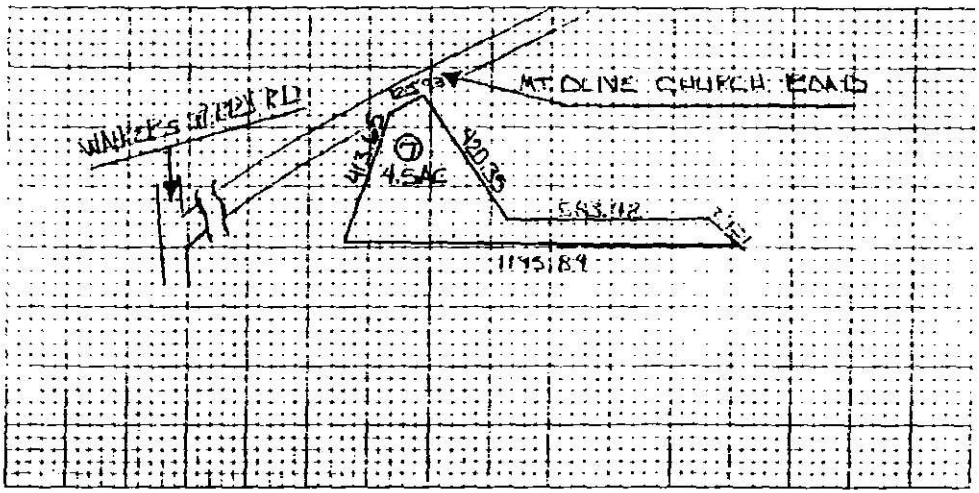

7) ACCURATELY DIAGRAM & DIMENSION LOT

Eddie W. S. Reid
OWNER

EHD-5-76

Environmental Health Department's Copy

S. I. R. NO. 10203

NORTH CAROLINA
DEPARTMENT OF HUMAN RESOURCES
DIVISION OF HEALTH SERVICES
RALEIGH, NORTH CAROLINA

APPENDIX II
SITE EVALUATION

T. C. # 113-181-07

(Ground Absorption Sewage Disposal)

OWNER: Eddie Reid
ADDRESS: 1600 Wayne Meadow Ln.
COUNTY: Charlotte, N.C.
LOCATION OF SITE: Mt. Olive Church Road

DATE REQUESTED:
PLAT NO.:
LOT SIZE: Approx 1 Acre

FACTORS	AREA 1	AREA 2	AREA 3	AREA 4
1. SLOPE (%)	S (PS) U — 2-10 % 10-20 %	S PS U — 2-10 %	S PS U — 2-10 %	S PS U +
2. SOIL TEXTURE (12-36 in.) (Sandy, loamy, clayey, Note 2:1 Clay)	S PS (U) — 2-1 Clay	S PS (U) — 2-1 Clay	S PS (U) — 2-1 Clay	S PS U
3. SOIL STRUCTURE (12-36 in.) (Clayey Soils)	S PS (U) — Massive	S PS (U) — Massive	S PS (U) — Massive	S PS U
4. SOIL DEPTH (In.)	S PS (U) — 48"	S PS (U) — 48"	(S) PS U — 48"	S PS U
5. RESTRICTIVE HORIZONS (In.) (Impervious Strata, Rock)	S PS (U) — Saprolite shallow	(S) PS U — None	(S) PS U — None	S PS U
6. SOIL DRAINAGE/GROUNDWATER (External & internal)	S PS (U) — Potential Lateral water movement	(S) PS U — 76 to ground water	S PS (U) — Seasonal perched water table	S PS U
7. SOIL PERMEABILITY (Percolation Rate)	S PS (U) — V. Slow	S PS (U) — V slow	S PS (U) — V. slow	S PS U
8. OTHER (Specify)	S PS U	S PS U	S PS U	S PS U
9. SITE CLASSIFICATION	unsuitable	unsuitable	unsuitable	
SOIL SERIES	Wilkes	Mecklenburg	Helena	

S - Suitable PS - Provisionally Suitable U - Unsuitable

* See Diagram on Back (Include: Soil areas, property lines, roads, streams, gullies wet areas, fill areas, wells, water bodies, slope patterns, etc

Recommendations/Comments:

Described By: William A. Meeks

Title: Soil Scientist Date: 10-31-79

DHS Form 2601
Sanitation
EHD 539 (3/79)

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH
1200 BLYTHE BOULEVARD
CHARLOTTE, NORTH CAROLINA

SITE INVESTIGATION REPORT
INDIVIDUAL SEPTIC TANK SYSTEM
WITH SUBSURFACE,
SOIL ABSORPTION,
EFFLUENT DISCHARGE

SIR.NO. 16203
T.C.NO 113-181-07
MAP DATE
DATE Nov. 1, 1979

NAME OF OWNER Reid, Eddie Willette S.

ADDRESS OF OWNER 1600 Haynes Meade Circle

LOCATION OF LOT 4432 Mount Olive Church Road, Lot 7

At your request and pursuant to Section .1900 of the North Carolina Administrative Code, Title 10, Department of Human Resources, Chapter 10, Health Services, Subchapter 10A, a site evaluation has been made for an on premises ground absorption sewage disposal system on the property designated above and the following conditions were found:

Soil Structure Massive
Soil Permeability Unsuitable

Sites classified as Unsuitable are not acceptable for soil absorption of sewage effluent. However, if engineering, geologic, soil, and environmental studies indicate that a suitable septic tank system or a suitable alternate system can be expected to function satisfactorily, such sites may be re-classified as Provisionally Suitable. (Section 10 of the North Carolina Administrative Code 10 A,.1910)

If you desire to file for permission to install an "alternate or modified" system, you should present this office with your proposals in the form of plans and specifications. These would be reviewed and if it is found that the system may reasonably be expected to function satisfactorily, approval may be given on the execution by you of a "Septic Tank Agreement Form" available in this office.

John R. Adkisson

John R. Adkisson, Environmentalist

4

Date Received 8-16-79

MECK COUNTY DEPARTMENT OF
RECEIVED
OCT 4 1979
ENVIRONMENTAL HEALTH

APT No. 16203

T C No. 113-181-07

Map Date _____

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH

APPLICATION FOR SOIL INVESTIGATION

1) NAME OF OWNER Reid (LAST) Eddie W. & Kay (FIRST) (MIDDLE)

2) ADDRESS OF OWNER [illegible] ZIP 37207

3) PHONE NO. Home [illegible] Office 329-0520


4) LOCATION OF PROPERTY [illegible] (STREET OR COUNTY ROAD)

5) SUBDIVISION _____ LOT NO. 7 BLOCK NO. 31

MAP BOOK NO. 113 PAGE NO. 18

6) DEED REFERENCE DEED BOOK 1965 PAGE NO. 71

Application is hereby made to the Mecklenburg County Department of Environmental Health for the conduct of a soil investigation and on site inspection of the lot hereinabove described for the purpose of determining if the lot is suitable for the installation of an individual septic tank wastewater treatment system with subsurface, soil absorption effluent discharge

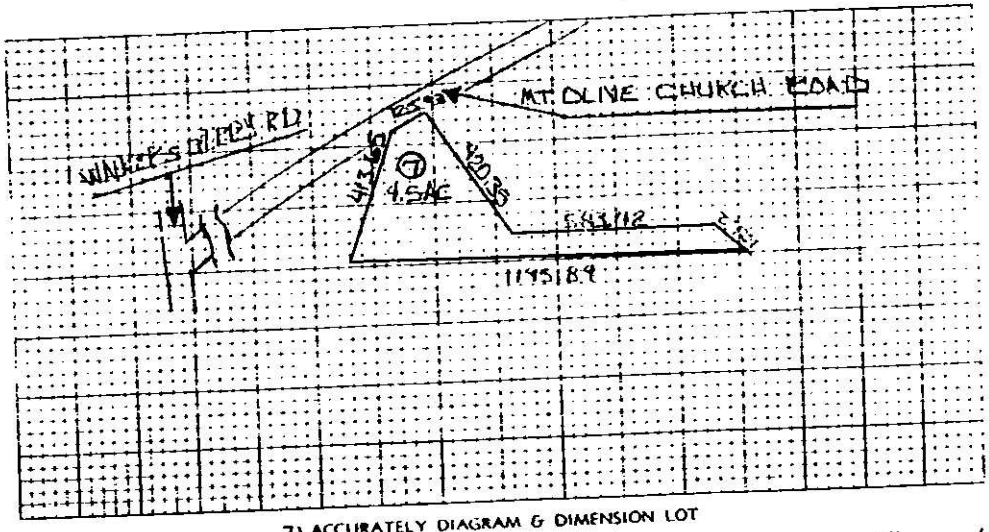

7) ACCURATELY DIAGRAM & DIMENSION LOT

Eddie W. & Kay Reid
OWNER

EHD-S-76

Environmental Health Department's Copy

NORTH CAROLINA
DEPARTMENT OF HUMAN RESOURCES
DIVISION OF HEALTH SERVICES
RALEIGH, NORTH CAROLINA

APPENDIX II
SITE EVALUATION

S. I. R. NO. 14203
T. C. # 113-191-07

(Ground Absorption Sewage Disposal)

OWNER: Eddie Reed
ADDRESS: 1600 Hagers Mountain Rd.
COUNTY: Iredell, N.C.
LOCATION OF SITE: Mr. Allen Church Rd.

DATE REQUESTED:
PLAT NO.:
LOT SIZE: Approx 160,000

FACTORS	AREA 1	AREA 2	AREA 3	AREA 4
1. SLOPE (%)	S (PS) 2-10 % 10-20% U	(S) PS 2-10 % U	(S) PS 2-10 % U	S PS U +
2. SOIL TEXTURE (12-36 in.) (Sandy loamy clayey, Note 2:1 Clay)	S PS 2-1 (U) Clay	S PS 2-1 (U) Clay	S PS 2-1 (U) Clay	S PS U
3. SOIL STRUCTURE (12-36 in.) (Clayey Soils)	S PS Massive (U)	S PS Massive (U)	S PS Massive (U)	S PS U
4. SOIL DEPTH (In.)	S PS 48" (U)	S PS 48" (U)	(S) 48" PS U	S PS U
5. RESTRICTIVE HORIZONS (In.) (Impervious Strata Rock)	S PS Saprolite (U) shallow	(S) None PS U	(S) None PS U	S PS U
6. SOIL DRAINAGE/GROUNDWATER (External & Internal)	S Potential PS Lateral water movement (U)	(S) 76 to ground water PS U	S Seasonal perched water table (U) PS	S PS U
7. SOIL PERMEABILITY (Percolation Rate)	S PS V. Slow (U)	S PS V Slow (U)	S PS V. slow (U)	S PS U
8. OTHER (Specify)	S PS U	S PS U	S PS U	S PS U
9. SITE CLASSIFICATION	unsuitable	unsuitable	unsuitable	
SOIL SERIES	Wilkes	Mecklenburg	Helena	

S - Suitable PS - Provisionally Suitable U - Unsuitable


* See Diagram on Back (Include: Soil areas, property lines, roads, streams, gullies wet areas, fill areas, wells, water bodies, slope patterns, etc

Recommendations/Comments:

Described By: William A. Morris

Title: Soil Scientist Date: 10-31-99

DHS Form 2601
Sanitation
EHD 539 (3/79)

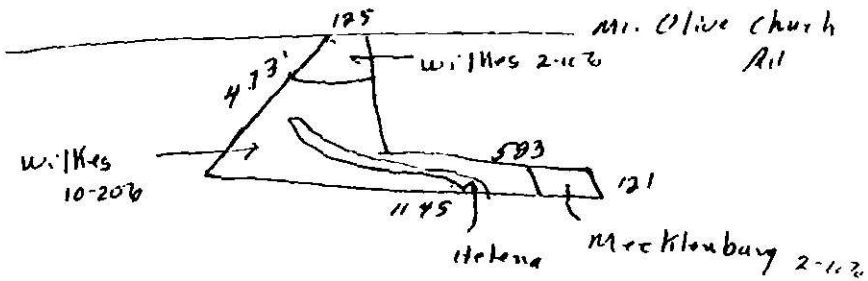
125
Mt. Olive Church Rd
Wilkes 2-1126
473'
Wilkes 10-2076
593
121
1145
Helena
Mecklenburg 2-1126

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH
1200 BLYTHE BOULEVARD
CHARLOTTE, NORTH CAROLINA

SITE INVESTIGATION REPORT
INDIVIDUAL SEPTIC TANK SYSTEM
WITH SUBSURFACE,
SOIL ABSORPTION,
EFFLUENT DISCHARGE

SIR.NO. 16203
T.C.NO 113-181-07
MAP DATE
DATE Nov. 1, 1979

NAME OF OWNER Reid, Eddie Willette S.

ADDRESS OF OWNER 1600 Haynes Meade Circle

LOCATION OF LOT 4432 Mount Olive Church Road, Lot 7

At your request and pursuant to Section .1900 of the North Carolina Administrative Code, Title 10, Department of Human Resources, Chapter 10, Health Services, Subchapter 10A, a site evaluation has been made for an on premises ground absorption sewage disposal system on the property designated above and the following conditions were found:

Soil Structure Massive
Soil Permeability Unsuitable

Sites classified as Unsuitable are not acceptable for soil absorption of sewage effluent. However, if engineering, geologic, soil, and environmental studies indicate that a suitable septic tank system or a suitable alternate system can be expected to function satisfactorily, such sites may be re-classified as Provisionally Suitable. (Section 10 of the North Carolina Administrative Code 10 A,.1910)

If you desire to file for permission to install an "alternate or modified" system, you should present this office with your proposals in the form of plans and specifications. These would be reviewed and if it is found that the system may reasonably be expected to function satisfactorily, approval may be given on the execution by you of a "Septic Tank Agreement Form" available in this office.

John R. Adkisson

John R. Adkisson, Environmentalist

4