

3513 GREY RD

00333101

1/11/2008

duponbj

Groundwater and Wastewater Services File Imaging Project
May 2007
Barcode Font = IDAutomationHC39M

Groundwater & Wastewater Services
Septic Project File & Data Review Worksheet

GWS File #: 7211 B WASPS App #: 2481

Primary ES assigned to project: PW

Secondary ES assigned to project:

Project Type: New System ☑ Alteration ☐ Repair ☐ Modified Plot Plan ☐

I. File Review:

Rule or Law				
	Permit Application			
.1937(d)	Is the Application complete	Yes ☑	No ☐	N/A ☐
.1937(d)	Is there a Site plan/Plat with application	Yes ☑	No ☐	N/A ☐
.1937(d)	Is the Facility shown?	Yes ☑	No ☐	N/A ☐
.1937(d)	Are appurtenances shown	Yes ☑	No ☐	N/A ☐
	Site Evaluation Information			
.1939 (a)(1)	Topography and Landscape Position Recorded?	Yes ☑	No ☐	N/A ☐
.1940 (a-g)	Slope % Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Texture Class Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Structure type Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Consistence Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Mineralogy Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(3)	Soil Wetness Condition Recorded?	Yes ☐	No ☐	N/A ☑
.1939 (a)(4)	Soil Depth to Rock or Parent Material Recorded When Encountered	Yes ☐	No ☐	N/A ☑
.1939 (a)(5)	Depth to Restrictive Horizons Recorded When Encountered?	Yes ☐	No ☐	N/A ☑
.1939 (a)(6)	Sufficient Available Space Recorded?	Yes ☑	No ☐	N/A ☐
.1937(m)	Are the Profile Locations Shown?			
.1939(a)	Are the S/PS Profiles in system & in repair area?	Yes ☑	No ☐	N/A ☐
& .1945(b)	Number of auger borings made: 3 Were sufficient auger borings made?	Yes ☑	No ☐	N/A ☐
.1939(d), .1955, .1956, .1957	LTAR .275	Yes ☑	No ☐	N/A ☐
	Improvement Permit/Construction Authorization			
.1937(g) 130A-336(a)	Proposed System Type stated-Initial	Yes ☑	No ☐	N/A ☐
.1945(b)	Proposed System Type stated-Repair	Yes ☑	No ☐	N/A ☐
130A-336 (a)(3)	System location identifiable by setbacks - Initial	Yes ☑	No ☐	N/A ☐
.1937(g) .1945(b)	System components shown – Initial	Yes ☑	No ☐	N/A ☐
.1945(b)	Repair area shown	Yes ☑	No ☐	N/A ☐
.1937 (f)(g)	Does System design match facility, flow & WWcharacteristics?	Yes ☑	No ☐	N/A ☐
.1937 (f)(g)	Is System design consistent with soil/site conditions?	Yes ☑	No ☐	N/A ☐
.1937 (f)(g)	Is the System located in the approved area?	Yes ☑	No ☐	N/A ☐
130A-336(a)	Is the Design flow (gpd) indicated?	Yes ☑	No ☐	N/A ☐

130A-336(a)	Number of Bedrooms, employees, seats, etc. indicated?	Yes ☑	No ☐	N/A ☐
.1937(g)	Trench depth indicated?	Yes ☑	No ☐	N/A ☐
.1937(g)	Trench width indicated?	Yes ☑	No ☐	N/A ☐
.1937(g)	Trench length indicated?	Yes ☐	No ☐	N/A ☐
130A-336(a)(1)	Proposed/existing well shown?	Yes ☑	No ☐	N/A ☐
130A-336(a)(1)	Property line lengths shown?	Yes ☑	No ☐	N/A ☐
130A-336(a)	Facility/appurtenance setbacks shown from fixed points?	Yes ☑	No ☐	N/A ☐

Operation Permit

.1937(i)	System type as described in table V(a) of rule .1961	Yes ☐	No ☐	N/A ☐
.1937(i)	Conditions for system performance, operation, maintenance, monitoring and reporting.	Yes ☐	No ☐	N/A ☐

II. WASPS Review:

Construction authorization issued	Yes ☐	No ☐	N/A ☐
Installation approval issued	Yes ☐	No ☐	N/A ☐
Operation permit issued	Yes ☐	No ☐	N/A ☐
Other related documentation	Yes ☐	No ☐	N/A ☐

Items requiring correction/modification: _____

Comments:

_____

_____

_____

_____

_____

IA issued date: _____

OP issued date: _____

Review performed by: _____ Date performed: 11-9-07

7211B

FILE NUMBER: ~~7211B~~ 7211B

Revised On: January 3, 2007

APPLICATION NUMBER: 2481

SEPTIC FEE: 200.00
DATE: 7/6/07
CK # 36828 JKA

MECKLENBURG COUNTY GROUNDWATER & WASTEWATER SERVICES
APPLICATION FOR A RESIDENTIAL SITE IMPROVEMENT PERMIT/ CONSTRUCTION AUTHORIZATION FOR AN ON-SITE WASTEWATER SYSTEM, NEW WELL INSTALLATION, OR REPAIR OF EXISTING WELL

WELL FEE: _____
DATE: _____

1. **SEPTIC / TYPE APPLICATION:** ☐ NONE ☒ NEW SYSTEM ☐ ALTERATION ☐ REPAIR ☐ MODIFIED PLOT PLAN

2. **WELL / TYPE APPLICATION:** ☐ NONE ☐ NEW WELL ☐ MAJOR REPAIR ☐ ABANDONMENT

3. **JOB LOCATION INFORMATION:**

TAX PARCEL NUMBER: 00333101, 00304103 (Part of), 00333102

STREET ADDRESS: ~~3513~~ Grey Road

CITY: Davidson

STATE: NC ZIP: 28036

SUBDIVISION NAME: ABERSHAM

LOT #: 33 LOT SIZE (acres): 2.0 acres

TOWNSHIP:

☐ 0-MECKLENBURG ☐ 3-CORNELIUS ☐ 6-HUNTERSVILLE
☐ 1-CHARLOTTE ☐ 4-PINEVILLE ☐ 7-MINT HILL
☒ 2-DAVIDSON ☐ 5-MATTHEWS

4. **BUILDING INFORMATION:**

BUILDING TYPE:

☐ SINGLE MOBILE HOME ☐ MODULAR HOME
☐ DOUBLE WIDE ☐ MULTIPLE FAMILY
☒ HOUSE ☐ OTHER _____

HEATED SQUARE FOOTAGE:

NUMBER OF BEDROOMS: 6

NUMBER OF OCCUPANTS: 12 maximum

FOUNDATION TYPE:

☐ CONCRETE SLAB ☒ BASEMENT WITH PLUMBING
☐ CRAWL SPACE ☐ BASMENT WITH NO PLUMBING

5. **IF PLANNING TO EXPAND OR ALTER THE EXISTING SYSTEM PLEASE COMPLETE THE FOLLOWING SECTION:** ☒ N/A

NUMBER OF BEDROOMS TO BE ADDED: _____ NUMBER OF ADDITIONAL OCCUPANTS IN THE RESIDENCE: _____

6. **WATER SUPPLY:** ☐ MUNICIPAL ☐ PUBLIC WELL ☒ PRIVATE WELL ☐ SHARED WELL ☐ SPRING

7. **PROPOSED USE OF WELL:** ☒ N/A ☐ IRRIGATION ☐ POTABLE ☐ GEOTHERMAL ☐ OTHER

8. **PLEASE INDICATE AND RANK DESIRED SEPTIC SYSTEM TYPE(S) IN ORDER OF PREFERENCE** *(1-MOST DESIRED 5-LEAST DESIRED):*

	☐ ANY TYPE	☒ CONVENTIONAL	☒ ACCEPTED	☒ INNOVATIVE	☒ ALTERNATIVE	☐ OTHER _____
8A. **RANK:**		1	2	3	4	

9. **DO ANY OF THE FOLLOWING APPLY TO THE PROPERTY IN QUESTION? IF "YES" PLEASE ATTACH SUPPORTING DOCUMENTATION.**

BURIED CABLES, LANDFILLS, STUMPHOLES	☐ YES	☒ NO	GRADING/SOIL REMOVAL PERFORMED	☐ YES	☒ NO
EXISTING WASTEWATER SYSTEMS	☐ YES	☒ NO	JURISDICTIONAL WETLANDS	☐ YES	☒ NO
WELLS, SPRINGS, OR WATER LINES	☐ YES	☒ NO	APPROVAL REQUIRED BY ANY OTHER PUBLIC AGENCY	☐ YES	☒ NO
EASEMENTS OR RIGHT-OF-WAYS	☐ YES	☒ NO	WASTEWATER OTHER THAN DOMESTIC SEWAGE	☐ YES	☒ NO

10. **PROPERTY OWNER:**

NAME: Neighborhoods at Abersham
ADDRESS: P.O. Box 99
CITY: Davidson
STATE: NC ZIP: 28036
HOME PHONE: N/A WORK PHONE: 704.895.0556
MOBILE PHONE: N/A FAX: 704.895.0558

11. **OWNER'S LEGAL REPRESENTATIVE, IF APPLICABLE:**

NAME: Rollans Soil & Environmental Services
ADDRESS: 470 N. Broad St., Suite D
CITY: Mooresville
STATE: NC ZIP: 28115
HOME PHONE: N/A WORK PHONE: 704.658.1723
MOBILE PHONE: 704.746.5046 FAX: 704.658.1724

12. **WHAT DATE WAS THE PROPERTY ORIGINALLY DEEDED AND RECORDED?** _____
13 **WHAT IS THE ANTICIPATED CLOSING DATE FOR THIS PROPERTY?** _____

14. **SEPTIC SYSTEM PERMIT APPLICATION SIGNATURE SECTION:**
If the information in this application is falsified, changed, or the site is altered, then the Improvement Permit and Authorization to Construct shall become invalid. I have read this application and certify that the information provided herein is true, complete and correct. Authorized county and state officials are granted right of entry to conduct necessary inspections to determine compliance with applicable laws and rules. I understand that I am solely responsible for the proper identification and labeling of all property lines and corners and making the site accessible so that a complete site evaluation can be performed. The permit is valid for either 60 months or is non-expiring depending upon the documentation submitted: complete site plan = 60 months, complete plat = non-expiring.

Samuel A Rollans
Property Owner's or Owner's Legal Representative Signature Date

15. **WELL PERMIT APPLICATION SIGNATURE SECTION:**
If the information in this application is falsified, changed, or the site is altered, then the Well Permit shall become invalid. I have read this application and certify that the information provided herein is true, complete and correct. Authorized county and state officials are granted right of entry to conduct necessary inspections to determine compliance with applicable laws and rules. I understand that I am solely responsible for the proper identification and labeling of all property lines and corners and making the site accessible so that a complete site evaluation can be performed. The permit is valid for a period of 12 months from the date of issuance.

Property Owner's or Owner's Legal Representative Signature Date

☐ SURVEY PLAT TO SCALE SUBMITTED ☒ SCALED SITE PLAN SUBMITTED ☐ UN-SCALED SITE PLAN SUBMITTED

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: PO 003-321-01
Lot #: 33
File #: 7211B
AppID: 2481

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

Owner: Neighborhoods at Abersham
Address: PO Box 99, Davidson, N. C. 28036
Proposed Facility: Residence Design Flow (.1949): 720gpd
Location of Site: Off Grey road
Water Supply: [ ] Public [x] Individual [x] Well [ ] Spring [ ] Other
Evaluation Method: [ ] Auger Boring [x] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

Applicant: Rollans Soil & Env. Services
Date Evaluated: 7/26/2007
Property Size: 2.0a
Property Recorded:

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 .1941 Structure/ Texture	.1941 Consistence Mineralogy	b PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
1	LS, 8	0-31	SBK/ABK/C	FI/SEXP/S/P	>40" TO SOIL WETNESS	40	N/A	NONE	PS, IV
		31-40	SBK/CL	FR/SEXP/SS/SP					.275GPD/FT^2
2	"	0-30	SBK/ABK/C	FI/SEXP/S/P	>48" TO SOIL WETNESS	48	"	"	"
		30-48	SBK/CL	FR/SEXP/SS/SP					
3	"	0-39	SBK/ABK/C	FI/SEXP/S/P	>54" TO SOIL WETNESS	54	"	"	"
		39-54	SBK/CL	FR/SEXP/SS/SP					
					SITE LTAR .275GPD/FT^2				

Description	Initial System	Repair System
Available Space (.1945)	PS	PS
System Type(s)	IIIb	Iva
Site LTAR	0.275	0.275

Other Factors (.1946):
Soil Evaluation By: W. R. Marlin, LSS, 8/3/2007, W. R. Marlin
Others Present: A. Rollans
Site Classification (.1948): PS
Site Evaluation By: PHILO WALKER RS
Others Present:

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: PO 003-321-01
Lot #: 33
File #: 7211B
AppID: 2481

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Owner: Neighborhoods at Abersham
Address: PO Box 99, Davidson, N. C. 28036
Proposed Facility: Residence Design Flow (.1949): 720gpd
Location of Site: Off Grey road
Water Supply: [ ] Public [x] Individual [x] Well [ ] Spring [ ] Other
Evaluation Method: [ ] Auger Boring [x] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

Applicant: Rollans Soil & Env. Services
Date Evaluated: 7/26/07
Property Size: 2.0a
Property Recorded:

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 .1941 Structure/ Texture	.1941 Consistence Mineralogy	b PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
1	LS, 8	0-31	SBK/ABK/C	FI/SEXP/S/P	>40" TO SOIL WETNESS	40	N/A	NONE	PS, IV
		31-40	SBK/CL	FR/SEXP/SS/SP					.275GPD/FT^2
2	"	0-30	SBK/ABK/C	FI/SEXP/S/P	>48" TO SOIL WETNESS	48	"	"	"
		30-48	SBK/CL	FR/SEXP/SS/SP					
3	"	0-39	SBK/ABK/C	FI/SEXP/S/P	>54" TO SOIL WETNESS	54	"	"	"
		39-54	SBK/CL	FR/SEXP/SS/SP					
					SITE LTAR .275GPD/FT^2				

Description	Initial System	Repair System
Available Space (.1945)		
System Type(s)		
Site LTAR		


Other Factors (.1946):
Soil Evaluation By: W. R. Marlin, LSS, 8/3/2007, W. R. Marlin
Others Present: A. Rollans
Site Classification (.1948):
Site Evaluation By:
Others Present:

COMMENTS:
100% repair

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace				
FP-Flood Plain		CL-Clay Loam		
		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

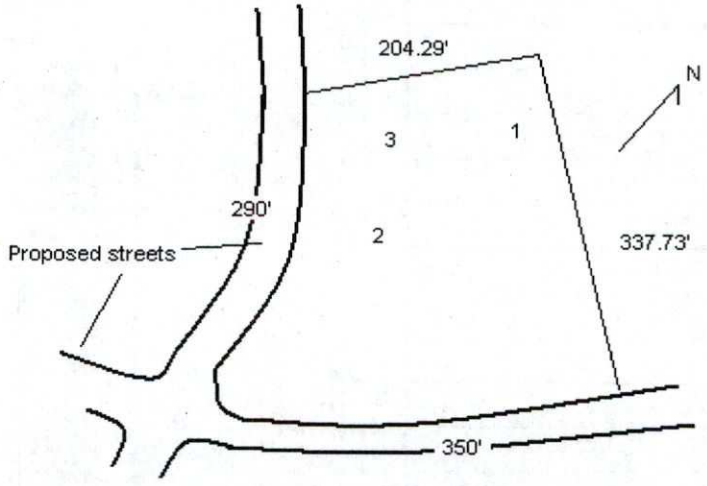


COMMENTS:
100% repair

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace				
FP-Flood Plain		CL-Clay Loam		
		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

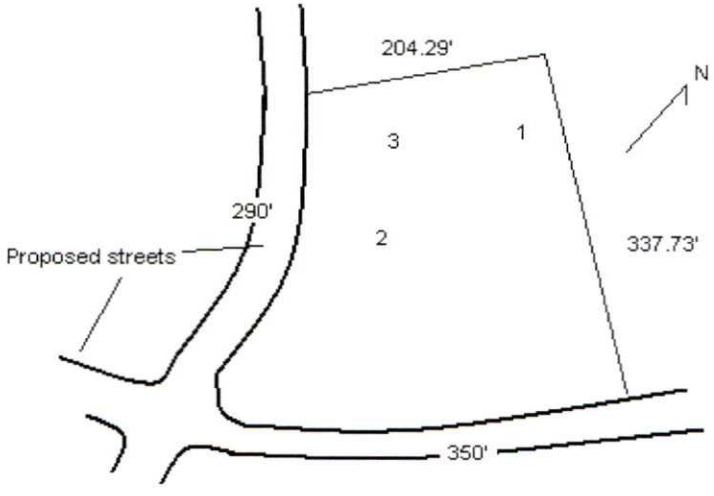

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: PO 003-321-01
Lot #: 33
File #: 7211B
AppID: 2481

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Owner: Neighborhoods at Abersham
Applicant: Rollans Soil & Env. Services
Address: PO Box 99, Davidson, N. C. 28036
Date Evaluated: 7/26/07
Proposed Facility: Residence
Design Flow (.1949): 720gpd
Property Size: 2.0a
Location of Site: Off Grey road
Property Recorded:
Water Supply: [ ] Public [x] Individual [x] Well [ ] Spring [ ] Other
Evaluation Method: [ ] Auger Boring [x] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 .1941 Structure/ Texture	.1941 Consistence Mineralogy	b PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
1	LS, 8	0-31	SBK/ABK/C	FI/SEXP/S/P	>40" TO SOIL WETNESS	40	N/A	NONE	PS, IV
		31-40	SBK/CL	FR/SEXP/SS/SP					.275GPD/FT^2
2	"	0-30	SBK/ABK/C	FI/SEXP/S/P	>48" TO SOIL WETNESS	48	"	"	"
		30-48	SBK/CL	FR/SEXP/SS/SP					
3	"	0-39	SBK/ABK/C	FI/SEXP/S/P	>54" TO SOIL WETNESS	54	"	"	"
		39-54	SBK/CL	FR/SEXP/SS/SP					
					SITE LTAR .275GPD/FT^2				

Description	Initial System	Repair System
Available Space (.1945)		
System Type(s)		
Site LTAR		


Other Factors (.1946):
Soil Evaluation By: W. R. Marlin, LSS, 8/3/2007, W. R. Marlin
Others Present: A. Rollans
Site Classification (.1948):
Site Evaluation By:
Others Present:

COMMENTS:
100% repair

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace				
FP-Flood Plain		CL-Clay Loam		
		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

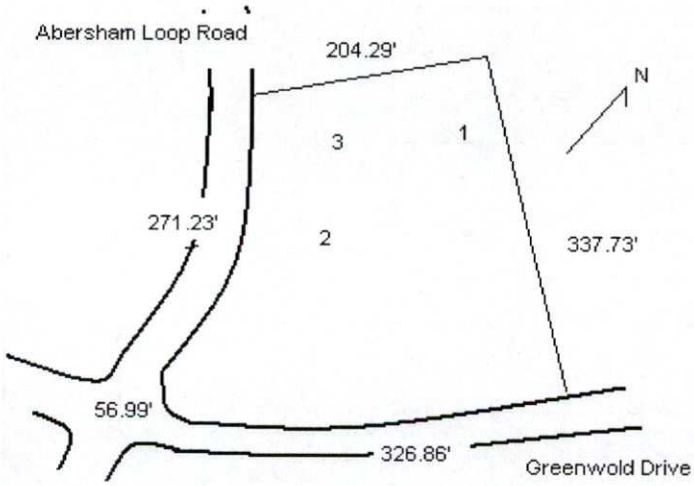

Mecklenburg County Groundwater & Wastewater Services
700 N. Tryon St, Suite 211 Charlotte, NC 28202
Phone: (704) 336-5103 Fax: (704) 336-6894

NC DENR
Division of Environmental Health
On-Site Wastewater Section

IMPROVEMENT PERMIT for a RESIDENTIAL ON-SITE WASTEWATER TREATMENT & DISPOSAL SYSTEM

Permit #: **30002481** GWS File #: **7211B** Tax Parcel #: **003-331-01**

- This IMPROVEMENT PERMIT is subject to revocation if site plans or the intended use change. There is to be **NO** grading, filling, or disturbance of the soil in the area of the septic tank system or repair area.
- CONSTRUCTION AUTHORIZATION must be obtained prior to receiving a Building Permit. The Construction Authorization is **NOT** transferable. Do not clear, grade, fill or disturb soil prior to obtaining a Construction Authorization.
- Domestic-type wastewater only. No industrial process wastewater may be discharged into the system.

I. This Improvement Permit Shall: Expire in Five (5) Years **Expiration Date (If Applicable):** 11/7/2012

Type of Installation: Residential - New System Lot Number: 33

Structure Type: HOUSE Size (ft^2): 0 # Bedrooms: 6 # Occupants: 12

Building Foundation: Basement With Plumbing Water Supply: Private Well

II. Initial System Type: Pump to Approved **System Classification:** IIIb

Initial System Specifications:

Design Flow (gpd):	720	LTAR (gpd/ft^2):	0.275	Septic Tank Size (gal):	1500	Pump Tank Size (gal):	1500
Trench Width (ft):	3	Trench Spacing (ft):	9	Absorption Area (ft^2):	1964	Total Trench Length (ft):	655
Maximum Trench Depth (in):	24	Depth of Media (in):	12	Distribution Device:	Pressure Manifold		

III. Repair System Type: PPBPS (pressurized) **System Classification:** IVa

Repair System Specifications:

Design Flow (gpd):	720	LTAR (gpd/ft^2):	0.275	Septic Tank Size (gal):	1500	Pump Tank Size (gal):	1500
Trench Width (ft):	3	Trench Spacing (ft):	9	Absorption Area (ft^2):	1309	Total Trench Length (ft):	436
Maximum Trench Depth (in):	36	Depth of Media (in):	N/A	Distribution Device:	Manifold (LPP Distri		

IV. Permit Conditions/Comments:

(Please See the Following Page for Permit Conditions.)

The undersigned, an authorized agent of the MECKLENBURG COUNTY HEALTH DEPARTMENT, certifies that the Department is issuing an IMPROVEMENT PERMIT for the above referenced property. This permit is being issued in accordance with the *Laws and Rules For Sewage Treatment, and Disposal Systems* and is subject to the following provisions:

- No work shall be conducted on the septic system until an INSTALLATION APPROVAL is granted by the Department.
- The septic system installer shall be a registered septic contractor with Mecklenburg County Health Department.
- The permitted system shall be installed in accordance with the included PLOT PLAN.
- This IMPROVEMENT PERMIT is transferable.

DENR Authorized Agent: Philo Walker

Signature: Philo Walker RS

Date Issued: 11/7/2007

Owner/Legal Agent: Greg C. Williams
Print Name

Signature:

Mecklenburg County Groundwater & Wastewater Services
700 N. Tryon St, Suite 211 Charlotte, NC 28202
Phone: (704) 336-5103 Fax: (704) 336-6894

NC DENR
Division of Environmental Health
On-Site Wastewater Section

IMPROVEMENT PERMIT for a RESIDENTIAL ON-SITE WASTEWATER TREATMENT & DISPOSAL SYSTEM

Permit #: **30002481** GWS File #: **7211B**

IV. Permit Conditions/Comments:

- This type of septic system requires an inspection once every 5 years by our office. The system owner is responsible for any fees, as determined by the Mecklenburg County Board of Commissioners, associated with this inspection.
- This type of repair system requires the installation of a pump tank and all associated components. This type of system will require routine inspections by our office. The system owner is responsible for all fees associated with these inspections.
- This type of repair system requires the property owner to obtain a contract with a Certified Operator to perform routine inspections and maintenance on the system.
- This type of repair system requires periodic inspections by our office. The system owner is responsible for any fees, as determined by the Mecklenburg County Board of Commissioners, associated with this inspection.
- All components of the septic system must be located at least 100 ft. (50 ft. minimum) from all private wells.

The undersigned, an authorized agent of the MECKLENBURG COUNTY HEALTH DEPARTMENT, certifies that the Department is issuing an IMPROVEMENT PERMIT for the above referenced property. This permit is being issued in accordance with the *Laws and Rules For Sewage Treatment and Disposal Systems* and is subject to the following provisions:

- No work shall be conducted on the septic system until an INSTALLATION APPROVAL is granted by the Department.
- The septic system installer shall be a registered septic contractor with Mecklenburg County Health Department.
- The permitted system shall be installed in accordance with the included PLOT PLAN.
- This IMPROVEMENT PERMIT is transferable.

DENR Authorized Agent: Philo Walker

Signature: Philo Walker RS

Date Issued: 11/7/2007


Owner/Legal Agent: Greg C Williams
Print Name

Signature:

COMMENTS 6 Bedroom House
1500 Gal septic tank
1500 Gal pump tank
pressure manifold distribution
4 lines @ 162' long Approved System
650 LF

Keep the septic system > 100' from any well
scale 1" = 60'
LTAR .275

1" = 60'

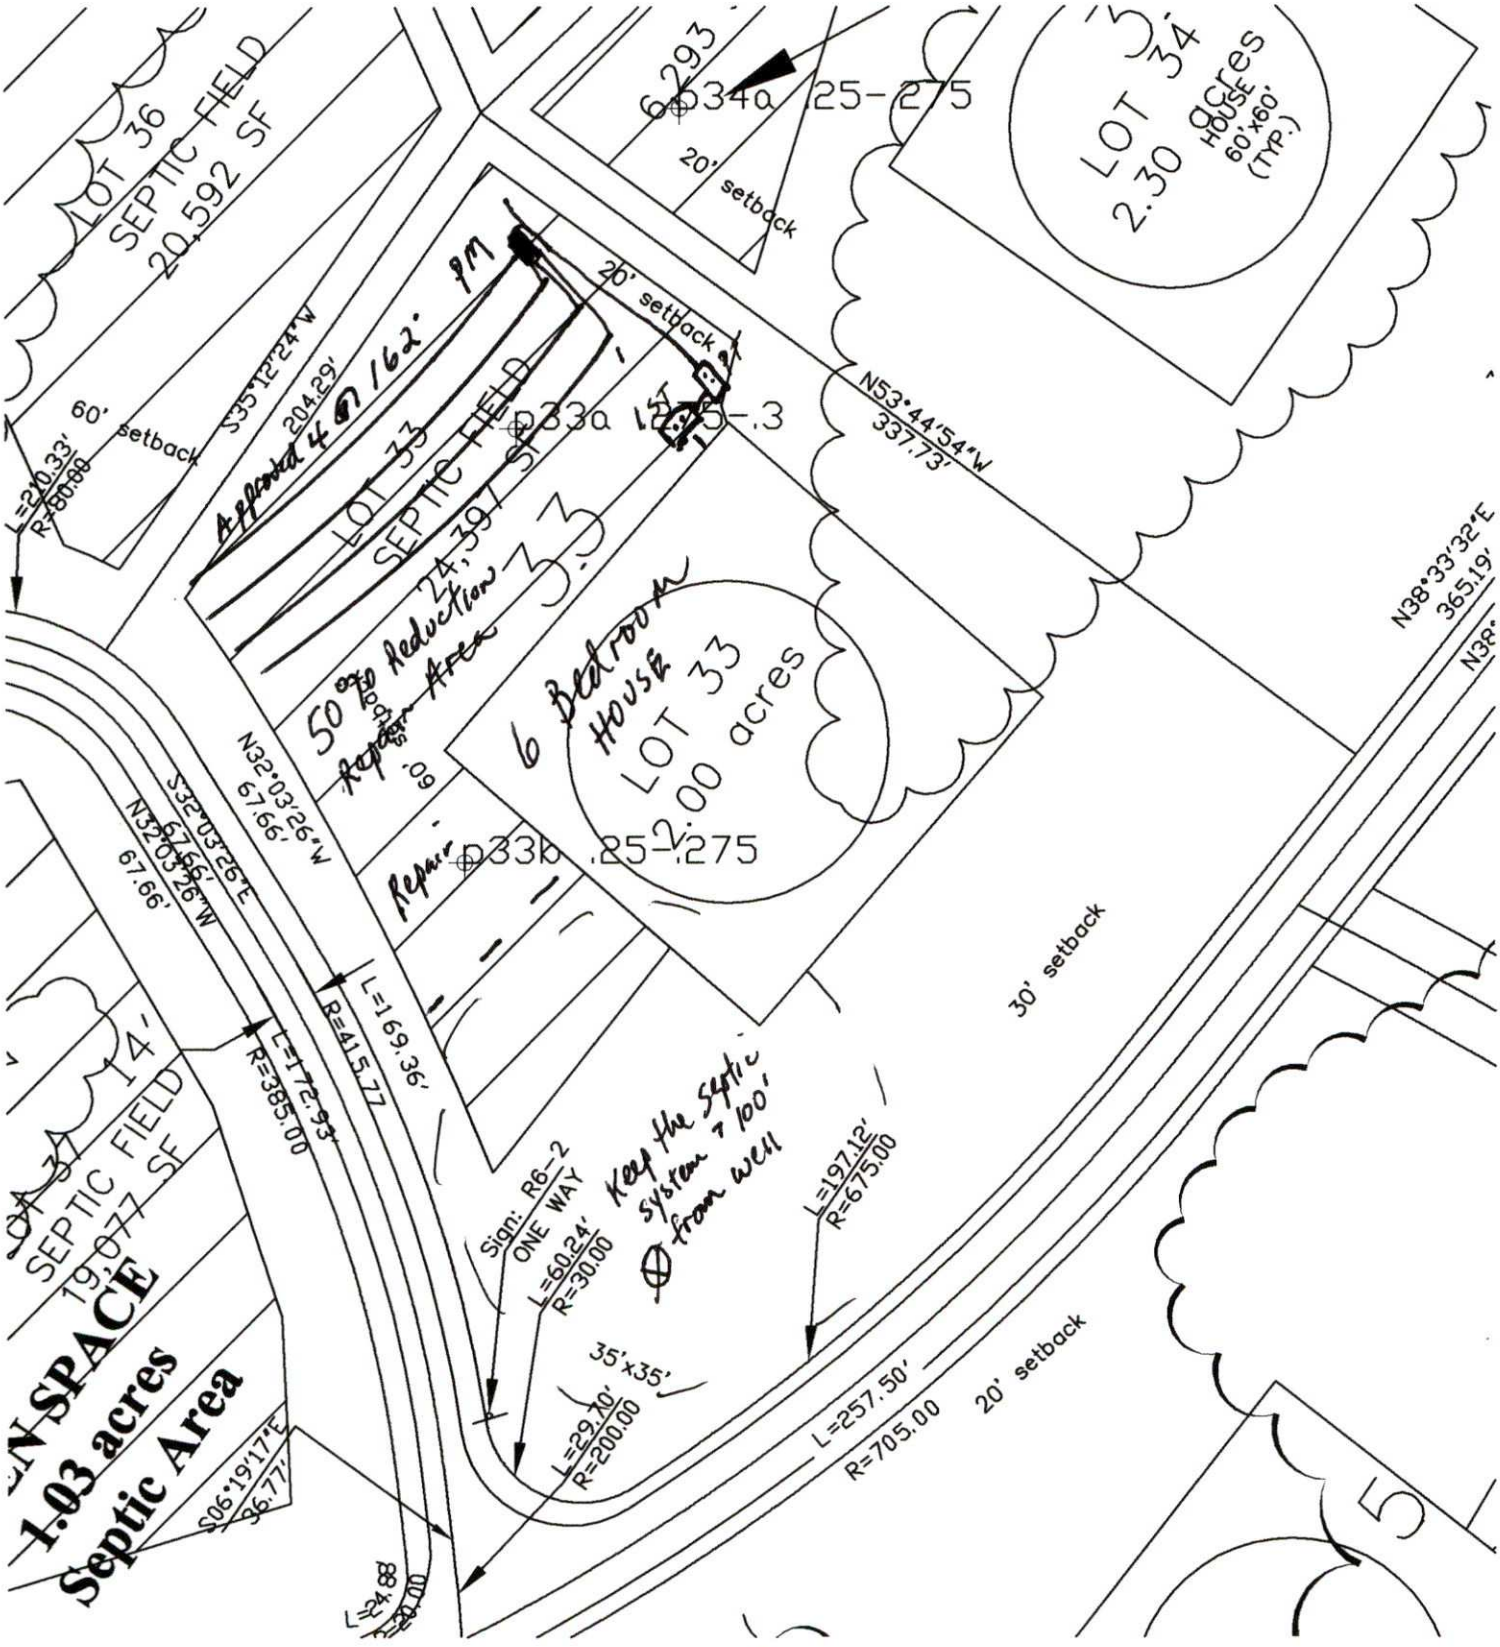

7211B