Groundwater & Wastewater Services
Septic Project File & Data Review Worksheet

GWS File #: 7820 B WASPS App #: 3647

Primary ES assigned to project: YS

Secondary ES assigned to project:

Project Type: New System ☐ Alteration ☐ Repair ☐ Modified Plot Plan ☐

I. File Review:

Rule or Law	Permit Application			
.1937(d)	Is the Application complete	Yes ☑	No ☐	N/A ☐
.1937(d)	Is there a Site plan/Plat with application	Yes ☑	No ☐	N/A ☐
.1937(d)	Is the Facility shown?	Yes ☑	No ☐	N/A ☐
.1937(d)	Are appurtenances shown	Yes ☑	No ☐	N/A ☐
	Site Evaluation Information			
.1939 (a)(1)	Topography and Landscape Position Recorded?	Yes ☑	No ☐	N/A ☐
.1940 (a-g)	Slope % Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Texture Class Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Structure type Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Consistence Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Mineralogy Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(3)	Soil Wetness Condition Recorded?	Yes ☐	No ☐	N/A ☑
.1939 (a)(4)	Soil Depth to Rock or Parent Material Recorded When Encountered	Yes ☐	No ☐	N/A ☑
.1939 (a)(5)	Depth to Restrictive Horizons Recorded When Encountered?	Yes ☐	No ☐	N/A ☑
.1939 (a)(6)	Sufficient Available Space Recorded?	Yes ☑	No ☐	N/A ☐
.1937(m)	Are the Profile Locations Shown?			
.1939(a)	Are the S/PS Profiles in system & in repair area?	Yes ☑	No ☐	N/A ☐
& .1945(b)	Number of auger borings made: 4 Were sufficient auger borings made?	Yes ☑	No ☐	N/A ☐
.1939(d), .1955, .1956, .1957	LTAR 3	Yes ☑	No ☐	N/A ☐
	Improvement Permit/Construction Authorization			
.1937(g) .130A-336(a)	Proposed System Type stated-Initial	Yes ☑	No ☐	N/A ☐
.1945(b)	Proposed System Type stated-Repair	Yes ☑	No ☐	N/A ☐
.130A-336 (a)(3)	System location identifiable by setbacks - Initial	Yes ☑	No ☐	N/A ☐
.1937(g) .1945(b)	System components shown -- Initial	Yes ☐	No ☐	N/A ☑
.1945(b)	Repair area shown	Yes ☑	No ☐	N/A ☐
.1937 (f)(g)	Does System design match facility, flow & WW characteristics?	Yes ☑	No ☐	N/A ☐
.1937 (f)(g)	Is System design consistent with soil/site conditions?	Yes ☑	No ☐	N/A ☐
.1937 (f)(g)	Is the System located in the approved area?	Yes ☑	No ☐	N/A ☐
.130A-336(a)	Is the Design flow (gpd) indicated?	Yes ☑	No ☐	N/A ☐

130A-336(a)	Number of Bedrooms, employees, seats, etc. indicated?	Yes [✓]	No [ ]	N/A [ ]
.1937(g)	Trench depth indicated?	Yes [✓]	No [ ]	N/A [ ]
.1937(g)	Trench width indicated?	Yes [✓]	No [ ]	N/A [ ]
.1937(g)	Trench length indicated?	Yes [✓]	No [ ]	N/A [ ]
130A-336(a)(1)	Proposed/existing well shown?	Yes [ ]	No [ ]	N/A [✓]
130A-336(a)(1)	Property line lengths shown?	Yes [✓]	No [ ]	N/A [ ]
130A-336(a)	Facility/appurtenance setbacks shown from fixed points?	Yes [✓]	No [ ]	N/A [ ]
	Operation Permit			
.1937(i)	System type as described in table V(a) of rule .1961	Yes [ ]	No [ ]	N/A [ ]
.1937(i)	Conditions for system performance, operation, maintenance, monitoring and reporting.	Yes [ ]	No [ ]	N/A [ ]

H. WASPS Review:

Construction authorization issued	Yes [ ]	No [ ]	N/A [ ]
Installation approval issued	Yes [ ]	No [ ]	N/A [ ]
Operation permit issued	Yes [ ]	No [ ]	N/A [ ]
Other related documentation	Yes [ ]	No [ ]	N/A [ ]

items requiring correction/modification: _____

Comments:

_____

_____

_____

_____

_____

IA issued date: _____

OP issued date: _____

Review performed by: IR Date performed: 7.29.08

MASTER COPY

LOT #95

FILE NUMBER: 7820B

Revised On: August 31, 2007

APPLICATION NUMBER: 3647

SEPTIC FEE: 200 rec'd
DATE: 6/24/08
X32342

MECKLENBURG COUNTY GROUNDWATER & WASTEWATER SERVICES
APPLICATION FOR A RESIDENTIAL SITE IMPROVEMENT PERMIT/ CONSTRUCTION AUTHORIZATION FOR AN ON-SITE WASTEWATER SYSTEM, NEW WELL INSTALLATION, OR REPAIR OF EXISTING WELL

WELL FEE: _____
DATE: _____

1. **SEPTIC / TYPE APPLICATION:** ☐ NONE ☒ NEW SYSTEM ☐ ALTERATION ☐ REPAIR ☐ MODIFIED PLOT PLAN

2. **WELL / TYPE APPLICATION:** ☒ NONE ☐ NEW WELL ☐ MAJOR REPAIR ☐ ABANDONMENT

3. **JOB LOCATION INFORMATION:**

TAX PARCEL NUMBER: 195-211-08
STREET ADDRESS: 13118 FARRINGTON OAKS DRIVE
CITY: MINT HILL
STATE: NC ZIP: 28227
SUBDIVISION NAME:
LOT #: 95 LOT SIZE (acres): 0.769 AC
TOWNSHIP:

☐ 0-MECKLENBURG ☐ 3-CORNELIUS ☐ 6-HUNTERSVILLE
☐ 1-CHARLOTTE ☐ 4-PINEVILLE ☒ 7-MINT HILL
☐ 2-DAVIDSON ☐ 5-MATTHEWS

4. **BUILDING INFORMATION:**

BUILDING TYPE:

☐ SINGLE MOBILE HOME ☐ MODULAR HOME
☐ DOUBLE WIDE ☐ MULTIPLE FAMILY
☒ HOUSE ☐ OTHER _____

HEATED SQUARE FOOTAGE: 3500
NUMBER OF BEDROOMS: 5
NUMBER OF OCCUPANTS:
FOUNDATION TYPE:

☐ CONCRETE SLAB ☐ BASEMENT WITH PLUMBING
☒ CRAWL SPACE ☐ BASMENT WITH NO PLUMBING

5. **IF PLANNING TO EXPAND OR ALTER THE EXISTING SYSTEM PLEASE COMPLETE THE FOLLOWING SECTION:** ☐ N/A

NUMBER OF BEDROOMS TO BE ADDED: _____ NUMBER OF ADDITIONAL OCCUPANTS IN THE RESIDENCE: _____

6. **WATER SUPPLY:** ☒ MUNICIPAL ☐ PUBLIC WELL ☐ PRIVATE WELL ☐ SHARED WELL ☐ SPRING

7. **PROPOSED USE OF WELL:** ☒ N/A ☐ IRRIGATION ☐ POTABLE ☐ GEOTHERMAL ☐ OTHER

8. **PLEASE INDICATE AND RANK DESIRED SEPTIC SYSTEM TYPE(S) IN ORDER OF PREFERENCE** *(1-MOST DESIRED 5-LEAST DESIRED):*

8A. **RANK:** ☒ ANY TYPE X ☐ CONVENTIONAL 4 ☐ ACCEPTED 1 ☐ INNOVATIVE 3 ☐ ALTERNATIVE 2 ☐ OTHER _____ 5

9. **DO ANY OF THE FOLLOWING APPLY TO THE PROPERTY IN QUESTION? IF "YES" PLEASE ATTACH SUPPORTING DOCUMENTATION.**

BURIED CABLES, LANDFILLS, STUMPHOLES	☐ YES	☒ NO	GRADING/SOIL REMOVAL PERFORMED	☐ YES	☒ NO
EXISTING WASTEWATER (SEPTIC) SYSTEMS	☐ YES	☒ NO	JURISDICTIONAL WETLANDS	☐ YES	☒ NO
WELLS, SPRINGS, OR WATER LINES	☐ YES	☒ NO	APPROVAL REQUIRED BY ANY OTHER PUBLIC AGENCY	☐ YES	☒ NO
EASEMENTS OR RIGHT-OF-WAYS	☐ YES	☒ NO	WASTEWATER OTHER THAN DOMESTIC SEWAGE	☐ YES	☒ NO

10. **PROPERTY OWNER:**

NAME: McCrae Homes
ADDRESS: 10130 MALLARD CREEK RD SUITE 106
CITY: CHARLOTTE
STATE: NC ZIP: 28262
HOME PHONE: 704-509-5742 WORK PHONE:
MOBILE PHONE: FAX: 704-509-5743

11. **OWNER'S LEGAL REPRESENTATIVE, IF APPLICABLE:**

NAME:
ADDRESS:
CITY:
STATE: ZIP:
HOME PHONE: WORK PHONE:
MOBILE PHONE: FAX:

12. **WHAT DATE WAS THE PROPERTY ORIGINALLY DEEDED AND RECORDED?** 4/16/08
13. **WHAT IS THE ANTICIPATED CLOSING DATE FOR THIS PROPERTY?** DEC 2008

14. **SEPTIC SYSTEM PERMIT APPLICATION SIGNATURE SECTION:**
If the information in this application is falsified, changed, or the site is altered, then the Improvement Permit and Authorization to Construct shall become invalid. I have read this application and certify that the information provided herein is true, complete and correct. Authorized county and state officials are granted right of entry to conduct necessary inspections to determine compliance with applicable laws and rules. I understand that I am solely responsible for the proper identification and labeling of all property lines and corners and making the site accessible so that a complete site evaluation can be performed. The permit is valid for either 60 months or is non-expiring depending upon the documentation submitted: complete site plan = 60 months, complete plat = non-expiring.

6/24/08

Property Owner's or Owner's Legal Representative Signature Date

15. **WELL PERMIT APPLICATION SIGNATURE SECTION:**
If the information in this application is falsified, changed, or the site is altered, then the Well Permit shall become invalid. I have read this application and certify that the information provided herein is true, complete and correct. Authorized county and state officials are granted right of entry to conduct necessary inspections to determine compliance with applicable laws and rules. I understand that I am solely responsible for the proper identification and labeling of all property lines and corners and making the site accessible so that a complete site evaluation can be performed. The permit is valid for a period of 12 months from the date of issuance.

Property Owner's or Owner's Legal Representative Signature Date


☐ SURVEY PLAT TO SCALE SUBMITTED ☐ SCALED SITE PLAN SUBMITTED ☐ UN-SCALED SITE PLAN SUBMITTED

Mecklenburg County
Land Use & Environmental Service Agency
Groundwater & Wastewater Services
700 N. Tryon St., Suite 211
Charlotte, NC 28202
Phone: (704) 336-5103
Fax: (704) 336-6894

File # 78203
Date _____

PROPOSED PLOT PLAN

A map showing existing and proposed property lines and easements with dimensions, the location of the single family residence, non-single family residence, or other facility, and appurtenances, the site for the proposed well, and the location of existing or proposed sewer lines and/or sewage disposal systems, surface water bodies, aboveground or underground storage tanks. Name all roads adjoining the property. If this a repair indicate the type of repair.

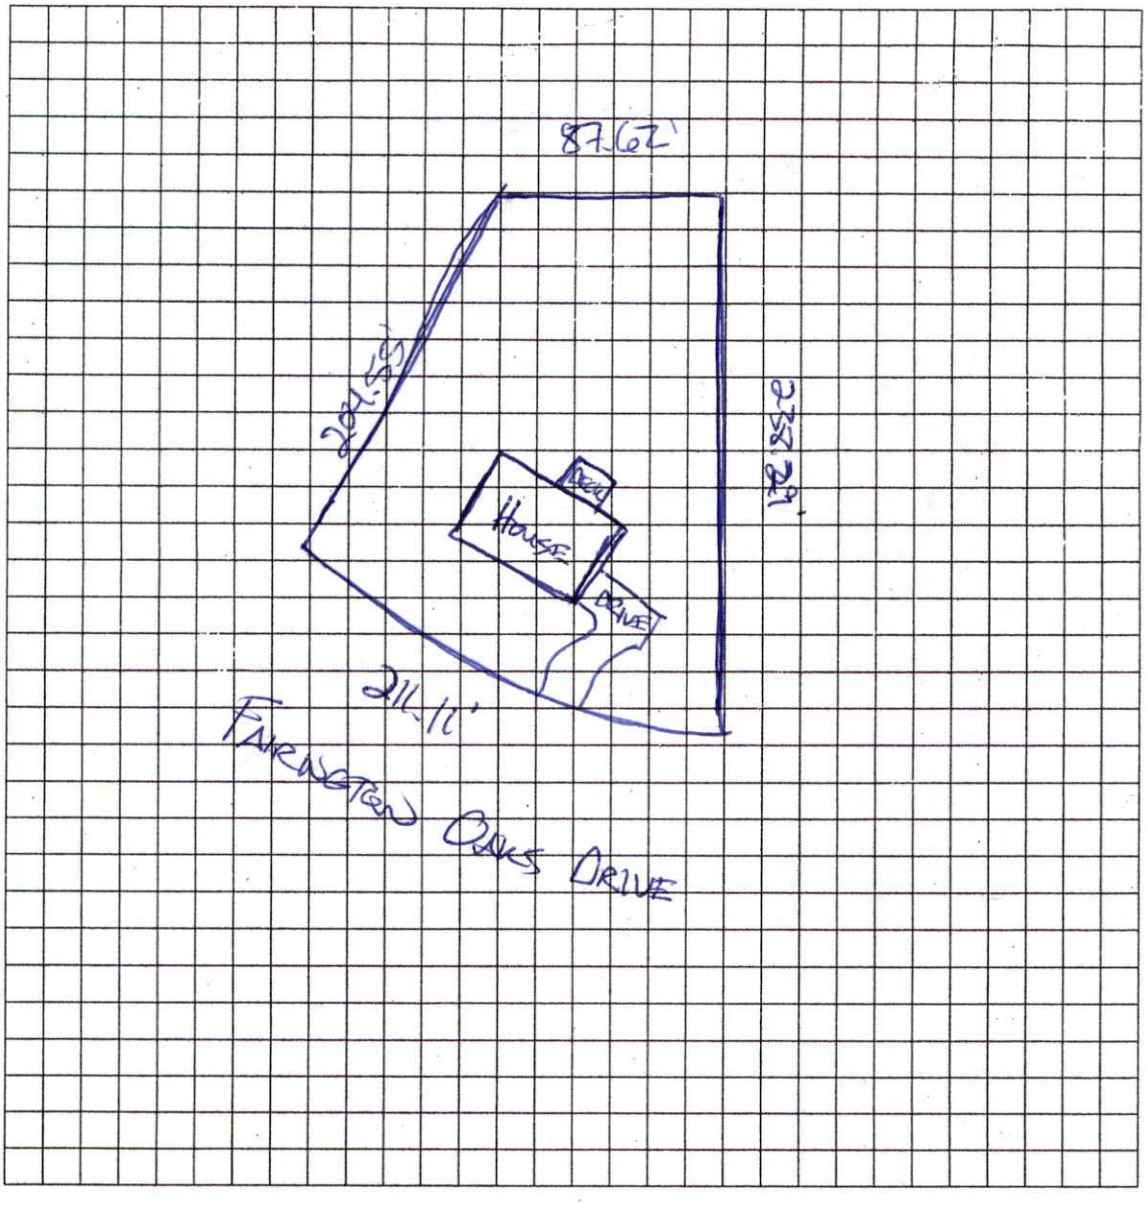

Owner/Agent Signature	
Date	6/24/08

LBC 12/15/04

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: 195-213-23
Lot #: 95
File #: 7820B
AppID: 3647

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

Owner: McCar Homes
Applicant:
Address: 10150 Mallard Creek Road, Ste 106, Charlotte, N. C. 28262
Date Evaluated: 7/10/2008
Proposed Facility: Residence
Design Flow (.1949) 600gpd
Property Size: .77a
Location of Site: 13118 Fairington Oaks Drive
Property Recorded:
Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [x] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 .1941 Structure/ Texture	.1941 Consistence Mineralogy	b PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
1	R, 5	0-4	GR/CL	FR/SEXP/SS/SP	>48" TO SOIL WETNESS	48	N/A	NONE	PS, IV
		4-40	SBK/ABK/C	FI/SEXP/S/P					.3GPD/FT^2
		40-48	SBK/CL	FR/SEXP/SS/SP					
2	LS, 5	0-5	GR/CL	"	"	"	"	"	"
		5-38	SBK/ABK/C	FI/SEXP/S/P					
		38-48	SBK/CL	FR/SEXP/SS/SP					
3	"	0-8	GR/CL	"	"	"	"	"	"
		8-43	SBK/ABK/C	FI/SEXP/S/P					
		43-48	SBK/CL	FR/SEXP/SS/SP					
4	"	0-6	GR/CL	"	"	"	"	"	"
		6-43	SBK/ABK/C	FI/SEXP/S/P					
		43-48	SBK/CL	FR/SEXP/SS/SP					
					SITE LTAR .3GPD/FT^2				

Description	Initial System	Repair System
Available Space (.1945)	PS	PS
System Type(s)	IIIg	Iva
Site LTAR	0.3	0.3


Other Factors (.1946):
Soil Evaluation By: W. R. Marlin, LSS, 7/11/2008,
Others Present:
Site Classification (.1948): PS
Site Evaluation By: Jeremy Michael
Others Present: Jeremy Michael

COMMENTS:
100% repair

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace				
FP-Flood Plain		CL-Clay Loam		
		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

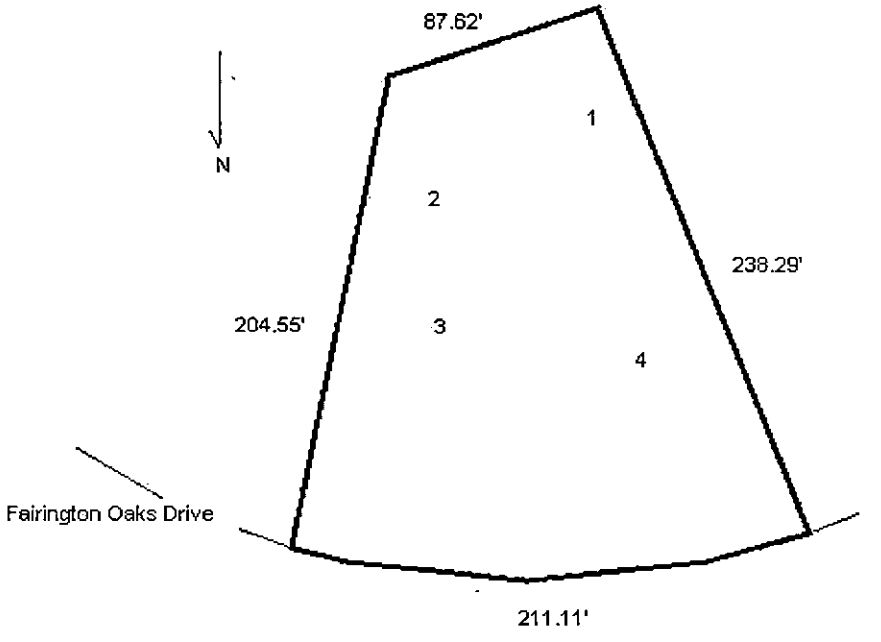


COMMENTS:
100% repair

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky,
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace				
FP-Flood Plain		CL-Clay Loam		
		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

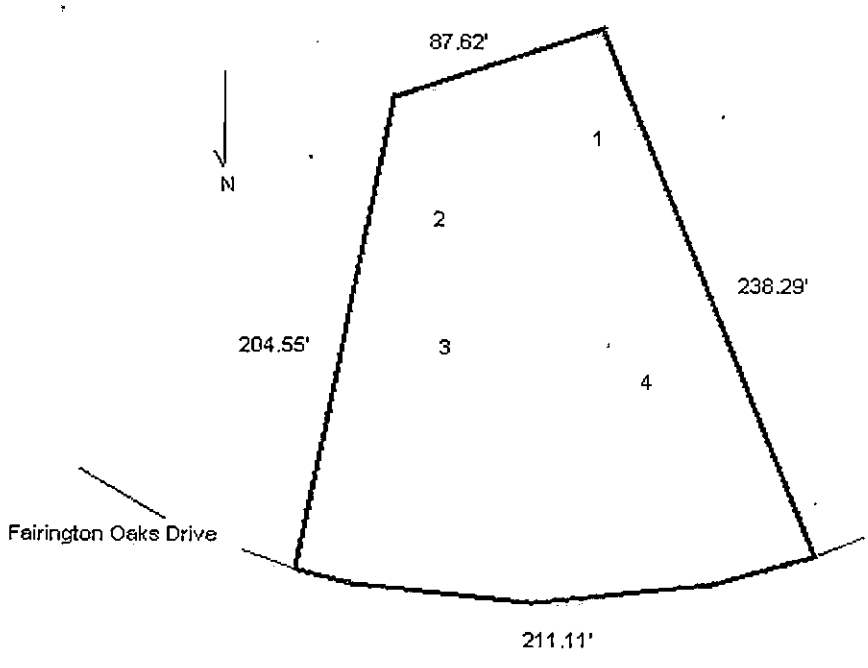

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: 195-213-23
Lot #: 95
File #: 7820B
AppID: 3647

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

Owner: McCar Homes
Applicant:
Address: 10150 Mallard Creek Road, Ste 106, Charlotte, N. C. 28262
Date Evaluated: 7/10/08
Proposed Facility: Residence Design Flow (.1949) 600gpd
Property Size: .77a
Location of Site: 13118 Fairington Oaks Drive
Property Recorded:
Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [x] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 .1941 Structure/ Texture	.1941 Consistence Mineralogy	b PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
1	R, 5	0-4	GR/CL	FR/SEXP/SS/SP	>48" TO SOIL WETNESS	48	N/A	NONE	PS, IV
		4-40	SBK/ABK/C	FI/SEXP/S/P					.3GPD/FT^2
		40-48	SBK/CL	FR/SEXP/SS/SP					
2	LS, 5	0-5	GR/CL	"	"	"	"	"	"
		5-38	SBK/ABK/C	FI/SEXP/S/P					
		38-48	SBK/CL	FR/SEXP/SS/SP					
3	"	0-8	GR/CL	"	"	"	"	"	"
		8-43	SBK/ABK/C	FI/SEXP/S/P					
		43-48	SBK/CL	FR/SEXP/SS/SP					
4	"	0-6	GR/CL	"	"	"	"	"	"
		6-43	SBK/ABK/C	FI/SEXP/S/P					
		43-48	SBK/CL	FR/SEXP/SS/SP					
					SITE LTAR .3GPD/FT^2				

Description	Initial System	Repair System
Available Space (.1945)		
System Type(s)		
Site LTAR		


Other Factors (.1946):
Soil Evaluation By: W. R. Marlin, LSS, 7/11/2008, W. R. Marlin
Others Present:
Site Classification (.1948):
Site Evaluation By:
Others Present:

COMMENTS:
100% repair

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky.
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace				
FP-Flood Plain		CL-Clay Loam		
		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

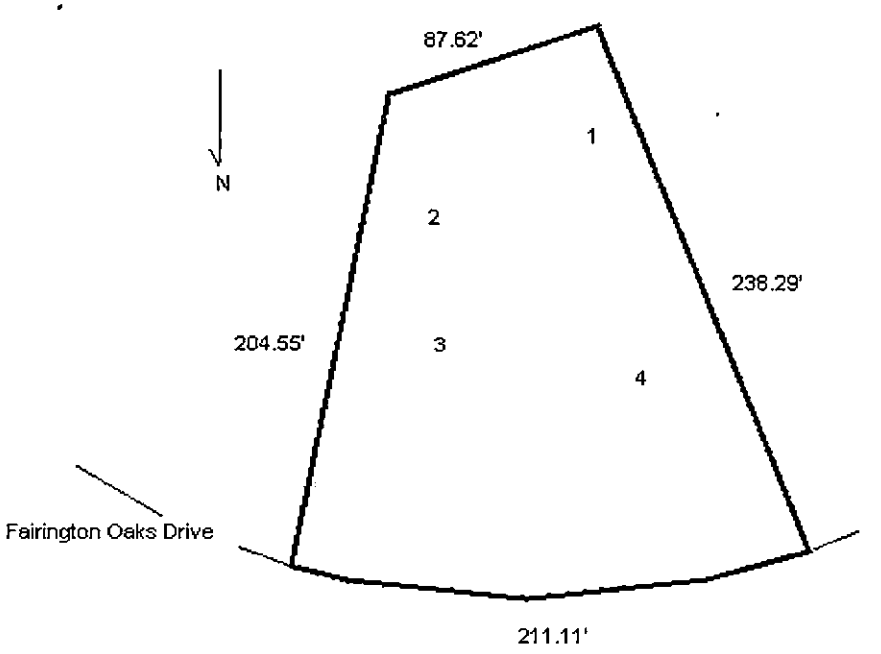


COMMENTS:
100% repair

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace				
FP-Flood Plain		CL-Clay Loam		
		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

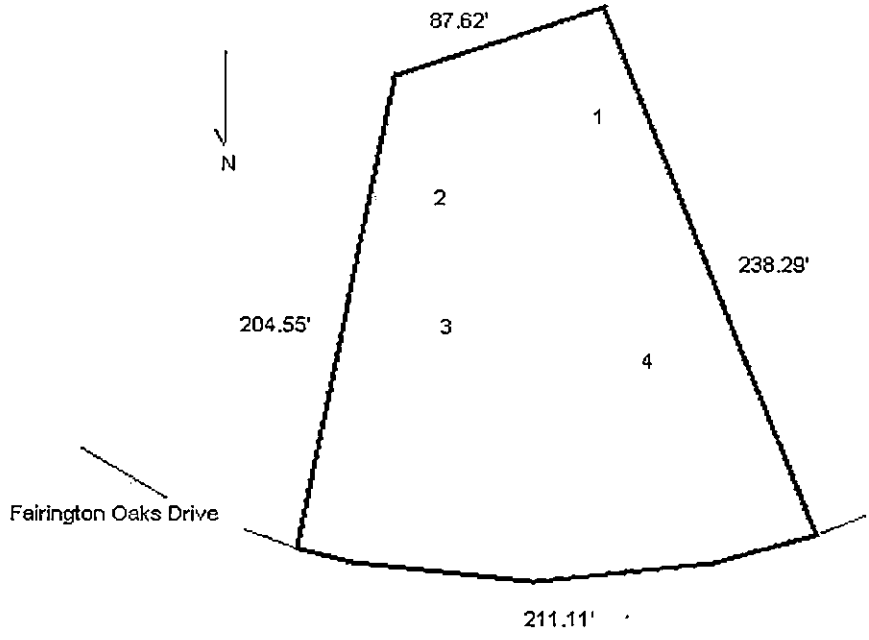

Mecklenburg County Groundwater & Wastewater Services
700 N. Tryon St, Suite 211 Charlotte, NC 28202
Phone: (704) 336-5103 Fax: (704) 336-6894

NC DENR
Division of Environmental Health
On-Site Wastewater Section

IMPROVEMENT PERMIT for a RESIDENTIAL ON-SITE WASTEWATER TREATMENT & DISPOSAL SYSTEM

Permit #: **30003647** GWS File #: **7820B** Tax Parcel #: **195-211-08**

- This IMPROVEMENT PERMIT is subject to revocation if site plans or the intended use change. There is to be NO grading, filling, or disturbance of the soil in the area of the septic tank system or repair area.
- CONSTRUCTION AUTHORIZATION must be obtained prior to receiving a Building Permit. The Construction Authorization is **NOT** transferable. Do not clear, grade, fill or disturb soil prior to obtaining a Construction Authorization.
- Domestic-type wastewater only. No industrial process wastewater may be discharged into the system.

I. This Improvement Permit Shall: Expire in Five (5) Years **Expiration Date (If Applicable):** 7/28/2013

Type of Installation: Residential - New System Lot Number: 95

Structure Type: HOUSE Size (ft^2): 3000 # Bedrooms: 5 # Occupants: 4

Building Foundation: Crawl Space Water Supply: Municipal

II. Initial System Type: Approved **System Classification:** IIIg

Initial System Specifications:

Design Flow (gpd):	600	LTAR (gpd/ft^2):	0.3	Septic Tank Size (gal):	1500	Pump Tank Size (gal):	N/A
Trench Width (ft):	3	Trench Spacing (ft):	9	Absorption Area (ft^2):	1500	Total Trench Length (ft):	500
Maximum Trench Depth (in):	36	Depth of Media (in):	12	Distribution Device:	Distribution Box		

III. Repair System Type: PPBPS (pressurized) **System Classification:** IVa

Repair System Specifications:

Design Flow (gpd):	600	LTAR (gpd/ft^2):	0.3	Septic Tank Size (gal):	1500	Pump Tank Size (gal):	1500
Trench Width (ft):	3	Trench Spacing (ft):	9	Absorption Area (ft^2):	1000	Total Trench Length (ft):	333
Maximum Trench Depth (in):	36	Depth of Media (in):	N/A	Distribution Device:	Manifold (LPP Distri		

IV. Permit Conditions/Comments:

(Please See the Following Page for Permit Conditions.)

The undersigned, an authorized agent of the MECKLENBURG COUNTY HEALTH DEPARTMENT, certifies that the Department is issuing an IMPROVEMENT PERMIT for the above referenced property. This permit is being issued in accordance with the *Laws and Rules For Sewage Treatment, and Disposal Systems* and is subject to the following provisions:

- No work shall be conducted on the septic system until an INSTALLATION APPROVAL is granted by the Department.
- The septic system installer shall be a registered septic contractor with Mecklenburg County Health Department.
- The permitted system shall be installed in accordance with the included PLOT PLAN.
- This IMPROVEMENT PERMIT is transferable.

DENR Authorized Agent: Jeremy Michael Owner/Legal Agent: _____
Print Name

Signature: Jeremy Michael Signature: _____

Date Issued: 7/28/2008

Mecklenburg County Groundwater & Wastewater Services
700 N. Tryon St, Suite 211 Charlotte, NC 28202
Phone: (704) 336-5103 Fax: (704) 336-6894

NC DENR
Division of Environmental Health
On-Site Wastewater Section

IMPROVEMENT PERMIT for a RESIDENTIAL ON-SITE WASTEWATER TREATMENT & DISPOSAL SYSTEM

Permit #: 30003647 GWS File #: 7820B

IV. Permit Conditions/Comments:

- This type of repair system requires the installation of a pump tank and all associated components. This type of system will require routine inspections by our office. The system owner is responsible for all fees associated with these inspections.
- This type of repair system requires the property owner to obtain a contract with a Certified Operator to perform routine inspections and maintenance on the system.
- All components of the septic system must be installed in accordance with the required setbacks listed on the corresponding plot plan.
- All waterlines must be located a minimum of 10 ft. from any part of the septic system.
- The invert of the sewer pipe exiting the structrue should be kept as high as possible in order to achieve gravity flow to the drain field. A dosing tank will be required if gravity flow to the drain field can not be achieved.

The undersigned, an authorized agent of the MECKLENBURG COUNTY HEALTH DEPARTMENT, certifies that the Department is issuing an IMPROVEMENT PERMIT for the above referenced property. This permit is being issued in accordance with the *Laws and Rules For Sewage Treatment and Disposal Systems* and is subject to the following provisions:

- No work shall be conducted on the septic system until an INSTALLATION APPROVAL is granted by the Department.
- The septic system installer shall be a registered septic contractor with Mecklenburg County Health Department.
- The permitted system shall be installed in accordance with the included PLOT PLAN.
- This IMPROVEMENT PERMIT is transferable.

DENR Authorized Agent: Jeremy Michael

Signature: Jeremy Michael

Date Issued: 7/28/2008

Owner/Legal Agent: _____
Print Name

Signature: _____

CURVE	RADIUS	ARC LENGTH	CHORD LENGTH	CHORD BRG
C1	320.00'	211.11'	207.31'	N 89°50'52" E

Lot # 95

LEGEND (IF USED)

IRF=IRON ROD OR REBAR FOUND
PF=PIPE FOUND
MBL=MINIMUM BUILDING LINE
IRS=IRON REBAR SET
CP=CALCULATED POINT
SDE=STORM DRAINAGE EASEMENT
FPE=FLOOD PROTECTION ELEVATION
COS=COMMON OPEN SPACE
ST=SIGHT TRIANGLE
S.W.I.M.=SURFACE WATER IMPROVEMENT & MANAGEMENT

LTAR 0.3
5 BR Residence
Gravity to 25% Reduction
Install (5) Lines at 100 ft
level with contour of land.
Distribution Box – Feed lines equal
1500 Gal S.T

DEER OAK LANE

97

S 72°24'42" W
87.62'

Type IIa repair
40' MBL

10'
20' MBL
3'X100'
3'X100'
33488.989 SQ FT.
0.769 ACRES
3'X100'

N 19°03'07" W
238.29'

S 12°59'40" W
204.55'

42.3'
35.9'
70.0'
House site
50.0'
60' MBL
Drainage Easement
C1

☐ Augor Boring Locations

Stay 10ft off all property lines
5' off all structures
10' off public water line.

96

Note!
Plumb out high
to obtain Gravity

Jeremy Michaud R.S.
07-28-2008

SCALE = 1" = 40'

13118 FAIRINGTON OAKS DRIVE