Certified Mail # 571200

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH
1200 BLYTHE BOULEVARD
CHARLOTTE, NORTH CAROLINA 28203

SITE INVESTIGATION REPORT
INDIVIDUAL SEPTIC TANK SYSTEM WITH SUBSURFACE, SOIL ABSORPTION, EFFLUENT DISCHARGE

SIR.NO. 12804
T.C. NO. 033-022-09
MAP DATE 6-29-76
DATE 1-17-78

NAME OF OWNER Thompson, Paul & Bobbie

ADDRESS OF OWNER 322 McClure Circle, Charlotte, NC 28216

LOCATION OF LOT McClure Circle, Lot 18

At your request and pursuant to Section.1900 of the North Carolina Administrative Code, Title 10, Department of Human Resources, Chapter 10, Health Services, Subchapter 10A, a site evaluation has been made for an on premises ground absorption sewage disposal system on the property designated above and the following conditions were found:

Soil Structure Massive.
Soil Permeability Unsuitable.

Section 10 of the North Carolina Administrative Code 10A, .1910 of these regulations states "Sites originally classified as unsuitable may be used for soil absorption disposal systems, provided engineering, hydrogeologic, and soils studies indicate to the local agency that a suitable septic tank system or a suitable alternate system can reasonably be expected to function satisfactorily.

Section 10, North Carolina Administrative Code 10A, .1916 states that "The design, construction, and maintenance of ground absorption sewage systems, whether septic tank systems or alternate systems shall be the responsibility of the owner, developer, installer, and user of the system as applicable in the circumstances."

We would also advise you that according to Regulation 10, North Carolina Administrative Code 10A, .1916 (b), "Actions of representatives of state or local agencies engaged in the evaluation and determination of measures required to effect compliance with the provisions of this section shall in no way be taken as a guarantee that sewage disposal systems approved and permitted will function in a satisfactory manner for any given period of time or that such employees assume any liability for damages, consequential or direct, which are caused or which may be caused, by a malfunction of such system.

These regulations became effective July 1, 1977. Since that time the second sentence of Section .1910 (c) has been found to be nugatory. For this reason, if you desire to file for permission to install an "alternate" system you should present this office with your proposals in the form of plans and specifications. These would be reviewed and if it is found that the system may reasonably be expected to function satisfactorily approval may be given on the execution by you of a "Septic Tank Agreement Form" available in this office.

John R. Atkinson Jr.
Environmentalist
On Premises Waste Disposal Section

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH
1200 BLYTHE BOULEVARD
CHARLOTTE NORTH CAROLINA 28203

DATE ISSUED
1. 7-20-77
2. _____
3. _____

SITE INVESTIGATION REPORT
INDIVIDUAL SEPTIC TANK SYSTEM
WITH SUBSURFACE,
SOIL ABSORPTION,
EFFLUENT DISCHARGE

SIR. NO. 12804
T.C. NO. 033-022-09
MAP DATE 6-29-76

NAME OF OWNER Thompson, Paul & Bobbie

ADDRESS OF OWNER 322 McClure Circle, Charlotte, NC 28216

LOCATION OF LOT McClure Circle, Lot 18

The lot described above is not recommended for the installation of an individual septic tank system with subsurface, soil absorption, effluent discharge as determined under the Rules and Regulations of the North Carolina Department of Human Resources, Division of Health Services, Raleigh, N.C. Due to the following:

Soil Structure Massive.

Soil Permeability Unsuitable.

John R. Adkisson

John R. Adkisson, Environmentalist
On Premises Waste Disposal Section

JRA:glr

(Stencil No.)
EHD 398
7/77

FORM NO.
E-19-8-21-74

NORTH CAROLINA
DEPARTMENT OF HUMAN RESOURCES
DIVISION OF HEALTH SERVICES
RALEIGH, NORTH CAROLINA

APPENDIX H
SITE EVALUATION

APT 17801
033-022-04

(Ground Absorption Sewage Disposal)

OWNER: Paul Thompson
ADDRESS: 322 McClure Circle
COUNTY: Charlotte, N.C.
LOCATION OF SITE: McClure Circle

DATE REQUESTED: 7-8-77
PLAT NO.:
LOT SIZE: 30,000 sq ft

FACTORS	AREA 1	AREA 2	AREA 3	AREA 4
1. SLOPE (%)	(S) PS U — 2-6%	S PS U	S PS U	S PS U +
2. SOIL TEXTURE (12-36 in.) (Sandy, loamy, clayey, Note 2:1, Clay)	S 2:1 PS depending U (clay)	S PS U	S PS U	S PS U
3. SOIL STRUCTURE (12.36 in.) (Clayey Soils)	S PS massive (U)	S PS U	S PS U	S PS U
4. SOIL DEPTH (In.)	S PS 36-40" (U)	S PS U	S PS U	S PS U
5. RESTRICTIVE HORIZONS (In.) (Imprevious Strata, Rock)	S PS U	S PS U	S PS U	S PS U
6. SOIL DRAINAGE/GROUNDWATER (External & Internal)	S seasonal PS perched (U) high water Table	S PS U	S PS U	S PS U
7. SOIL PERMEABILITY (Percolation Rate)	S slow PS 72:00 min/in (U)	S PS U	S PS U	S PS U
8. OTHER (Specify)	S PS U	S PS U	S PS U	S PS U
9. SITE CLASSIFICATION	unsuitable			
SOIL SERIES	Helena			

S - Suitable PS - Provisionally Suitable U - Unsuitable

* See Diagram on Back (Include: Soil areas, property lines, roads, streams, gullies, wet areas, fill areas, wells, water bodies, slope patterns, etc)


Recommendations/Comments: Based the investigation, the soil on the lot was found to be unsuitable for the installation of septic tank system

Described By: William A. Marlin

Title: Soil Scientist Date: July 19 1977

DHS Form 2601 (2/77)
Sanitation

Lot rechecked 8-22-77
No change needed in Report - W. A. Marlin

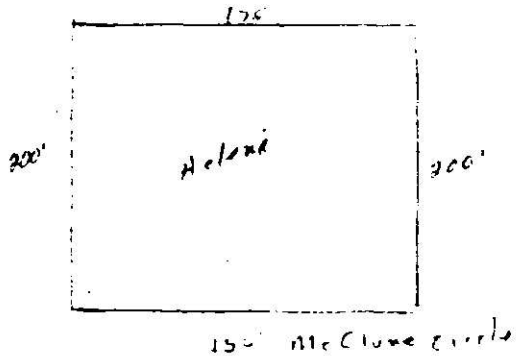
125'
200'
Leland
200'
150' McClure Circle

Date Received

APT No 12904

T C No

Map Date

MECKLENBURG COUNTY HEALTH DEPARTMENT

ENVIRONMENTAL HEALTH DIVISION

APPLICATION FOR PERCOLATION TEST

1) NAME OF OWNER Thompson (LAST) Paul V (FIRST) Robbie C (MIDDLE)

2) ADDRESS OF OWNER 320 McClure Circle ZIP 28216

3) PHONE NO. Home 399-6621 Office 334-6121


4) LOCATION OF PROPERTY McClure Circle (STREET OR COUNTY ROAD)

5) SUBDIVISION _____ LOT NO. 18 BLOCK NO. _____

MAP BOOK NO 30170 - 140554 PAGE NO. 418-22

6) DEED REFERENCE: DEED BOOK 033 PAGE NO. 022

Application is hereby made to the Mecklenburg County Health Department for the conduct of a percolation test and an on site inspection of the lot hereinabove described for the purpose of determining if the lot is suitable for the installation of an individual septic tank wastewater treatment system with subsurface, soil absorption, effluent discharge.

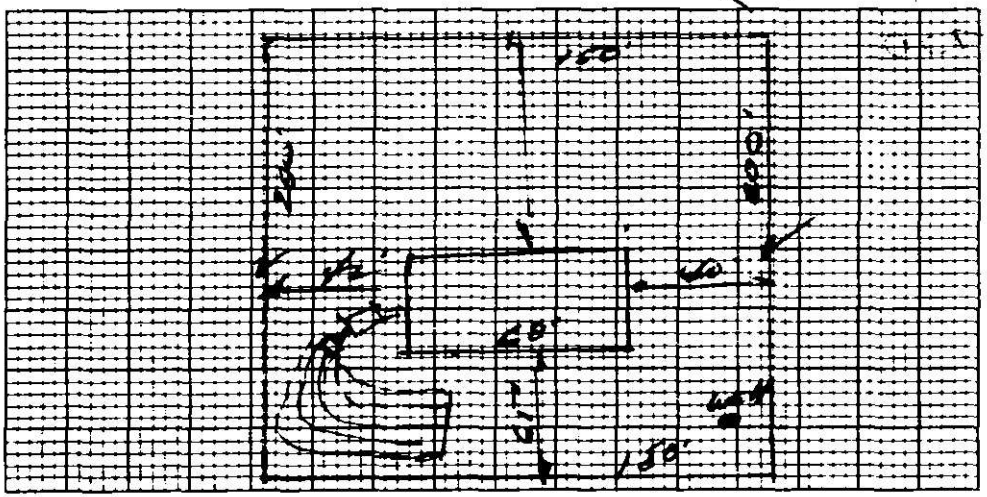

7) ACCURATELY DIAGRAM & DIMENSION LOT

Paul C Thompson Jr
OWNER

FORM NO. E-1-11-1-70

HEALTH DEPARTMENT'S COPY