Date Received 11-1-83

[illegible] DEPARTMENT OF [illegible]

SIR No. 20235

T. CR 033-024-04

Map Date _____

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH

APPLICATION FOR SOIL INVESTIGATION

1) NAME OF OWNER Tench (LAST) Donald (FIRST) Everette (MIDDLE)

2) ADDRESS OF OWNER 5035 Thrift Rd-51 CITY ZIP 28208

3) PHONE NO. Home 394-8737 Office _____


4) LOCATION OF PROPERTY [redacted] Oakdale Road (STREET OR COUNTY ROAD)

5) SUBDIVISION _____ LOT NO. _____ BLOCK NO. _____

MAP BOOK NO _____ PAGE NO. _____

6) DEED REFERENCE: DEED BOOK _____ PAGE NO. _____

Application is hereby made to the Mecklenburg County Department of Environmental Health for the conduct of a soil investigation and an on site inspection of the lot hereinabove described for the purpose of determining if the lot is suitable for the installation of an individual septic tank wastewater treatment system with subsurface, soil absorption, effluent discharge

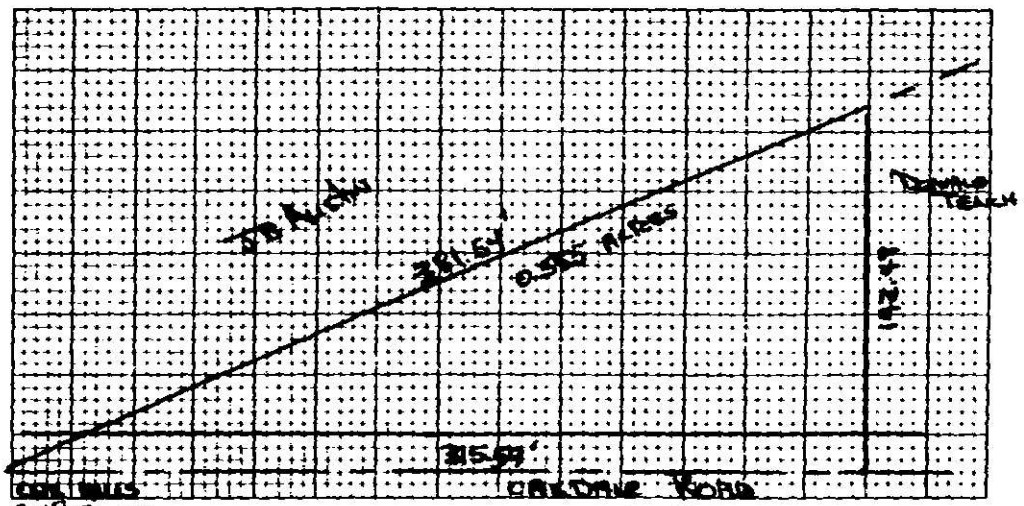

7) ACCURATELY DIAGRAM & DIMENSION LOT

Donald E. Tench
OWNER

EHD-5-74

ENVIRONMENTAL HEALTH DEPARTMENT'S COPY

DEPARTMENT OF ENVIRONMENTAL HEALTH
1200 BLYTHE BOULEVARD
CHARLOTTE, NORTH CAROLINA 28203

SIR. NO. 20235
T.C. NO. PO 033-074-04
DATE: 11-8-83

Donald E. Tench
5035 Thrift Road
Charlotte, NC 28208

RE: Property located at Oakdale Road

Dear Mr. Tench:

At your request, a field investigation was conducted on the property designated above and was classified unsuitable for the installation of a ground absorption sewage disposal system. A copy of the site evaluation report is enclosed for your information.

Sites classified as unsuitable may be utilized for soil absorption disposal systems provided engineering, hydrogeologic, soil and environmental studies indicate that a suitable septic tank system or a suitable alternate system can be reasonably expected to function satisfactorily.

Should you desire to file for permission to install an alternate system, plans and specifications prepared by a person with a demonstrated knowledge of ground absorption sewage treatment disposal systems, soil and rock characteristics, groundwater hydrology and drainage systems should be submitted to this office. They will be reviewed and if it is found that the system may be reasonably expected to function satisfactorily, approval will be given upon the execution by you of "Septic Tank Agreement Form" provided by this office.

If I may be of assistance, please feel free to call.

Sincerely,

Bill D. Hardister, Jr.
Environmental Health Supervisor

BDH/kbg

Enclosure

DEPARTMENT OF
ENVIRONMENTAL HEALTH
MECKLENBURG COUNTY,
NORTH CAROLINA

SITE EVALUATION

S.I.R. NO. 20235

T.C. NO. PO 033-074-04

(Ground Absorption Sewage Disposal)

OWNER: DONALD TENCH
ADDRESS: 5035 Thrift Rd 51 28208
LOCATION OF SITE: 3501 DeKalb Rd

PLAT NO:
LOT SIZE: 1655 A

FACTORS	AREA 1	AREA 2	AREA 3	AREA 4
1. SLOPE (%)	S PS Complex (U) Slopes	S PS U	S PS U	S PS U
2. SOIL TEXTURE (12-36 inches) Sandy, Loamy, Clayey (Note 2-1 Clay)	S PS Mixed (U) Clay	S PS U	S PS U	S PS U
3. SOIL STRUCTURE (12-36 inches)	S PS Weak (U) Blocky	S PS U	S PS U	S PS U
4. SOIL DEPTH (inches)	S PS 6-15 (U)	S PS U	S PS U	S PS U
5. RESTRICTIVE HORIZONS (Inches) (Impervious strata, Rock)	S (PS) None (U)	S PS U	S PS U	S PS U
6. SOIL DRAINAGE/GROUNDWATER (external and internal)	S PS-Slow (U)	S PS U	S PS U	S PS U
7. OTHER (Specify)	S PS U	S PS U	S PS U	S PS U
8. SOIL GROUP	IVe			
9. SITE CLASSIFICATION	Unsuitable			
10. SOIL SERIES	Complex Slopes on Wilkes			

S - Suitable PS - Provisionally Suitable U - Unsuitable

**See Diagram on Back (includes: soil areas, property lines, roads, streams, gullies, wet areas, fill areas, wells, water bodies, slopes)


Recommendations/Comments:

Described by: W. B. Kapucci
Title: Sanitarian

Date: 11-4-83

END 539 (Revised: 6/82)

24

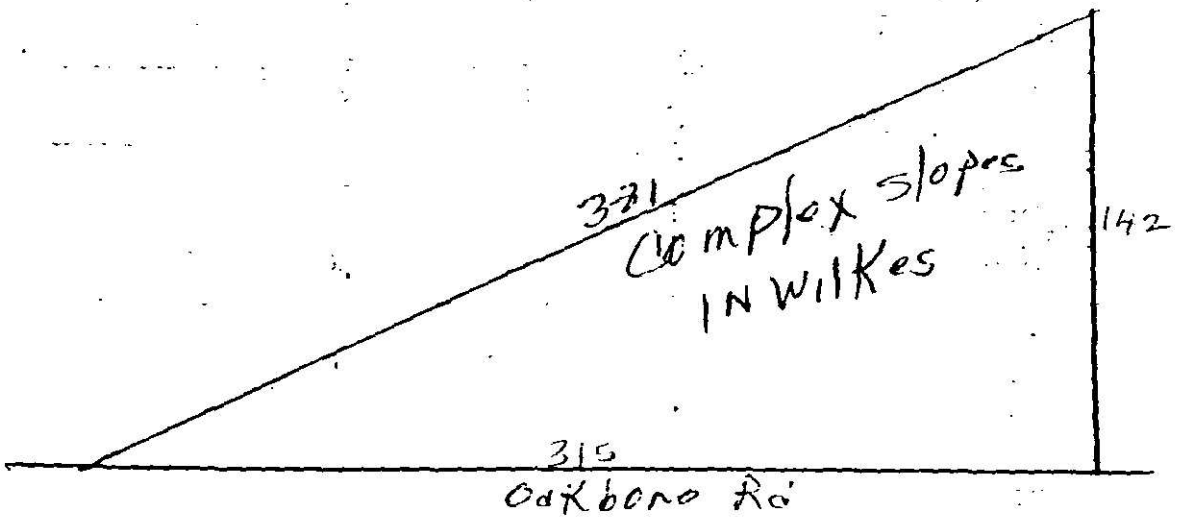
331
Complex slopes
IN Wilkes
142
315
Oakboro Rd