

15312 PAVILION HILL CR

01924323

1/8/2008

duponbj

Groundwater and Wastewater Services File Imaging Project
May 2007
Barcode Font = IDAutomationHC39M

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: PO 019-242-32
Lot #: 2
File #: 5543B
AppID: 1075
Code: 1

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

Owner: Simoni Builders
Applicant: Kenny Owens
Address: 1910 South Boulevard, Suite 200, Charlotte, N. C. 28203
Date Evaluated: 11/3/06
Proposed Facility: Residence
Design Flow (.1949): 600gpd
Property Size: 1.44a
Location of Site: 15312 Pavilion Hill Circle
Property Recorded:
Water Supply: [ ] Public [x] Individual [x] Well [ ] Spring [ ] Other
Evaluation Method: [x] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 .1941 Structure/ Texture	.1941 Consistence Mineralogy	b PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
1	LS, 6	0-7	GR/SCL	FR/SEXP/SS/SP	>48" TO SOIL WETNESS	48+	N/A	NIONE	PS, IV
		7-48	SBK/C	FI/SEXP/S/P					.3GPD/FT^2
2	"	0-5	GR/SCL	FR/SEXP/SS/SP	"	"	"	"	PS, IV
		5-29	SBK/CL	"					.25GPD/FT^2
		29-48	SBK/C	FI/SEXP/S/P					
3	"	0-16	GR/SCL	FR/SEXP/SS/SP	"	"	"	"	"
		16-48	SBK/C	FI/SEXP/S/P					
4	"	0-6	GR/SCL	FR/SEXP/SS/SP	"	"	"	"	PS, IV
		6-48	SBK/C	FI/SEXP/S/P					.275GPD/FT^2
5	"	0-8	GR/SCL	FR/SEXP/SS/SP	"	"	"	"	"
		8-48	SBK/C	FI/SEXP/S/P					
6	"	0-9	GR/SCL	FR/SEXP/SS/SP	>46" TO SOIL WETNESS	46	"	"	"
		9-43	SBK/C	FI/SEXP/S/P					
		43-46	SBK/CL	FR/SEXP/SS/SP					
7	"	0-10	GR/SCL	"	>48" TO SOIL WETNESS	48+	"	"	"
		10-48	SBK/C	FI/SEXP/S/P					
8	"	0-9	GR/SCL	FR/SEXP/SS/SP	"	"	"	"	"
		9-48	SBK/C	FI/SEXP/S/P					

Description	Initial System	Repair System
Available Space (.1945)	PS	PS
System Type(s)		
Site LTAR	.275GPD/FT^2	.275GPD/FT^2


Other Factors (.1946):
Site Classification (.1948): PROVISIONALLY SUITABLE
Evaluated By: W. R. Marlin, LSS, 11/7/2006 W. R. Marlin
Others Present:

COMMENTS:
100% repair, house site not designated at time of investigation

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace				
FP-Flood Plain		CL-Clay Loam		
		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

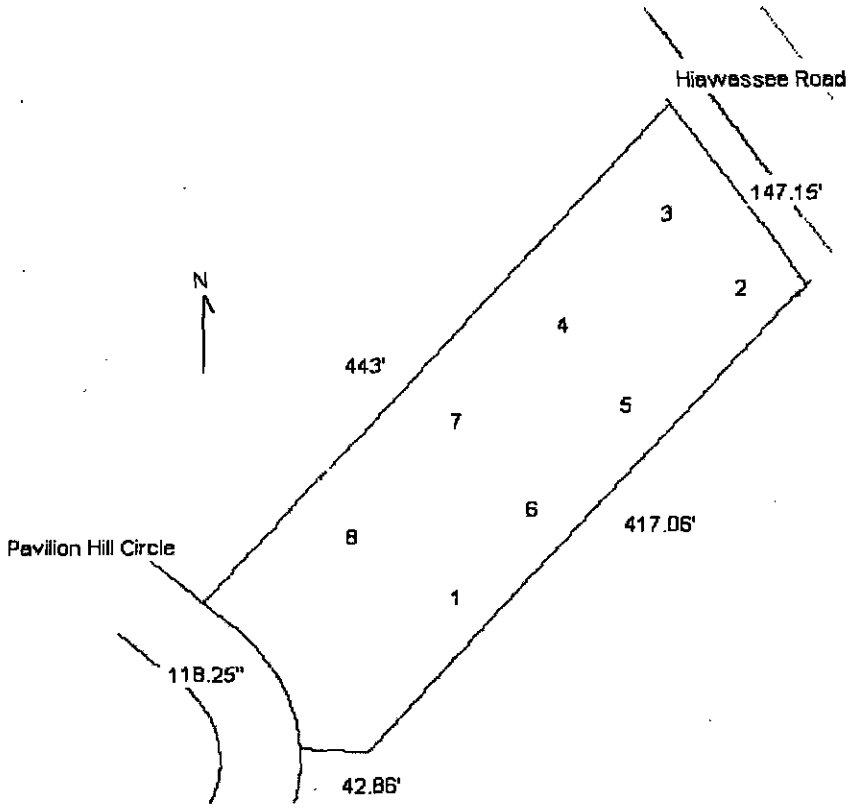

CONDITIONS OF IMPROVEMENT PERMIT

Permit Number: **5543B**

Tax Number: ***199-371-03***

- The IMPROVEMNET PERMIT is subject to revocation if site plans or the intended use change. There is to be **NO** grading, filling, or disturbance of the soil in the area of the septic tank system or repair area.
- CONSTRUCTION AUTHORIZATION must be obtained prior to receiving a Building Permit. The Construction Authorization is **NOT** transferable. Do not clear, grade, fill or disturb soil prior to obtaining a Construction Authorization.
- Domestic-type wastewater only. No industrial process wastewater may be discharged into the system.

Basement: ☒ Yes ☐ No ☐ Partial Basement

Primary Wastewater System

Type: ☐ I ☐ II ☒ III ☐ IV ☐ V ☐ VI

☐ Conventional
☐ Prefabricated, permeable block panel system
☐ Shallow Placed Conventional
☐ Low Pressure Pipe
☐ Large Diameter Pipe
☐ Fill
☐ Other
☒ Innovative or Experimental:

0.3 Long-term acceptance rate (GPD/ft^2)	**600** Max gallons/day wastewater flow	**1500** Absorption Area (ft^2)	**9** Trench spacing (min. on centers) (ft)
Serviced by private well: ☐ Yes ☒ No	**1500** Gallon septic tank	**500** Total trench length (ft)	**24** *Maximum trench depth (in)* (*At least 12" of provisionally suitable soil must remain between trench bottom and unsuitable soil conditions.*)
5 Bedrooms in residence	**1500** Gallon pump tank	**na** *Depth of stone (in)*	

Any surface water present: **No** Type: Minimum separation distance (ft):

Additional conditions: **Install according to plans on file submitted by Toney Jacobs and associates. Install pressure manifold.**

Repair Area System

Type: ☐ I ☐ II ☒ III ☐ IV ☐ V ☐ VI

☐ Conventional
☐ Prefabricated, permeable block panel system
☐ Shallow Placed Conventional
☐ Low Pressure Pipe
☐ Large Diameter Pipe
☐ Fill
☐ Other
☒ Innovative or Experimental:

1500 Absorption Area (ft^2) **500** Total trench length (ft)	**na** Depth of stone (in)	**9** Trench spacing (min. on centers) (ft)	**24** Maximum trench depth (in)

The undersigned, an authorized agent of the MECKLENBURG COUNTY HELTH DEPARTMENT, certifies that the Department has approved the Request for the Job Location contained in this document. The approval is granted in accordance with the provisions of Laws and Rules For Sewage, Treatment and Disposal in effect at the time of issuance of the permit and is subject to the following provisions:

*** No work shall be conducted on the septic tank system until an Installation, Construction, Alteration and/or Repair Approval is granted by this Department.

*** This Improvement permit is transferable.

R.S. 8/4/04

DENR Authorized Agent Date

Owner/Agent Signature Date

MECKLENBURG COUNTY
HEALTH DEPARTMENT
ENVIRONMENTAL HEALTH DIVISION
c/o HAL MARSHALL CTR.
SUITE 211
700 N. TRYON ST.
CHARLOTTE, NC 28202
(704) 336-5103

NORTH CAROLINA DEPARTMENT OF
ENVIRONMENTAL, HEALTH, AND
NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

TONEY C. JACOBS & ASSOCIATES, INC.

Consulting Soil Scientists

Licensed by the North Carolina Board for Licensing of Soil Scientists

Certified by the American Registry of Certified Professionals in Agronomy, Crops and Soils

168 Broadbill Drive
Mooresville, NC 28117
Phone (704) 663-6905
Fax (704) 662-9845 E-mail jacobs@i-america.net

David's Copy

June 21, 2004

To: Mr. David Cornelius, R.S.
Mecklenburg County Env. Health Dept.

From : Toney C. Jacobs
Paul G. Penninger

RE: Request for an Improvement Permit for lot 8 at The Sanctuary:
MCHD file # 5543B

Crescent Resources is requesting an Improvement Permit for lot 8 at The Sanctuary Subdivision for a **5** bedroom, basement home. Mr. Bill Marlin of the MCHD evaluated the soils on 5-10-04 and determined the septic area is PS at an 0.3 gpd/ft^2 LTAR. Toney C. Jacobs and Associates, Inc. has flagged a 25% reduction septic system and repair on the off-lot septic area, as shown on the attached sketch.

We understand a building permit cannot be issued until your office issues an Authorization to Construct (ATC). The buyer of the lot will apply for the ATC. If the buyer's house pad does not fit in the "building envelope" shown on the Improvement Permit, we understand the proposed system may have to be modified prior to your office issuing the ATC. **No grading shall take place on lot prior to obtaining the ATC from the MCHD.**

Tri-County Wastewater (TCWW) is under contract to supply maintenance services for each septic system installed at The Sanctuary. TCWW will have a list of preferred septic contractors for the subdivision and will also have requirements for the installation of the septic systems that are greater that the state requirements. It will be the responsibility of TCWW to enforce any requirements above state requirements or the conditions on the Improvement Permit or ATC.

Please review the attached system sketch and design specifications for the Improvement Permit. Please call if you have and questions, comments, or corrections.

Design Specifications for Lot 8 at

The Sanctuary, MCHD File # 5543B

System Type:	primary:	pressure manifold , 25% reduction
	repair:	pressure manifold , 25% reduction
Daily design flow:		600 gpd
Septic tank size:		1500 gal. (2 compartments)
Pumping tank size:		1500 gal.
Effluent loading rate:		0.3 gpd/ft^2 for primary and repair
Number and length of laterals:		4@ 125 ft. 25% reduction
Flow rate through the system:		22 gpm –use ½ in. SCH 80 taps with 2 ft. head pressure on pressure manifold (5.5 gpm per tap)
Pump requirements:		to be calculated by installer or owners agent when specific house and pump tank location are available
Dosing volume:		approx. 270 gal. – 2.2 doses/day at design flow
Depth of water pumped per dose:		calculated to specific tank by measure or dealer engineering specifications (1 cubic ft. of water equals 7.48 gal.)
Check valve:		YES
Siphon break hole:		No

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: PO 199-371-03
Lot #: 8
File #: 5543B
Code: 1

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

Owner: The Sanctuary at Lake Wylie
Address: 10933 Ballantyne Crossing Ave., Charlotte, N. C. 28277
Proposed Facility: Residence Design Flow (.1949): 600gpd
Location of Site: Ninebark Trail
Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [x] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

Applicant: Toney Jacobs
Date Evaluated: 05/10/2004
Property Size: .5a inv.
Property Recorded:

PROFILE #	1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY 1941		OTHER PROFILE FACTORS				
			1941 Structure/ Texture	1941 Consistence Mineralogy	1942 Soil Wetness/ Color	1943 Soil Depth (IN.)	1956 Sapro Class	1944 Restr. Horiz	Profile Class & LTAR
1	R, 5	0-2	GR/L	FR/SEXP/NS/NP	>49" TO SOIL WETNESS	49	N/A	NONE	PS, IV .3GPD/FT^2
		2-40	SBK/C	FI/SEXP/S/P					
		4-49	SBK/CL	FR/SEXP/SS/SP					
2	"	0-8	GR/CL	"	>48" TO SOIL WETNESS	48	"	"	"
		8-38	SBK/C	FI/SEXP/S/P					
		38-48	SBK/CL	FR/SEXP/SS/SP					
3	"	0-8	GR/CL	"	"	"	"	"	"
		8-39	SBK/C	FI/SEXP/S/P					
		39-48	SBK/CL	FR/SEXP/SS/SP					

Description	Initial System	Repair System
Available Space (.1945)	PS	PS
System Type(s)		
Site LTAR	.3GPD/FT^2	.3GPD/FT^2

Other Factors (.1946):
Site Classification (.1948): PROVISIONALLY SUITABLE
Evaluated By: W. R. Marlin, LSS, 5/10/2004
Others Present:

COMMENTS:

100% repair, drainfield areas located in common open space, would need pump

Landscape Position	Group	Texture	.1955 LTAR
R-Ridge	I	S-Sand	1.2 - 0.8
SS-Shoulder Slope		LS-Loamy Sand	
LS-Linear Slope			
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6
NS-Nose Slope		L-Loam	
HS-Head Slope			
CC-Concave Slope	III	SI-Silt	0.6 - 0.3
CV-Convex Slope		SICL-Silty Clay Loam	
T-Terrace		CL-Clay Loam	
FP-Flood Plain		SCL-Sandy Clay Loam	
	IV	SC-Sandy Clay	0.4 - 0.1
		SIC-Silty Clay	
		C-Clay	


Structure
SG-Single Grain
M-Massive
CR-Crumb
GR-Granular
SBK-Subangular Blocky
ABK-Angular Blocky
PL-Platy
PR-Prismatic


Consistence
Moist
VFR-Very Friable
FR-Friable
FI-Firm
VFI-Very Firm
EFI-Extremely Firm

Consistence
Wet
NS-Non-Sticky
SS-Slightly Sticky
S-Sticky
VS-Very Sticky
NP-Non-Plastic
SP-Slightly Plastic
P-Plastic
VP-Very Plastic

Mineralogy
SEXP-Slightly Expansive
EXP-Expansive

Sketch of Soil Evaluation Locations

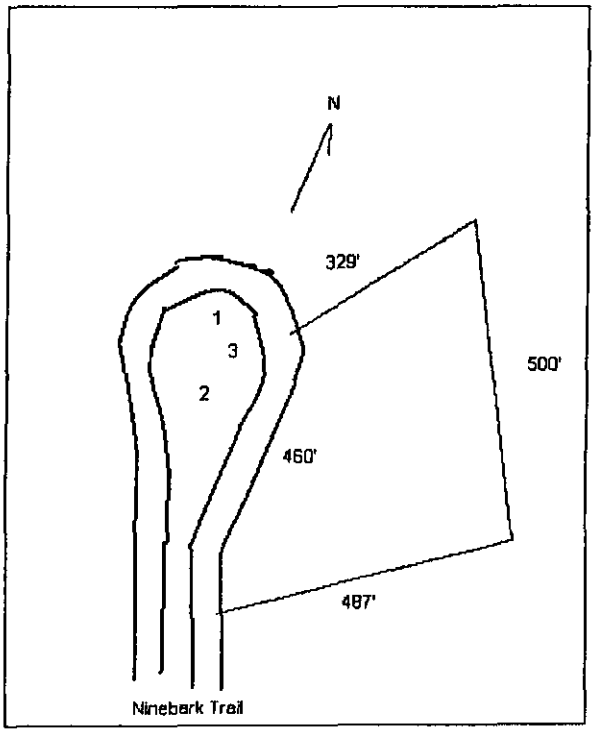

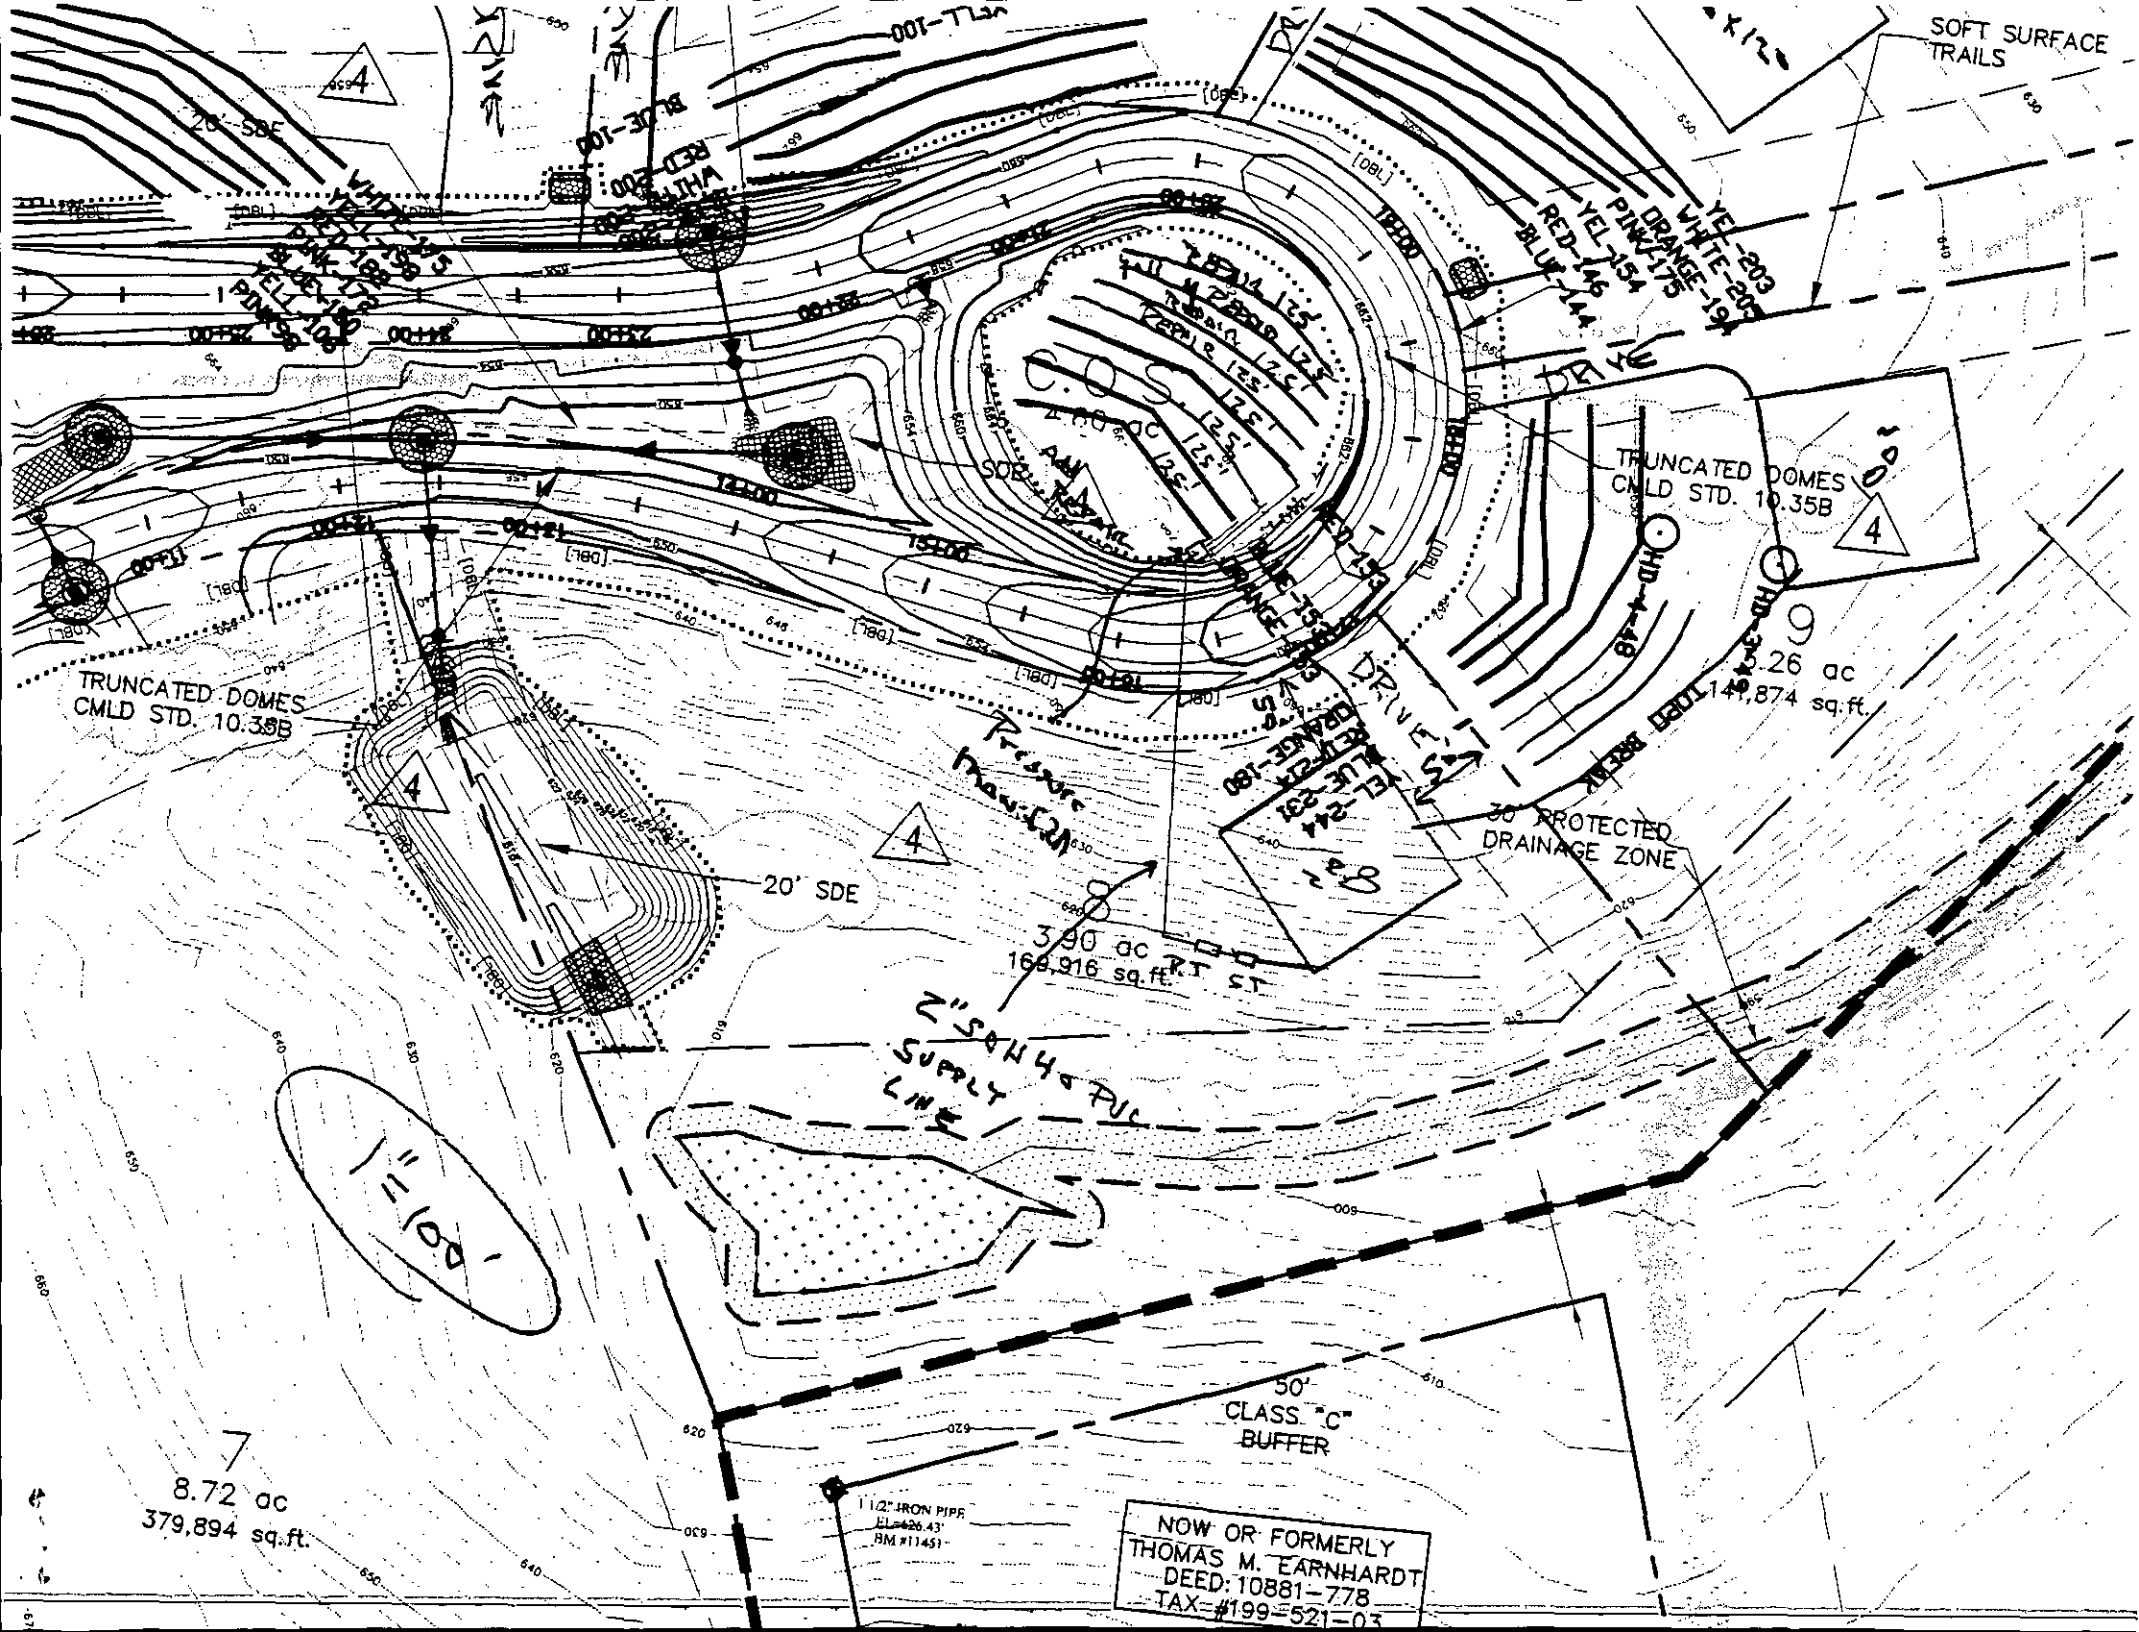
SOFT SURFACE TRAILS
TRUNCATED DOMES CMLD STD. 10.35B
TRUNCATED DOMES CMLD STD. 10.35B
20' SDE
20' SDE
30' PROTECTED DRAINAGE ZONE
3.90 ac
169,916 sq.ft.
9
5.26 ac
149,874 sq.ft.
7
8.72 ac
379,894 sq.ft.
2" SCH 40 PVC SUPPLY LINE
50' CLASS "C" BUFFER
1" = 100'
1/2" IRON PIPE EL=626.43' BM #1145
NOW OR FORMERLY
THOMAS M. EARNHARDT
DEED: 10881-778
TAX: #199-521-03

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: PO 199-371-03
Lot #: 8
File #: 5543B
Code: 1

ACS

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Owner: The Sanctuary at Lake Wylie
Address: 10933 Ballantyne Crossing Ave., Charlotte, N. C. 28277
Proposed Facility: Residence Design Flow (.1949): 600gpd
Location of Site: Ninebark Trail

Applicant: Toney Jacobs
Date Evaluated: 05/10/2004
Property Size: .5a inv.
Property Recorded:

Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [x] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 .1941 Structure/ Texture	SOIL MORPHOLOGY .1941 .1941 Consistence Mineralogy	OTHER PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
1	R, 5	0-2	GR/L	FR/SEXP/NS/NP	>49" TO SOIL WETNESS	49	N/A	NONE	PS, IV .3GPD/FT^2
		2-40	SBK/C	FI/SEXP/S/P					
		4-49	SBK/CL	FR/SEXP/SS/SP					
2	"	0-8	GR/CL	"	>48" TO SOIL WETNESS	48	"	"	"
		8-38	SBK/C	FI/SEXP/S/P					
		38-48	SBK/CL	FR/SEXP/SS/SP					
3	"	0-8	GR/CL	"	"	"	"	"	"
		8-39	SBK/C	FI/SEXP/S/P					
		39-48	SBK/CL	FR/SEXP/SS/SP					

Description	Initial System	Repair System
Available Space (.1945)	PS	PS
System Type(s)		
Site LTAR	.3GPD/FT^2	.3GPD/FT^2

Other Factors (.1946):
Site Classification (.1948): PROVISIONALLY SUITABLE
Evaluated By: W. R. Marlin, LSS, 5/10/2004.
Others Present:


COMMENTS:

100% repair, drainfield areas located in common open space, would need pump

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace		CL-Clay Loam		
FP-Flood Plain		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

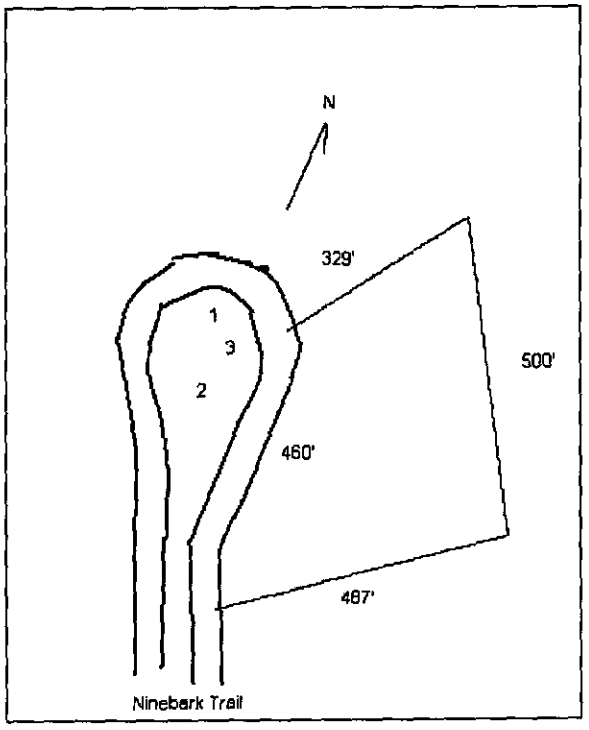

FEE: 100 200 00
DATE: 3-24-04
JKA

APPLICATION FOR IMPROVEMENT PERMIT FOR RESIDENTIAL SITE INDIVIDUAL WATER AND WASTEWATER SYSTEMS PROGRAM

[ ] CRT

TYPE APPLICATION: ___ NEW SYSTEM ___ EXPANSION/ ALTERATION OF EXISTING SYSTEM ___ REPAIR OF EXISTING SYSTEM

NORTH CAROLINA
DEPARTMENT OF ENVIRONMENT,
HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

FILE #: 5543B

PROPERTY INFORMATION (FROM ENGINEERING FORM) FOR JOB LOCATION:

TAX/PARCEL NUMBER: 199-371-03

STREET ADDRESS: Island Point Rd

SUBDIVISION OR MOBILE HOME PARK NAME: The Sanctuary at Lake Wylie, LLC

LOT NUMBER: 8

TYPE OF BUILDING (CHECK ONE):

___ SINGLE MOBILE HOME(S)
___ DOUBLE WIDE (D)
___ HOUSE (H)
___ MODULAR HOME (M)
___ MULTIPLE FAMILY (U)
___ OTHER (O)

TOWNSHIP (CHECK ONE):

✓ 0 MECKLENBURG
___ 1 CHARLOTTE
___ 2 DAVIDSON
___ 3 CORNELIUS
___ 4 PINEVILLE
___ 5 MATTHEWS
___ 6 HUNTERSVILLE
___ 7 MINT HILL

HEATED SQUARE FOOTAGE:

NUMBER OF BEDROOMS:

NUMBER OF OCCUPANTS:

CLOSING DATE _____

FOUNDATION FOR RESIDENCE:

___ WITHOUT BASEMENT
___ ON SLAB
___ CRAWL SPACE
___ WITH BASEMENT /PLUMBING
___ WITH BASEMENT /NO PLUMBING

IF EXPANSION/ALTERATION OF EXISTING SYSTEM, DESCRIBE THE PROPOSED BUILDING ADDITION:

WILL THERE BE A HOME BUSINESS IN THE RESIDENCE: ___ YES ✓ NO TYPE: _____

WATER SUPPLY (CHECK ONE):

___ COMMUNITY (C)
___ SHARED WELL (S)
✓ MUNICIPAL (M)
___ OTHER 'SPRINGS' (O)
___ PRIVATE WELL (P)

IF ANY OF THE FOLLOWING ARE LOCATED ON THE PROPERTY, PLEASE SHOW LOCATION ON PLAT:

BURIED CABLES, LANDFILLS, STUMPHOLES ___ YES ✓ NO
EXISTING WASTEWATER SYSTEMS ___ YES ___ NO
EASTMENTS OR RIGHT-OF-WAYS ✓ YES ___ NO
WELL, SPRINGS OR WATERLINES ___ YES ✓ NO
DESIGNATED WETLANDS ___ YES ✓ NO

PROPERTY OWNER:

NAME: (LAST) The Sanctuary at Lake Wylie, LLC (FIRST) (MI)

ADDRESS: 10933 Ballantyne Crossing Ave

CITY: Charlotte STATE: NC ZIP: 28277

DAYTIME PHONE: 704 544-0201 ext 226

LEGAL AGENT FOR PROPERTY OWNER, IF APPLICABLE:

NAME: (LAST) Jacobs (FIRST) Tony (MI) C

DAYTIME PHONE: 704 663-6905

m 704 582 9219

WHAT DATE WAS THE PROPERTY ORIGINALLY DEEDED AND RECORDED? _____

An Improvement Permit is subject to suspension or revocation if site plans or the intended use change or if information submitted in this application is falsified or changed. The undersigned, owner, or legal agent for the owner, of the property described above as the "Job Location" has read the foregoing application, acknowledges that the contents of same are true, and authorizes agents of the Mecklenburg County Health Department to enter onto the property for the purpose of processing this request.

SIGNED: Tony C Jacobs, CPSS (Agent) DATE: 3/24/04

MECKLENBURG COUNTY HEALTH DEPARTMENT
ENVIRONMENTAL HEALTH DIVISION
c/o HAL MARSHALL CTR., SUITE 211, 700 N. TRYON ST., CHARLOTTE, N.C. 28202., (704) 336-5102