

10915 HERMIT THRUSH LN

19935311

1/8/2008

duponbj

Groundwater and Wastewater Services File Imaging Project
May 2007
Barcode Font = IDAutomationHC39M

Groundwater & Wastewater Services
Septic Project File & Data Review Worksheet

GWS File #: 5485B WASPS App #: _____

Primary ES assigned to project: CS

Secondary ES assigned to project: _____

Project Type: New System ☑ Alteration ☐ Repair ☐ Modified Plot Plan ☐

I. File Review:

Rule or Law	Permit Application			
.1937(d)	Is the Application complete	Yes ☑	No ☐	N/A ☐
.1937(d)	Is there a Site plan/Plat with application	Yes ☑	No ☐	N/A ☐
.1937(d)	Is the Facility shown?	Yes ☑	No ☐	N/A ☐
.1937(d)	Are appurtenances shown	Yes ☑	No ☐	N/A ☐
	Site Evaluation Information			
.1939 (a)(1)	Topography and Landscape Position Recorded?	Yes ☑	No ☐	N/A ☐
.1940 (a-g)	Slope % Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Texture Class Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Structure type Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Consistence Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Mineralogy Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(3)	Soil Wetness Condition Recorded?	Yes ☐	No ☐	N/A ☑
.1939 (a)(4)	Soil Depth to Rock or Parent Material Recorded When Encountered	Yes ☐	No ☐	N/A ☑
.1939 (a)(5)	Depth to Restrictive Horizons Recorded When Encountered?	Yes ☐	No ☐	N/A ☑
.1939 (a)(6)	Sufficient Available Space Recorded?	Yes ☐	No ☐	N/A ☑
.1937(m)	Are the Profile Locations Shown?			
.1939(a)	Are the S/PS Profiles in system & in repair area?	Yes ☑	No ☐	N/A ☐
& .1945(b)	Number of auger borings made: 4 Were sufficient auger borings made?	Yes ☑	No ☐	N/A ☐
.1939(d), .1955, .1956, .1957	LTAR 3	Yes ☑	No ☐	N/A ☐
	Improvement Permit/Construction Authorization			
.1937(g) 130A-336(a)	*Proposed System Type stated-Initial*	Yes ☑	No ☐	N/A ☐
.1945(b)	Proposed System Type stated-Repair	Yes ☑	No ☐	N/A ☐
130A-336 (a)(3)	System location identifiable by setbacks - Initial	Yes ☑	No ☐	N/A ☐
.1937(g) .1945(b)	System components shown – Initial	Yes ☑	No ☐	N/A ☐
.1945(b)	Repair area shown	Yes ☑	No ☐	N/A ☐
.1937 (f)(g)	Does System design match facility, flow & WWcharacteristics?	Yes ☑	No ☐	N/A ☐
.1937 (f)(g)	Is System design consistent with soil/site conditions?	Yes ☑	No ☐	N/A ☐
.1937 (f)(g)	Is the System located in the approved area?	Yes ☑	No ☐	N/A ☐
130A-336(a)	Is the Design flow (gpd) indicated?	Yes ☑	No ☐	N/A ☐

130A-336(a)	Number of Bedrooms, employees, seats, etc. indicated?	Yes ☑	No ☐	N/A ☐
.1937(g)	Trench depth indicated?	Yes ☐	No ☐	N/A ☐
.1937(g)	Trench width indicated?	Yes ☑	No ☐	N/A ☐
.1937(g)	Trench length indicated?	Yes ☑	No ☐	N/A ☐
130A-336(a)(1)	Proposed/existing well shown?	Yes ☐	No ☐	N/A ☑
130A-336(a)(1)	Property line lengths shown?	Yes ☑	No ☐	N/A ☐
130A-336(a)	Facility/appurtenance setbacks shown from fixed points?	Yes ☑	No ☐	N/A ☐
	Operation Permit			
.1937(i)	System type as described in table V(a) of rule .1961	Yes ☐	No ☐	N/A ☐
.1937(i)	Conditions for system performance, operation, maintenance, monitoring and reporting.	Yes ☐	No ☐	N/A ☐

II. WASPS Review:

Construction authorization issued	Yes ☐	No ☐	N/A ☐
Installation approval issued	Yes ☐	No ☐	N/A ☐
Operation permit issued	Yes ☐	No ☐	N/A ☐
Other related documentation	Yes ☐	No ☐	N/A ☐

Items requiring correction/modification: _____

Comments:

_____

_____

_____

_____

_____

IA issued date: 3-14-08

OP issued date: _____

Review performed by: KR Date performed: 3/10/08

Mecklenburg County Groundwater & Wastewater Services
700 N. Tryon St., Suite 211 Charlotte, NC 28202
Phone: (704) 336-5103 Fax: (704) 336-6894

NC DENR
Division of Environmental Health
On-Site Wastewater Section

INSTALLATION APPROVAL for an
ON-SITE WASTEWATER TREATMENT & DISPOSAL SYSTEM

File #: 5485 B Permit #: _____ Tax Parcel #: 199-352-02

Property Owner: THE SANCTUARY @ LAKE WYLIE

Job Location Address: 10915 HERMIT THRUSH LN (LOT #76)

City: CHARLOTTE State: NC Zip Code: 28278

Installation Approval Issuance Date: 3/14/08

Permission is hereby given to ☑ install ☐ alter ☐ repair an on-site wastewater treatment & and disposal system, with subsurface soil absorption and effluent discharge, as specified herein at the described location. This approval is granted based upon the application information submitted to our office. All work shall be completed on or before 4/14/08, after which date this approval shall be null and void. The system shall meet all of the construction requirements of 15A NCAC 18A .1900 which are in effect on the date of granting this approval. An **Operation Permit** must be obtained from the Mecklenburg County Health Department before any system can be covered up or placed into service. The issuance of this permit does not in any way guarantee that the system anticipated to be constructed will operate properly, or relieve any person now of hereafter owning, controlling or using such system from any liability resulting from the failure of the system to operate properly.

***NOTICE: This system shall not be installed while soils are in a wet condition.**

Permitted Design Flow: 600 GPD

Site LTAR: .3 GPD/ft² (For new installations only.)

Liquid Capacity of Septic Tank: 1500 gallons

Liquid Capacity of Dosing Tank: 1500 gallons

Drainfield Design ☐ N/A

Trench Depth: 24 inches

Trench Width: 3 feet

Line Spacing: 9 feet (O.C.)

Total line length: 500 feet

# of Lines: 5 @ 100 feet

Depth of Media: 12 inches (Type) INNOVATIVE

Distribution Device: PRESSURE MANIFOLD

Bed Design *(For Repair Installations ONLY.)* ☑ N/A

Bed Depth: _____ inches

Bed Width: _____ feet

Total line length: _____ feet

# of Lines: _____ @ _____ feet

Depth of Media: _____ inches (Type) _____

Distribution Device: _____

Water Supply Source

☑ Municipal ☐ Private Well ☐ Community Well

☐ Other _____

Minimum System Setbacks

Distance from Building Foundation: 25 feet

Distance from Property Line: 10 feet

Distance from Water Supply Source: 10 feet

SKETCH OF SYSTEM LAYOUT
(Proposed Layout)

INSTALL IN ACCORDANCE W/ PLANS ON FILE SUBMITTED BY S+ME, INC.

CMS
3/14/08

Comments: System Classification & Type: IIIb PUMP 25% REDUCTION; TO BE INSPECTED BY GWS EVERY 5 YRS; INSTALL PER. 1961

DENR Authorized Agent: Chris Sherrill, RS, LSS Signature: Christopher M Sherrill

FEE: 200
DATE: 12-19-03 TKA

APPLICATION FOR IMPROVEMENT PERMIT FOR RESIDENTIAL SITE INDIVIDUAL WATER AND WASTEWATER SYSTEMS PROGRAM

[ ] CRT

TYPE APPLICATION: ___ NEW SYSTEM ___ EXPANSION/ ALTERATION OF EXISTING SYSTEM ___ REPAIR OF EXISTING SYSTEM

NORTH CAROLINA
DEPARTMENT OF ENVIRONMENT,
HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

FILE #: 54853

PROPERTY INFORMATION (FROM ENGINEERING FORM) FOR JOB LOCATION:

TAX/PARCEL NUMBER: 199-352-02

STREET ADDRESS: Harm CT THRUS H CANE

SUBDIVISION OR MOBILE HOME PARK NAME: The Sanctuary At Lake Wylie, LLC

LOT NUMBER: 76

TYPE OF BUILDING (CHECK ONE):

___ SINGLE MOBILE HOME(S)
___ DOUBLE WIDE (D)
✓ HOUSE (H)
___ MODULAR HOME (M)
___ MULTIPLE FAMILY (U)
___ OTHER (O)

TOWNSHIP (CHECK ONE):

✓ 0 MECKLENBURG
___ 1 CHARLOTTE
___ 2 DAVIDSON
___ 3 CORNELIUS
___ 4 PINEVILLE
___ 5 MATTHEWS
___ 6 HUNTERSVILLE
___ 7 MINT HILL

HEATED SQUARE FOOTAGE:

NUMBER OF BEDROOMS: 5 NUMBER OF OCCUPANTS:

CLOSING DATE _____

FOUNDATION FOR RESIDENCE:

___ WITHOUT BASEMENT ON SLAB
___ CRAWL SPACE
___ WITH BASEMENT /PLUMBING
___ WITH BASEMENT /NO PLUMBING

IF EXPANSION/ALTERATION OF EXISTING SYSTEM, DESCRIBE THE PROPOSED BUILDING ADDITION:

WILL THERE BE A HOME BUSINESS IN THE RESIDENCE: ___ YES ✓ NO TYPE: _____

WATER SUPPLY (CHECK ONE):

___ COMMUNITY (C)
___ SHARED WELL (S)
✓ MUNICIPAL (M)
___ OTHER 'SPRINGS' (O)
___ PRIVATE WELL (P)

IF ANY OF THE FOLLOWING ARE LOCATED ON THE PROPERTY, PLEASE SHOW LOCATION ON PLAT:

BURIED CABLES, LANDFILLS, STUMPHOLES ___ YES ✓ NO
EXISTING WASTEWATER SYSTEMS ___ YES ✓ NO
EASTMENTS OR RIGHT-OF-WAYS ✓ YES ___ NO
WELL, SPRINGS OR WATERLINES ___ YES ✓ NO
DESIGNATED WETLANDS ___ YES ✓ NO

PROPERTY OWNER:

NAME: (LAST) The Sanctuary At Lake Wylie, LLC (FIRST) (MI)
ADDRESS: 10933 Ballantyne Crossing Ave
CITY: Charlotte STATE: NC ZIP: 28277
DAYTIME PHONE: (704) 544-0201 ext 226

LEGAL AGENT FOR PROPERTY OWNER, IF APPLICABLE:


NAME: (LAST) Jacobs (FIRST) Tonay (MI) C
DAYTIME PHONE: 704 663-6905
m 704 582 9219

WHAT DATE WAS THE PROPERTY ORIGINALLY DEEDED AND RECORDED? _____

An Improvement Permit is subject to suspension or revocation if site plans or the intended use change or if information submitted in this application is falsified or changed. The undersigned, owner, or legal agent for the owner, of the property described above as the "Job Location" has read the foregoing application, acknowledges that the contents of same are true, and authorizes agents of the Mecklenburg County Health Department to enter onto the property for the purpose of processing this request.

SIGNED: Tonay C Jacobs, CPSS (Agent) DATE: 12/19/03

MECKLENBURG COUNTY HEALTH DEPARTMENT
ENVIRONMENTAL HEALTH DIVISION
c/o HAL MARSHALL CTR., SUITE 211, 700 N. TRYON ST., CHARLOTTE, N.C. 28202., (704) 336-5102

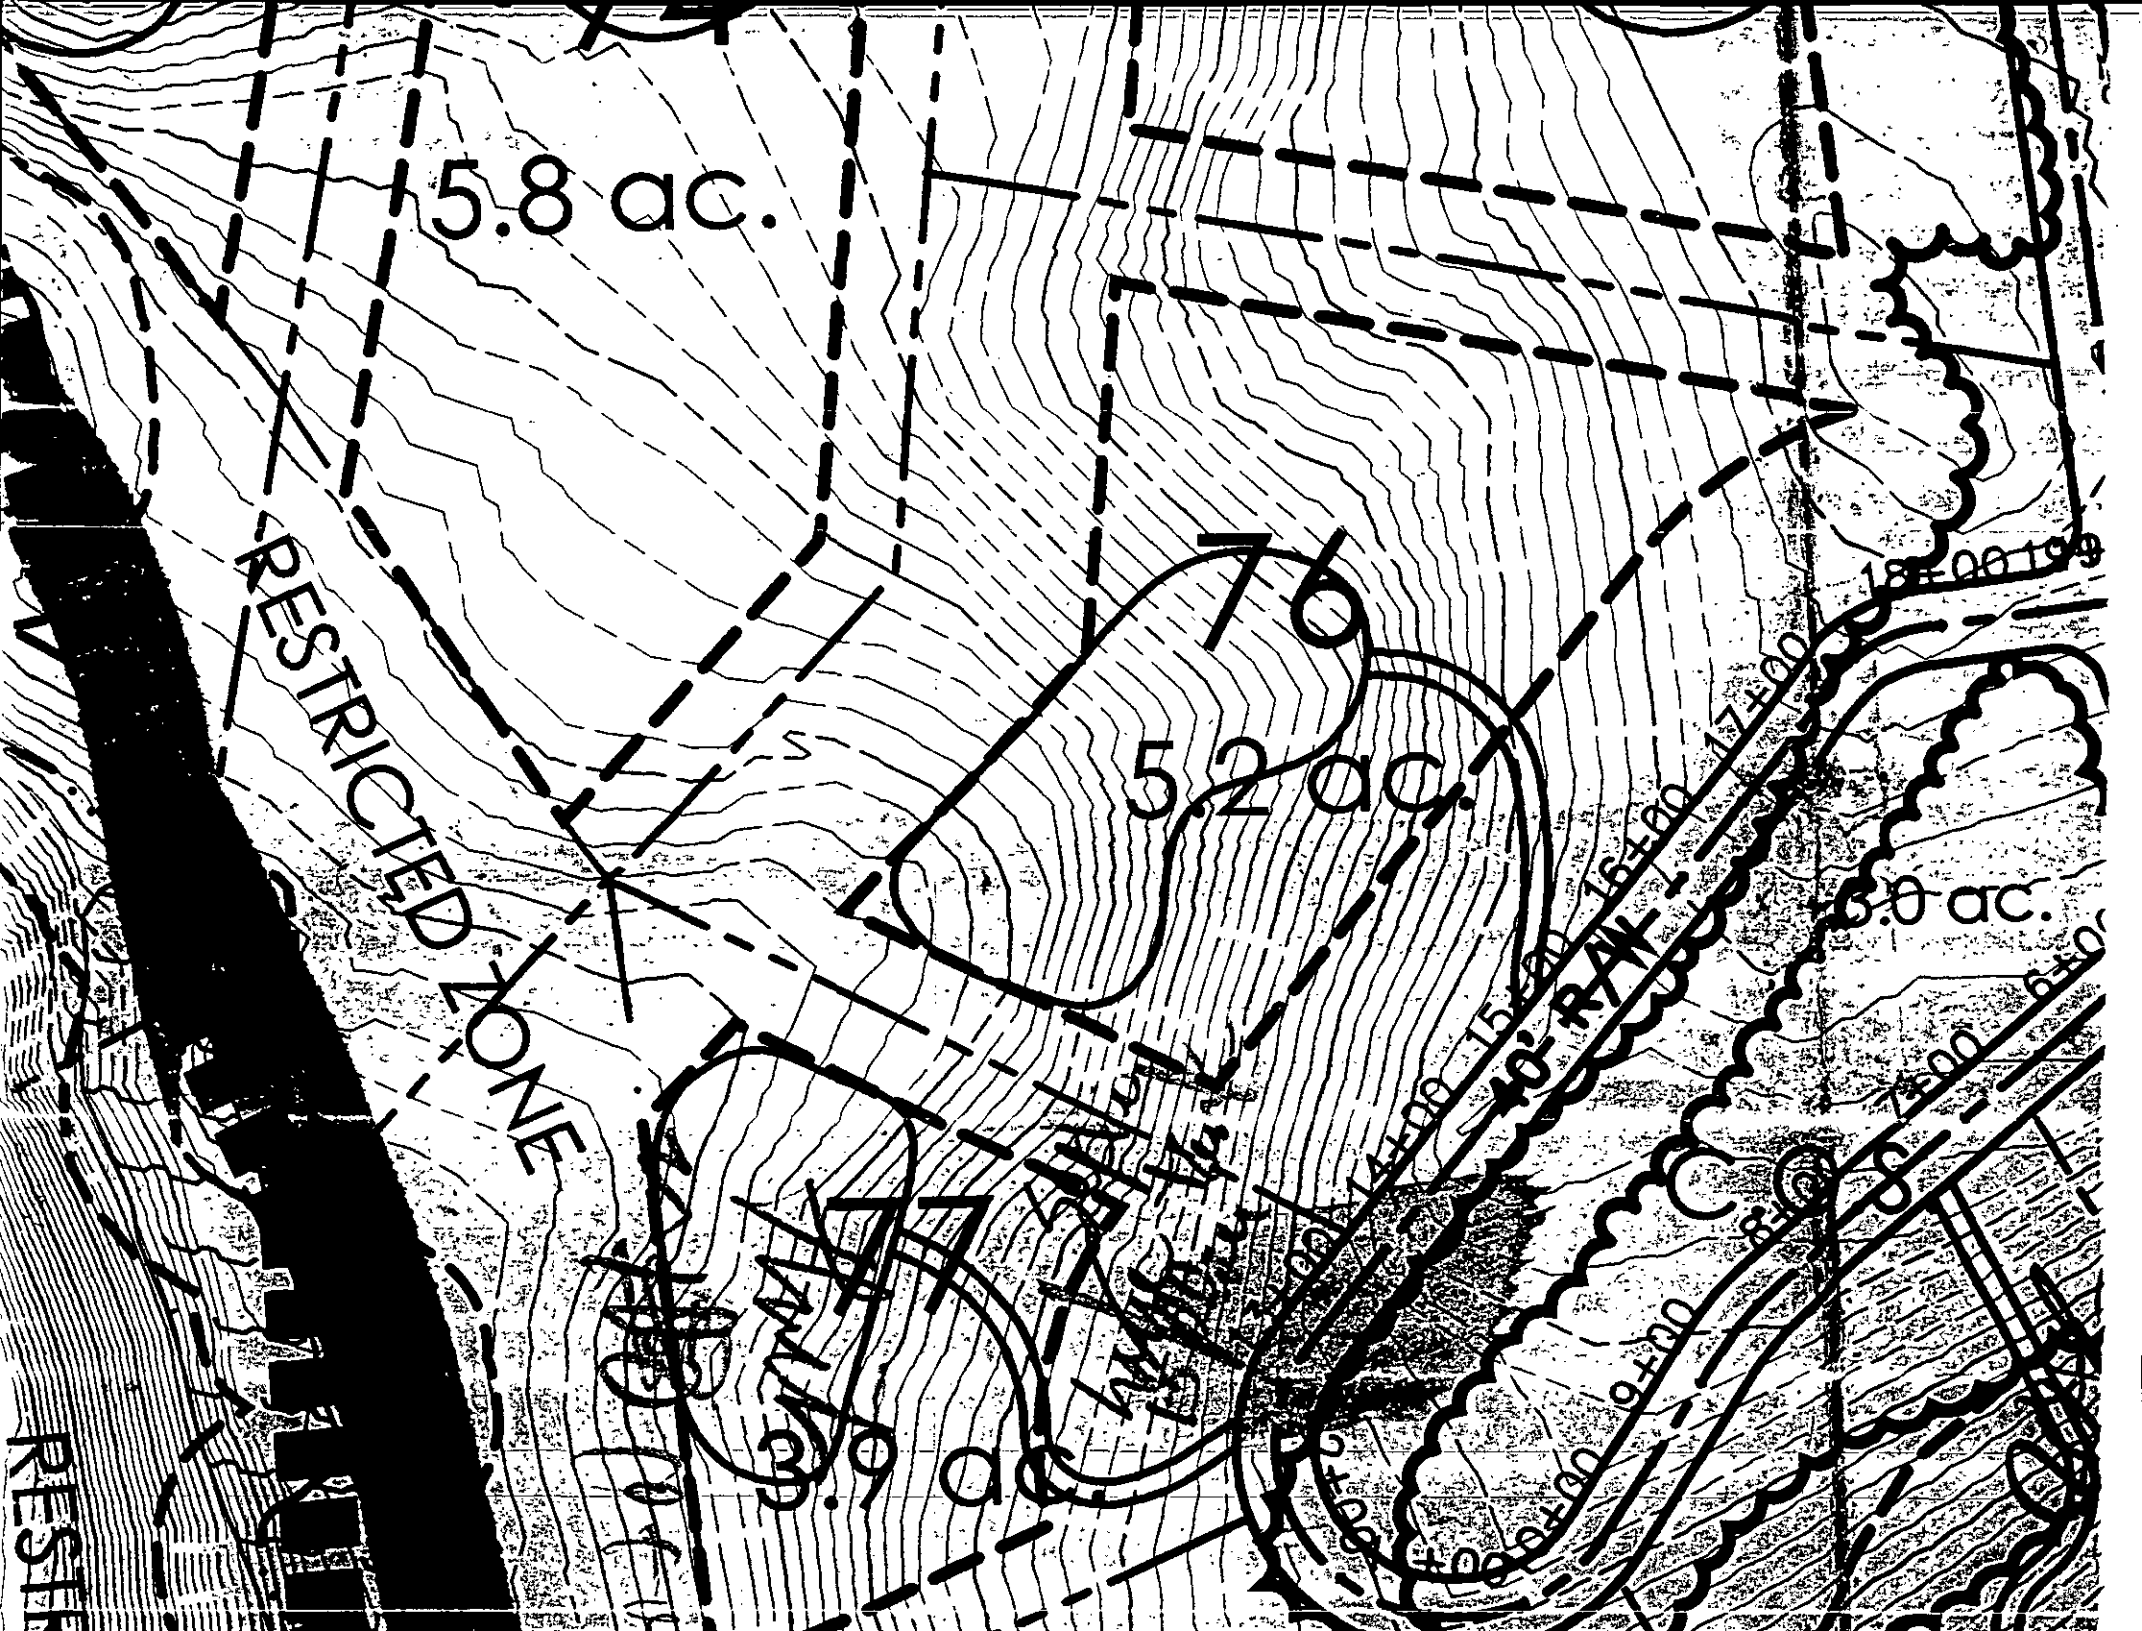
5.8 ac.
RESTRICTED ZONE
5.2 ac.
3.9 ac.
3.0 ac.
40' R/W
RESTRICTED ZONE

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 1
Property ID: PO 199-352-02
Lot #: 76
File #: 5485B
Code: 1

ACS

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Owner: The Sanctuary at Lake Wylie
Applicant: Toney Jacobs
Address: 10933 Ballantyne Crossing Ave., Charlotte, N. C. 28277
Date Evaluated: 04/30/2004
Proposed Facility: Residence
Design Flow (.1949): 600gpd
Property Size: .5a inv.
Location of Site: Hermit Thrush Lane
Property Recorded:
Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [x] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

PROFILE #	1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941		OTHER PROFILE FACTORS				Profile Class & LTAR
			1941 Structure/ Texture	1941 Consistence Mineralogy	1942 Soil Wetness/ Color	1943 Soil Depth (IN.)	1956 Sapro Class	1944 Restr Horiz	
1	LS, 12	0-4	GR/CL	FR/SEXP/SS/SP	>46" TO SOIL WETNESS	46	N/A	NONE	PS, IV
		4-39	SBK/C	FI/SEXP/S/P					.3GPD/FT^2
		39-46	SBK/CL	FR/SEXP/SS/SP					
2	"	0-4	GR/CL	"	>48" TO SOIL WETNESS	48	"	"	"
		4-48	SBK/C	FI/SEXP/S/P					
3	"	0-5	GR/CL	FR/SEXP/SS/SP	"	"	"	"	"
		5-48	SBK/C	FI/SEXP/S/P					
4	LS, 10	0-4	GR/CL	FR/SEXP/SS/SP	>49" TO SOIL WETNESS	49	"	"	"
		4-49	SBK/C	FI/SEXP/S/P					

Description	Initial System	Repair System
Available Space (.1945)	PS	PS
System Type(s)	IIIb	IVa
Site LTAR	.3GPD/FT^2	.3GPD/FT^2


Other Factors (.1946):
Site Classification (.1948): PROVISIONALLY SUITABLE
Evaluated By: W. R. Marlin, LSS, 5/4/2004, W.R. Marlin
Others Present:

COMMENTS:
100% repair, system will need pump

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Food Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace		CL-Clay Loam		
FP-Flood Plain		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

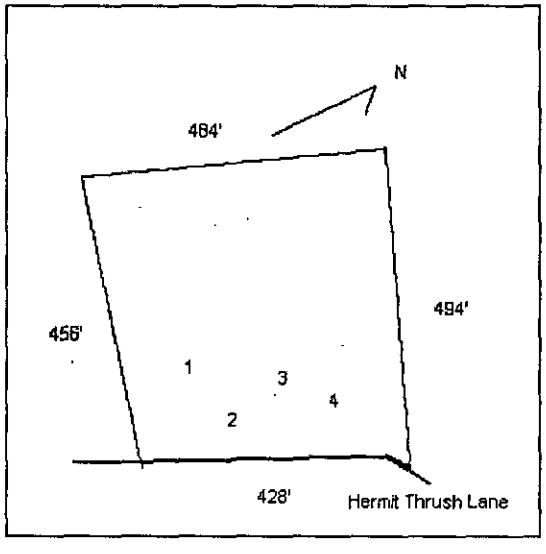

CONDITIONS OF IMPROVEMENT PERMIT

Permit Number: **5485B** Tax Number: **199-352-02**

- The IMPROVEMNET PERMIT is subject to revocation if site plans or the intended use change. There is to be **NO** grading, filling, or disturbance of the soil in the area of the septic tank system or repair area.
- CONSTRUCTION AUTHORIZATION must be obtained prior to receiving a Building Permit. The Construction Authorization is **NOT** transferable. Do not clear, grade, fill or disturb soil prior to obtaining a Construction Authorization.
- Domestic-type wastewater only. No industrial process wastewater may be discharged into the system.

Basement: ☒ Yes ☐ No ☐ Partial Basement

Primary Wastewater System

Type: ☐ I ☐ II ☒ III ☐ IV ☐ V ☐ VI

☐ Conventional
☐ Prefabricated, permeable block panel system
☐ Shallow Placed Conventional
☐ Low Pressure Pipe
☐ Large Diameter Pipe
☐ Fill
☐ Other
☒ Innovative or Experimental:

0.3 Long-term acceptance rate (GPD/ft^2)	600 Max gallons/day wastewater flow	1500 Absorption Area (ft^2)	9 Trench spacing (min. on centers) (ft)
Serviced by private well: ☐ Yes ☒ No	1500 Gallon septic tank	500 Total trench length (ft)	24 Maximum trench depth (in) (At least 12" of provisionally suitable soil must remain between trench bottom and unsuitable soil conditions.)
5 Bedrooms in residence	1500 Gallon pump tank	na Depth of stone (in)	

Any surface water present: **No** Type: Minimum separation distance (ft):

Additional conditions: ***Pressure Manifold***

Repair Area System

Type: ☐ I ☐ II ☐ III ☒ IV ☐ V ☐ VI

☐ Conventional
☒ Prefabricated, permeable block panel system
☐ Shallow Placed Conventional
☐ Low Pressure Pipe
☐ Large Diameter Pipe
☐ Fill
☐ Other
☐ Innovative or Experimental:

1000 Absorption Area (ft^2) 333 Total trench length (ft)	na Depth of stone (in)	8 Trench spacing (min. on centers) (ft)	24 Maximum trench depth (in)

The undersigned, an authorized agent of the MECKLENBURG COUNTY HELTH DEPARTMENT, certifies that the Department has approved the Request for the Job Location contained in this document. The approval is granted in accordance with the provisions of Laws and Rules For Sewage, Treatment and Disposal in effect at the time of issuance of the permit and is subject to the following provisions:

*** No work shall be conducted on the septic tank system until an Installation, Construction, Alteration and/or Repair Approval is granted by this Department.

*** This Improvement permit is transferable.

DENR Authorized Agent — Date: RS 6/29/04

MECKLENBURG COUNTY
HEALTH DEPARTMENT
ENVIRONMENTAL HEALTH DIVISION
c/o HAL MARSHALL CTR.
SUITE 211
700 N. TRYON ST.
CHARLOTTE, NC 28202
(704) 336-5103

Owner/Agent Signature — Date: 3.11.08

NORTH CAROLINA DEPARTMENT OF
ENVIRONMENTAL, HEALTH, AND
NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

TONEY C. JACOBS & ASSOCIATES, INC.

Consulting Soil Scientists

Licensed by the North Carolina Board for Licensing of Soil Scientists

Certified by the American Registry of Certified Professionals in Agronomy, Crops and Soils

168 Broadbill Drive
Mooresville, NC 28117
Phone (704) 663-6905
Fax (704) 662-9845 E-mail jacobs@i-america.net

June 21, 2004

To: Mr. David Cornelius, R.S.
Mecklenburg County Env. Health Dept.

From : Toney C. Jacobs
Paul G. Penninger

RE: Request for an Improvement Permit for lot 76 at The Sanctuary:
MCHD file # 5485B

Crescent Resources is requesting an Improvement Permit for lot **76** at The Sanctuary Subdivision for a **5** bedroom, basement home. Mr. Bill Marlin of the MCHD evaluated the soils on 5-4-04 and determined the septic area is PS at an 0.3 gpd/ft^2 LTAR. Toney C. Jacobs and Associates, Inc. has flagged a 25% reduction septic system and PPBPS repair on the lot, as shown on the attached sketch.

We understand a building permit cannot be issued until your office issues an Authorization to Construct (ATC). The buyer of the lot will apply for the ATC. If the buyer's house pad does not fit in the "building envelope" shown on the Improvement Permit, we understand the proposed system may have to be modified prior to your office issuing the ATC. **No grading shall take place on lot prior to obtaining the ATC from the MCHD.**


Tri-County Wastewater (TCWW) is under contract to supply maintenance services for each septic system installed at The Sanctuary. TCWW will have a list of preferred septic contractors for the subdivision and will also have requirements for the installation of the septic systems that are greater that the state requirements. It will be the responsibility of TCWW to enforce any requirements above state requirements or the conditions on the Improvement Permit or ATC.

Please review the attached system sketch and design specifications for the Improvement Permit. Please call if you have and questions, comments, or corrections.

Design Specifications for Lot 76 at

The Sanctuary, MCHD File # 5485B

System Type:	primary: repair:	pressure manifold , 25% reduction PPBPS
Daily design flow:		600 gpd
Septic tank size:		1500 gal. (2 compartments)
Pumping tank size:		1500 gal.
Effluent loading rate:		0.3 gpd/ft^2 for primary and repair
Number and length of laterals:		5@ 100 ft. 25% reduction
Flow rate through the system:		27.5 gpm –use ½ in. SCH 80 taps with 2 ft. head pressure on pressure manifold (5.5 gpm per tap)
Pump requirements:		to be calculated by installer or owners agent when specific house and pump tank location are available
Dosing volume:		approx. 270 gal. – 2.2 doses/day at design flow
Depth of water pumped per dose:		calculated to specific tank by measure or dealer engineering specifications (1 cubic ft. of water equals 7.48 gal.)
Check valve:		YES
Siphon break hole:		No

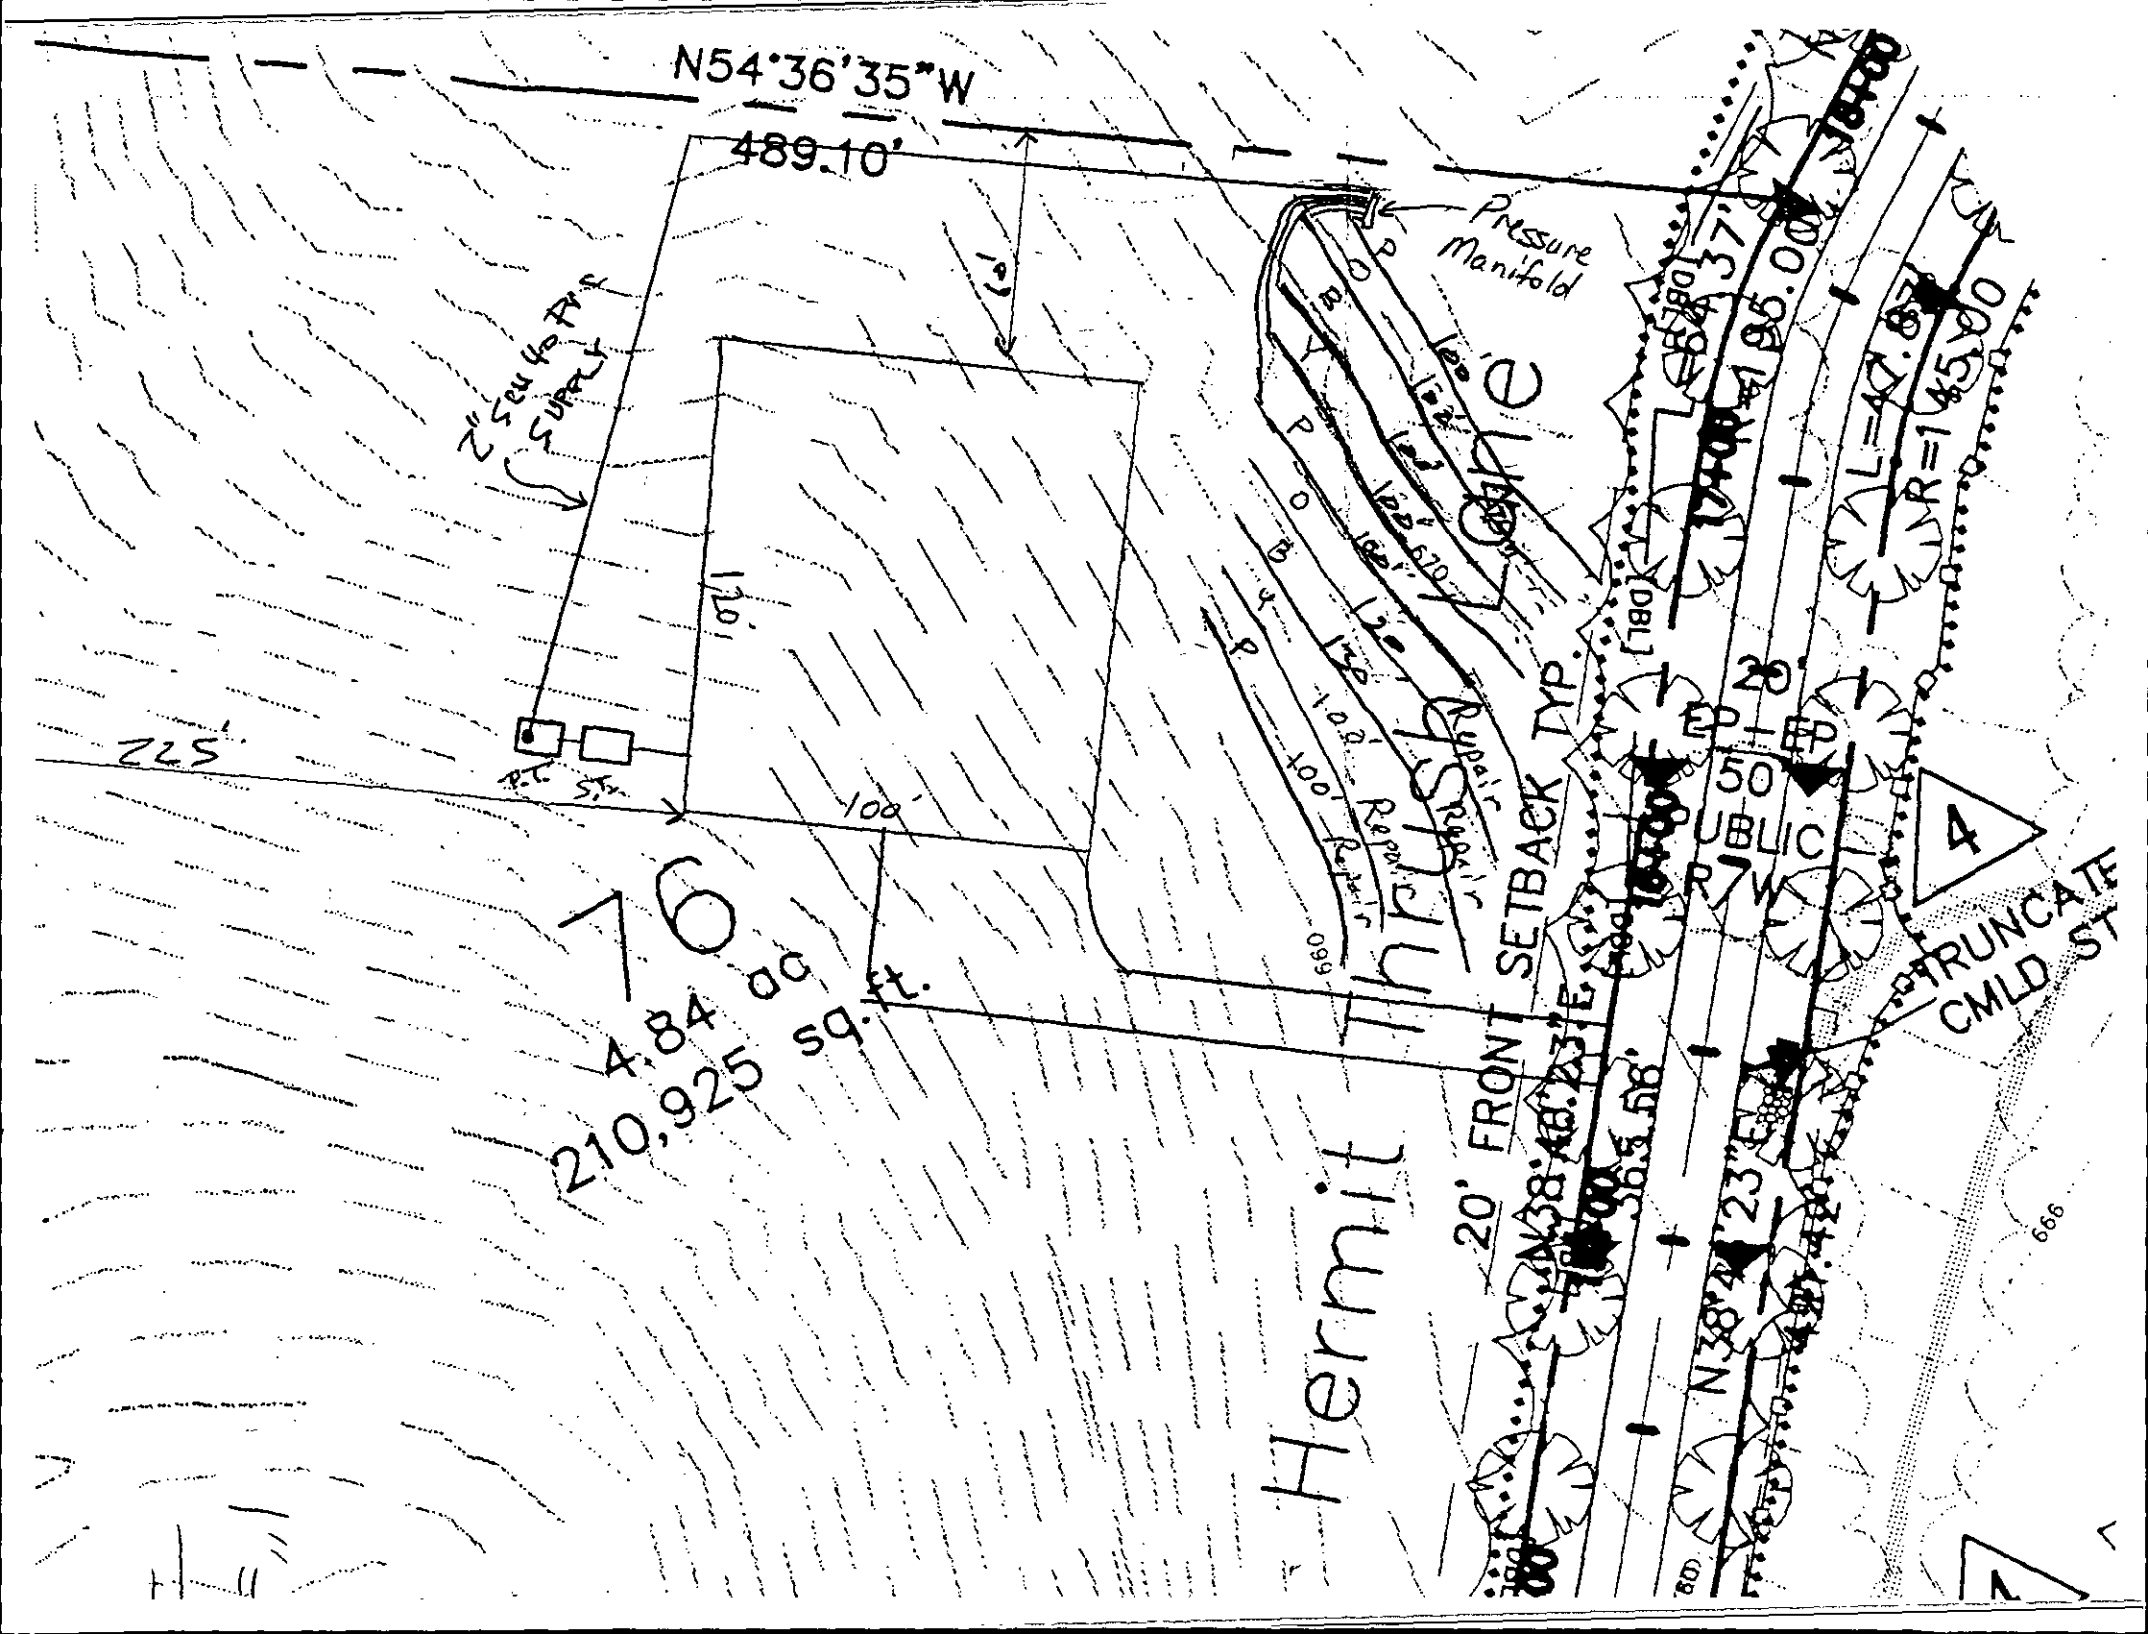
N54°36'35"W
489.10'
Pressure Manifold
2" Sch 40 PVC Supply
Blue Heron Hill
Repair
Repair
Repair
225'
100'
100'
P.V.C. Str.
10
4.84 ac
210,925 sq.ft.
20' FRONT SETBACK TYP.
PUBLIC R/W
TRUNCATE CMLD ST
N38°47'23"E
363.58'
N38°47'23"E
L=47.87'
R=145.00'
185.00'
666


N54°36'35"W
489.10'
Pressure Manifold
2" Sewage Force Main
Hermit
75
5.74 ac
303,379.23 sq.ft.
76
4.84 ac
210,925 sq.ft.
N34°39'08"E
484.40'
225'
100'
120'
N61°52'12"W
450.66'
20' FRONT SETBACK
N38°48'23"E
53.86'
N38°48'23"E
56.58'
L=47.87'
R=145.00'
20' PUBLIC R/W
TRUNCATED CMLD STT
SDE
TED CORRIDOR
1" = 50'

1" = 50'

LOT 76

210,925 SQ. FT.

LOT 76 - HERMIT THRUSH LANE - THE SANCTUARY
SITE PLAN WITH REVISED SEPTIC TANK LOCATION

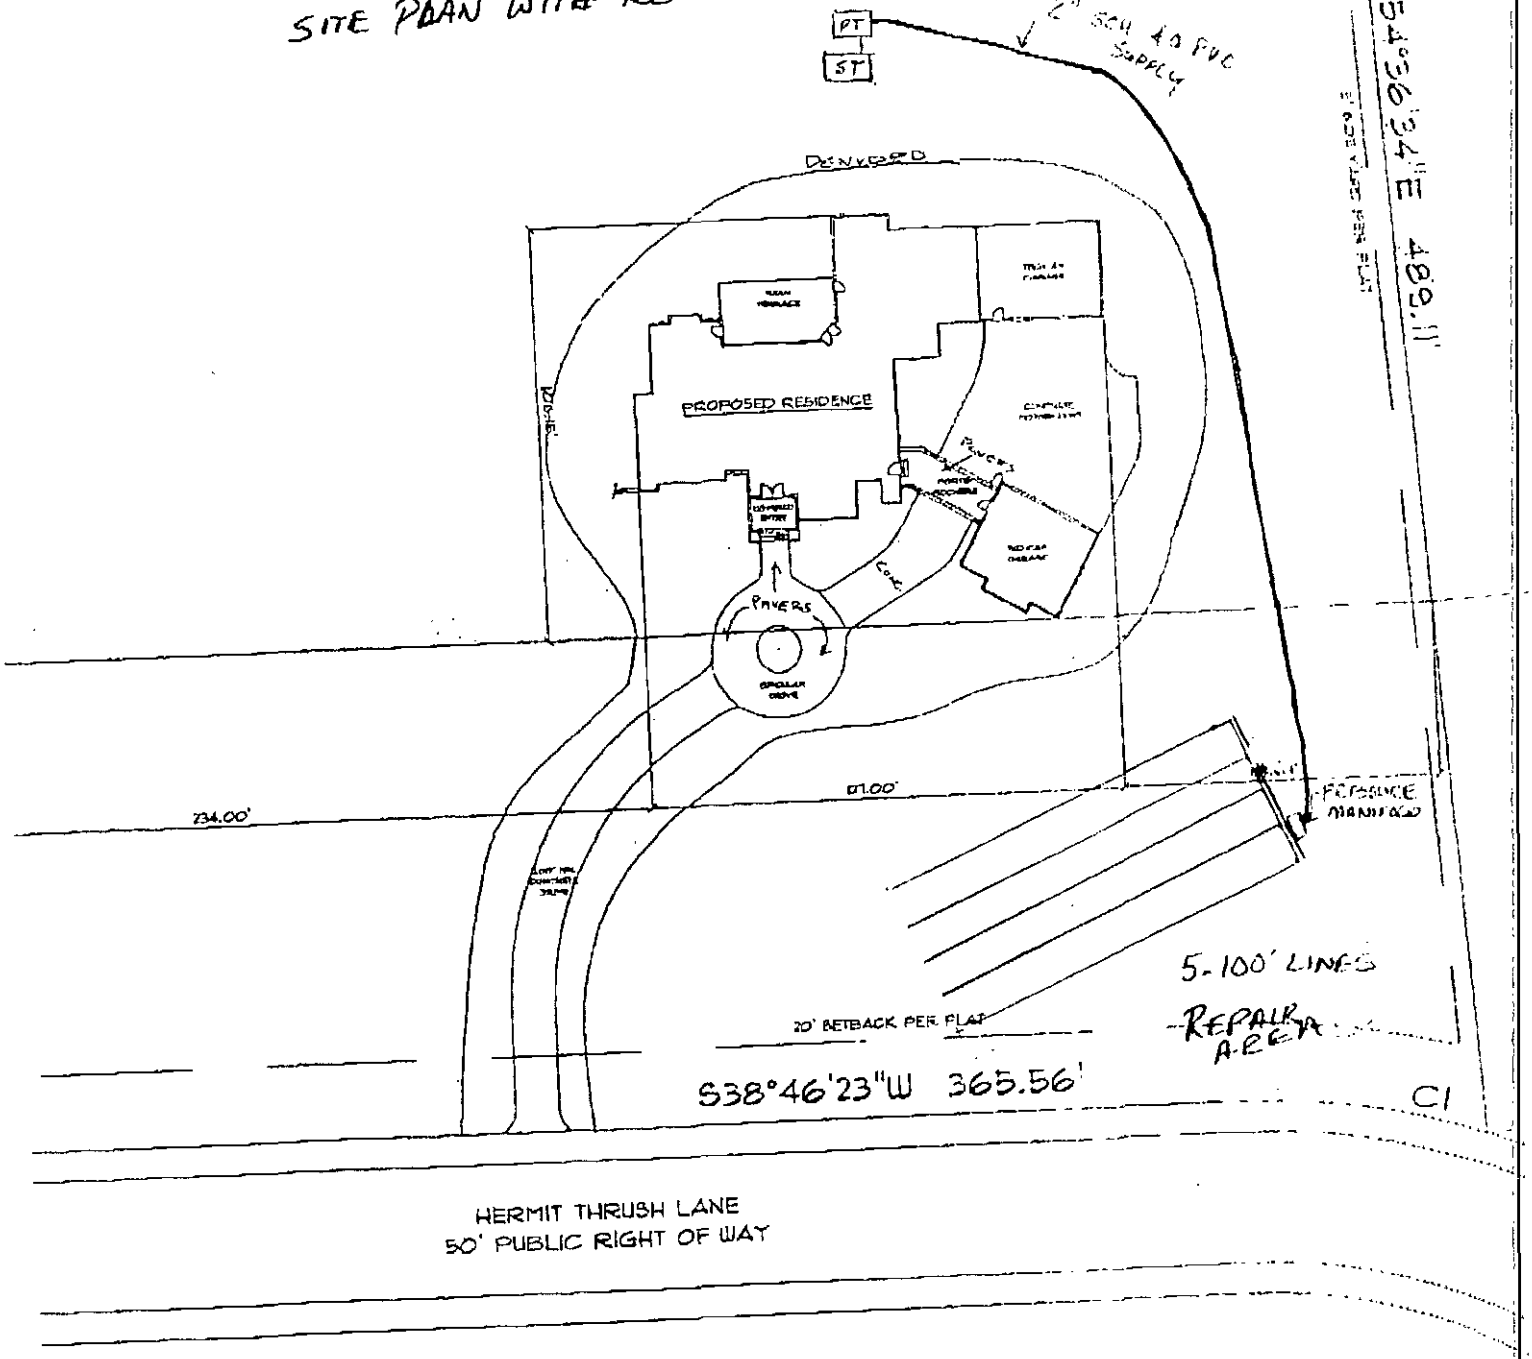

IMPERVIOUS AREA

PROPOSED RESIDENCE 6952 SQUARE FEET