

13012 WESTMORELAND FARM RD

00742302

12/31/2007

duponbj

Groundwater and Wastewater Services File Imaging Project
May 2007
Barcode Font = IDAutomationHC39M

DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet: _____

Property ID: 007-423-02

Lot #: 24

File #: 2792B

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: James M. Herring APPLICANT: _____

ADDRESS: 420 Carlisle Ave., Summerville, SC DATE EVALUATED: 12-18-00

PROPOSED FACILITY: residence PROPOSED DESIGN FLOW (.1949) 440 gpd PROPERTY SIZE: 1.71

LOCATION OF SITE: Westmoreland Farm Road PROPERTY RECORDED: _____

WATER SUPPLY: ☐Private ☐~~Public~~ ☐Well ☐Spring ☐Other _____

EVALUATION METHOD: ☐Augur Boring ☐~~Pit~~ ☐Cut

TYPE OF WASTEWATER: ☐~~Sewage~~ ☐Industrial Process ☐Mixed

PROFILE #	.1940 Landscape Position/ Slope %	Horizon Depth (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS &LTAR
1	LS Slopes 5-10%	0-4"	gr/scl	Fr/SEXP / 35/50	754" TO soil wetness	54"	N/A	None	US
		4-27"	SBKI scl	Fr/SEXPl 55/50					
		27-54"	ABKI sc	UF:/ Mixed/ US/US					
2	LS	0-11"	gr/sl	Fr/ SEXPlNS/NP	760" TO 60" soil wetness	60"	N/A	None	US
		11-22"	SBKI scl	Fr/SEXPl 35/50					
		22-60"	SBKI sc	UF:/~~SEX~~ MIXED/ US/US					
3	LS	0-4	gr/scl	Fr/SEXPl 35/50	758" TO soil wetness	59"	N/A	None	US
		4-20"	SBKIscl	Fr/SEXPl 35/50					
		20-58"	SBKIsc	UF:/Mixed/ US/US					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	MS	US
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____

SITE CLASSIFICATION (.1948): unsuitable

EVALUATED BY: Mr. A. Medlin LSS 12-18-00


OTHER(S) PRESENT: J. Herring, M. Christenberry

FILE # 27928

COMMENTS 1002 Repair

LANDSCAPE POSITION	GROUP	TEXTURE	.1955 LTAR	CONSISTENCE MOIST	CONSISTENCE WET
R-RIDGE	I	S-SAND	1.2-0.8		
S-SHOULDER SLOPE		LS-LOAMY SAND		VFR-VERY FRIABLE	NS-NON-STICKY
L-LINEAR SLOPE				FR-FRIABLE	SS-SLIGHTLYSTICKY
FS-FOOT SLOPE	II	SL-SANDY LOAM	0.8-0.6	FI-FIRM	S-STICKY
N-NOSE SLOPE		L-LOAM		VFI-VERY FIRM	VS-VERY STICKY
H-HEAD SLOPE				EFI-EXTREMELY FIRM	NP-NON-PLASTIC
CC-CONCLAVE SLOPE	III	SI-SILT	0.6-0.3		SP-SLIGHTLYSTICKY
CV-CONVEX SLOPE		SICL-SILTY CLAY LOAM			P-PLASTIC
T-TERRACE		CL-CLAY LOAM			VP-VERY PLASTIC
FP-FLOOD PLAIN		SCL-SANDY CLAY LOAM			
	IV	SC-SANDY CLAY	0.4-0.1		
		SIC-SILTY CLAY			
		O-ORGANIC			

STRUCTURE	MINERALOGY
SG-SINGLE GRAIN	SLIGHTLY EXPANSIVE
M-MASSIVE	
CR-CRUMB	EXPANSIVE
GR-GRANULAR	
SBK-SUBANGULAR BLOCKY	
ABK-ANGULAR BLOCKY	
PL-PLATY	
PR-PRISMATIC	

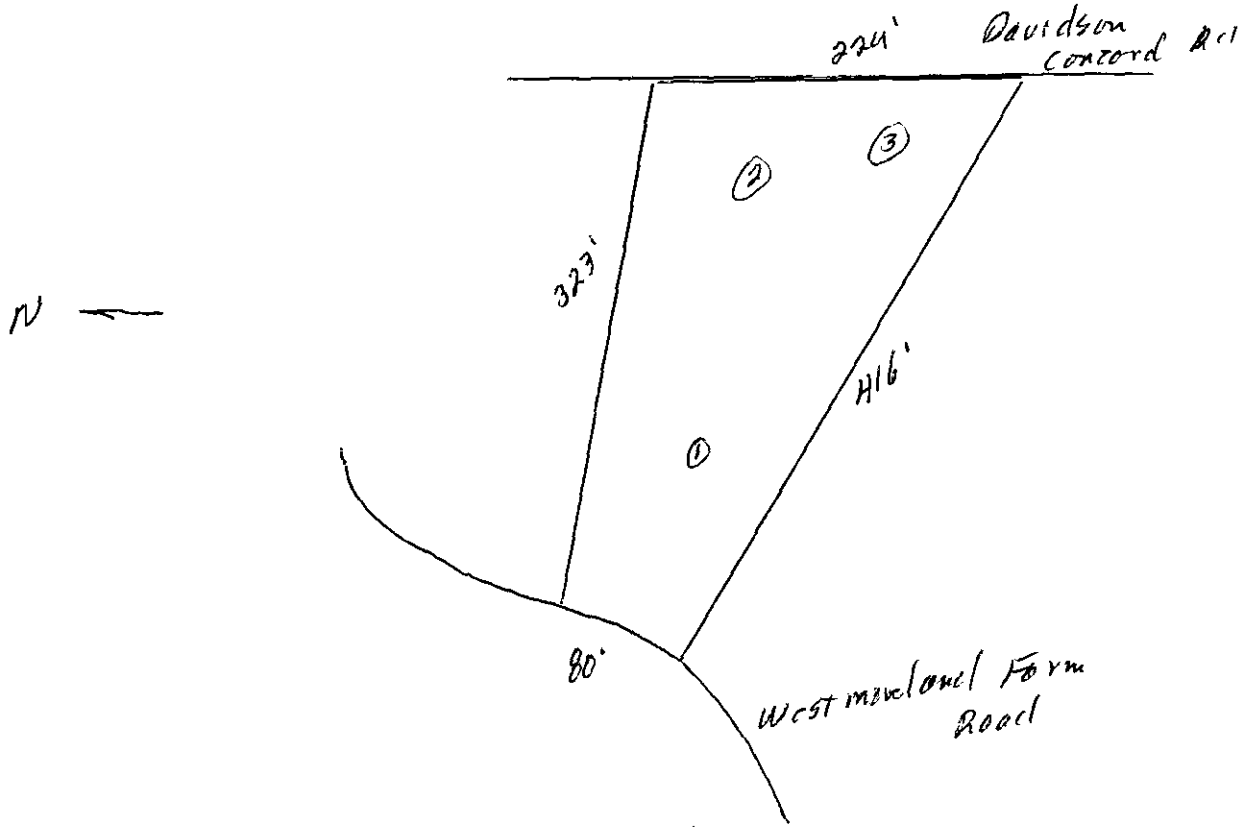

3rd

Mecklenburg County
Health Department

December 28, 2000

James W. Herring
605 Greene Street
Camden , S.C. 29020

Re: Application for improvement permit for Westmoreland Farm Road, Lot 24
Health Department file no. 2792B

Dear Property Owner or Owner's Agent:

The Mecklenburg County Health Department, Environmental Health Division on December 18, 2000 evaluated the above-referenced property at the site designated on the plat/site plan that accompanied your improvement permit application. According to your application the site is to serve a Four bedroom residence, with a design wastewater flow of ___480____gallons per day. The evaluation was done in accordance with the laws and rules governing wastewater systems in North Carolina General Statute 130A-333 and related statutes and Title 15A, Subchapter 18A, of the North Carolina Administrative Code, Rule .l900 and related rules.

Based on the criteria set out in Title 15A, Subchapter 18A, of the North Carolina Administrative Code, Rules .1940 through .1948, the evaluation indicated that the site is **UNSUITABLE for** a ground adsorption sewage system. Therefore, your request for an improvement permit is **DENIED.** A copy of the site evaluation is enclosed. The site is unsuitable based on the following:

_____Unsuitable soil topography and/or landscape position (Rule .1940)
____X____Unsuitable soil characteristics (structure or clay mineralogy) (Rule .1941)
_____ ____Unsuitable soil wetness condition (Rule .1942)
_____ ____Unsuitable soil depth (Rule .1943)
_____Presence of restrictive horizon (Rule .1944)
____X ____Insufficient space for septic system and repair area (Rule .1945)
_____Unsuitable for meeting required setbacks (Rule .1950)
_____Other (Rule .1946)

For the reasons set out above, the property is currently classified **UNSUITABLE,** and an improvement permit shall not be issued for this site in accordance with Rule .1948 (c).

However, the site classified as **UNSUITABLE** may be classified as **PROVISIONALLY SUITABLE** *if* written documentation is provided that meets the requirements of Rule .1948(d). A copy of this rule is enclosed. You may hire a consultant to assist you if you wish to try to develop a plan under which your site could be reclassified as **PROVISIONALLY SUITABLE.**

You have a right to an informal review of this decision. You may request an informal review by the soil scientist or environmental health supervisor at the local health department. You may also request an informal review by the N. C. Department of Environment and Natural Resources regional soil specialist. A request for informal review must be made in writing to the local health department.

You also have a right to a formal appeal of this decision. To pursue a formal appeal, you must file a petition for a contested case hearing with the Office of Administrative Hearings, 6714 Mail Center, Raleigh, NC 27699-6714. To get a copy of a petition form, you may write the Office of Administrative Hearings or call the office at (919) 733-0926. The petition for a contested case hearing must be filed in accordance with the provision of North Carolina General Statutes 130A-24 and 150B-23 and all other applicable provisions of Chapter 150B. N. C. General Statue 130A-335(g) provides that your hearing would be held in the county where your property is located.

Please note: If you wish to pursue a formal appeal, you must file the petition form with the Office of Administrative Hearings **WITHIN 30 DAYS OF THE DATE OF THIS LETTER.** The date of this letter is December 28, 2000. Meeting the 30-day deadline is critical to your right to a formal appeal. Beginning a formal appeal within 30 days will not interfere with any informal review that you might request. Do no wait for the outcome of any informal review if you wish to file a formal appeal.

If you file a petition for a contested case hearing with the Office of Administrative Hearings, you are required by law (N.C. General Statute 150B-23) to send a copy of your petition to the North Carolina Department of Environment and Natural Resources. Send the copy to: Office of General Counsel, N. C. Department of Environment and Natural Resources, 1601 Mail Service Center, Raleigh, NC. 27699-1601. Do **NOT** send the copy of the petition to your local health department. Sending a copy of your petition to the local health department will **NOT** satisfy the legal requirement in N.C. General Statute 150B-23 that you send a copy to the Office of General Counsel, NCDENR.

You may call or write the local health department if you need any additional information or assistance.

Sincerely,

Kelly Randall, R.S.
Authorized Agent - DENR

Encl: (2)

DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

AES
AMS

#3

Sheet: _____

Property ID: 007-423-02

Lot #: 24

File #: 2792B

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: James M. Herring APPLICANT: _____

ADDRESS: 420 Carolina Ave, Fayetteville, SC DATE EVALUATED: 12-18-00

PROPOSED FACILITY: residence PROPOSED DESIGN FLOW (.1949) 440 gpd PROPERTY SIZE: 1.21

LOCATION OF SITE: Westmoreland Farm Acres PROPERTY RECORDED: _____

WATER SUPPLY: ☐Private ☐Public ☐Well ☐Spring ☐Other _____

EVALUATION METHOD: ☐Augur Boring ☐Pit ☐Cut

TYPE OF WASTEWATER: ☐Sewage ☐Industrial Process ☐Mixed

PROFILE #	.1940 Landscape Position/ Slope %	Horizon Depth (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS &LTAR
1	LS	0-4"	gr/scl	Fr/SEXP / 33/SD	754" TO soil wetness	54"	N/A	None	US
		4-27"	SABKI scl	Fr/SEXP/ 33/SD					
		27-54"	ABKI sc	VF/ Mixed/ US/US					
2	LS	0-11"	gr/sl	Fr/ SEXP/NSNP	760" TO 60" wetness	60"	N/A	None	US
		11-22"	SAB MI scl	Fr/SEXP/ 33/SD					
		22-60"	SAMI sc	VF/ MIXED / US/US					
3	LS	0-4	gr/ scl	Fr/SEXP/ 33/SD	758" TO soil wetness	58"	N/A	None	US
		4-30"	SAMISCl	Fr/SEXP/ 33/SD					
		30-58"	SAMISC	VF/ Mixed/ US/US					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	NO	US
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____

SITE CLASSIFICATION (.1948): Unsuitable

EVALUATED BY: Mr. A. Mathis LSS 12-18-00

OTHER(S) PRESENT: J. Herring, M. Chesleborough

FILE # 27728

COMMENTS 1002 Repair

LANDSCAPE POSITION	GROUP	TEXTURE	.1955 LTAR
R-RIDGE	I	S-SAND	1.2-0.8
S-SHOULDER SLOPE		LS-LOAMY SAND	
L-LINEAR SLOPE			
FS-FOOT SLOPE	II	SL-SANDY LOAM	0.8-0.6
N-NOSE SLOPE		L-LOAM	
H-HEAD SLOPE			
CC-CONCLAVE SLOPE	III	SI-SILT	0.6-0.3
CV-CONVEX SLOPE		SICL-SILTY CLAY LOAM	
T-TERRACE		CL-CLAY LOAM	
FP-FLOOD PLAIN		SCL-SANDY CLAY LOAM	
	IV	SC-SANDY CLAY	0.4-0.1
		SIC-SILTY CLAY	
		O-ORGANIC	

CONSISTENCE MOIST	CONSISTENCE WET
VFR-VERY FRIABLE	NS-NON-STICKY
FR-FRIABLE	SS-SLIGHTLYSTICKY
FI-FIRM	S-STICKY
VFI-VERY FIRM	VS-VERY STICKY
EFI-EXTREMELY FIRM	NP-NON-PLASTIC
	SP-SLIGHTLYSTICKY
	P-PLASTIC
	VP-VERY PLASTIC


STRUCTURE

SG-SINGLE GRAIN
M-MASSIVE
CR-CRUMB
GR-GRANULAR
SBK-SUBANGULAR BLOCKY
ABK-ANGULAR BLOCKY
PL-PLATY
PR-PRISMATIC

MINERALOGY

SLIGHTLY EXPANSIVE

EXPANSIVE

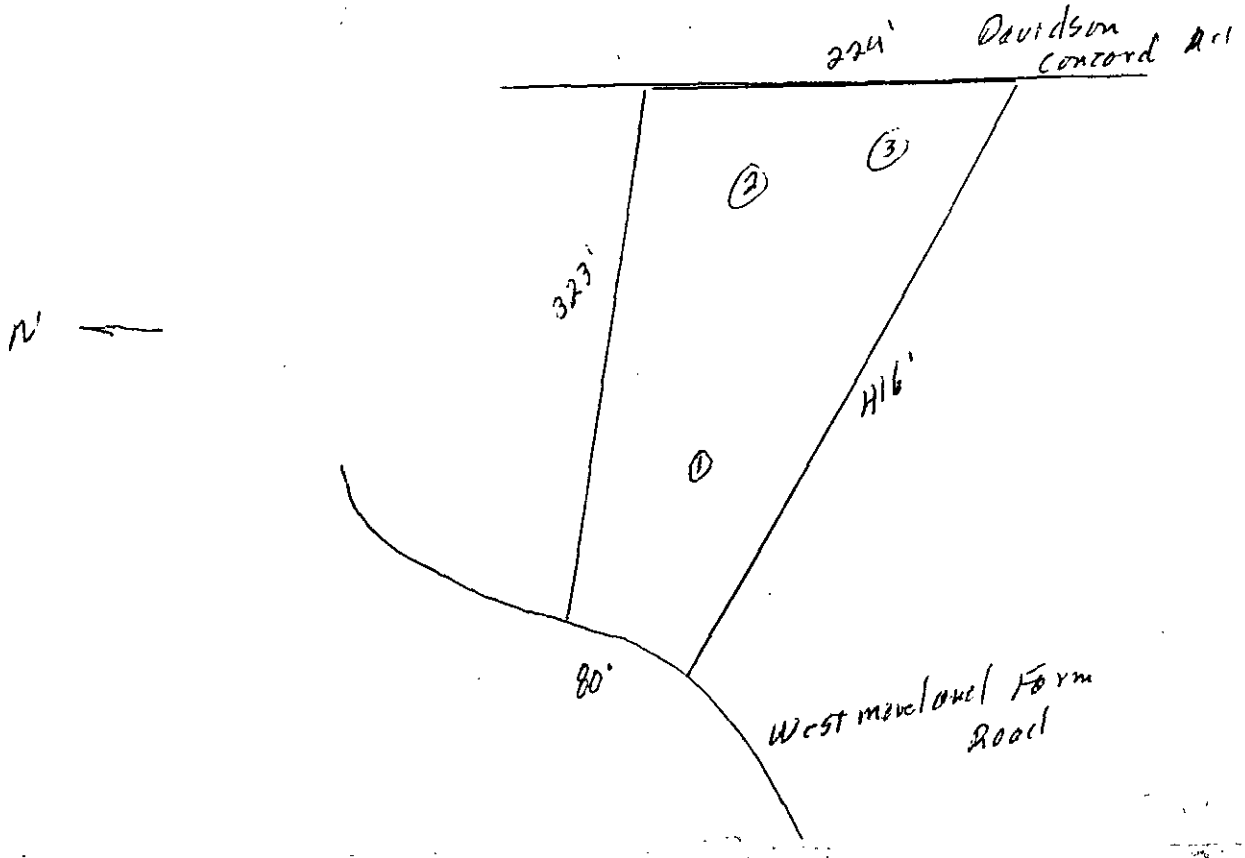

Mecklenburg County
Health Department

November 30, 1999

James Herring
605 Greene Street
Camden, SC 29020

Re: Westmoreland Farm Rd., lot 24
File: 2792B
Parcel: 007-423-02

Dear Property Owner:

Receipt of your Application for Improvement Permit for the above referenced property is acknowledged. A soil evaluation and a site visit have been conducted. The results of the evaluation indicated that the site is **UNSUITABLE** under Rules .1941 **SOIL CHARACTERISTICS (MORPHOLOGY)**, .1942 **SOIL WETNESS CONDITIONS**, and .1945 **AVAILABLE SPACE.** For these reasons your Application for Improvement Permit is denied. A possible way to develop the site exists under Rule .1948(d), which reads as follows:

> A site classified as **UNSUITABLE** may be used for a ground absorption sewage treatment and disposal system specifically identified in Rules .1955, .1956, or .1957 of this Section or a system approved under Rule .1969 if written documentation including engineering, hydrogeologic, geologic or soil studies, indicates to the local health department that the proposed system can be expected to function satisfactorily. Such sites shall be reclassified as **PROVISIONALLY SUITABLE** if the local health department determines that the substantiating data indicate that:
>
> (1) a ground absorption system can be installed so that the effluent will be non-pathogenic, non-infectious, non-toxic, and non-hazardous;
> (2) the effluent will not contaminate ground or surface water; and
> (3) the effluent will be exposed on the ground surface or be discharged to surface waters where it could come in contact with people, animals, or vectors.

The State shall review the substantiating date if requested by the local health department.

Please be advised that you have the right to an informal review by this department. You also have the right to appeal under G.S. 130A-24, and to have the appeal held in Mecklenburg County

If you have any questions regarding this matter, please call me at 336-5575.

Sincerely,

Kelly Randall, R.S.
Individual Water and Wastewater Systems

DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

#3 Jmd pit

Sheet: _____
Property ID: 001-423-02
Lot #: 24
File #: 2792 B

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: James W. Herring APPLICANT: _____
ADDRESS: 605 Greene St. Camden SC DATE EVALUATED: 11-16-99
PROPOSED FACILITY: residence PROPOSED DESIGN FLOW (.1949) 4gpd PROPERTY SIZE: 1.21
LOCATION OF SITE: Westmoreland Farm Road PROPERTY RECORDED: _____
WATER SUPPLY: ☐Private ☐~~Public~~ ☐Well ☐Spring ☐Other _____
EVALUATION METHOD: ☐Augur Boring ☑~~Pit~~ ☐Cut
TYPE OF WASTEWATER: ☑~~Sewage~~ ☐Industrial Process ☐Mixed

PROFILE #	Slopes 6-10% .1940 Landscape Position/ Slope %	Horizon Depth (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS &LTAR
1	LS	0-8"	gr/sl	Fr/SEXP/ss/sp	2.5Y 7/1 @ 22"	39"	US	None	US
		8-39"	ABK/ C	vFi/ Mixed/ US/ VP					
		39-49"	M/ sc	vFi/ Mixed/ US/ VP					
		49-60"	M/ scl	Fi/ SEXP/ SS/ SP					
2	LS	0-17"	gr/ scl	Fr/ SEXP/ ss/ sp	2.5Y 7/1 @ 16"	60"	US	None	US
		17-26"	SBK/ sc	vFi/ Mixed/ US/ VP					
		26-43"	ABK/ C	vFi/ Mixed/ US/ VP					
		43-60"	ABK-Pl/ C	vFi/ Mixed/ US/ VP					
3	LS	0-8"	gr/ scl	Fr/ SEXP/ ss/ sp	7.5Y TO 5Y 7/1 wetness	55"	US	None	US
		8-15"	SBK/ scl	Fr/ SEXP/ ss/ sp					
		15-51"	SBK/ C	vFi/ Mixed/ US/ VP					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	US	US
System Type(s)		
Site LTAR		


OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): Unsuitable
EVALUATED BY: W. R. Martin LSS 11-19-99
OTHER(S) PRESENT: _____

FILE # 27923

COMMENTS 1006 Repair

LANDSCAPE POSITION	GROUP	TEXTURE	.1955 LTAR	CONSISTENCE MOIST	CONSISTENCE WET
R-RIDGE	I	S-SAND	1.2-0.8		
S-SHOULDER SLOPE		LS-LOAMY SAND		VFR-VERY FRIABLE	NS-NON-STICKY
L-LINEAR SLOPE				FR-FRIABLE	SS-SLIGHTLYSTICKY
FS-FOOT SLOPE	II	SL-SANDY LOAM	0.8-0.6	FI-FIRM	S-STICKY
N-NOSE SLOPE		L-LOAM		VFI-VERY FIRM	VS-VERY STICKY
H-HEAD SLOPE				EFI-EXTREMELY FIRM	NP-NON-PLASTIC
CC-CONCLAVE SLOPE	III	SI-SILT	0.6-0.3		SP-SLIGHTLYSTICKY
CV-CONVEX SLOPE		SICL-SILTY CLAY LOAM			P-PLASTIC
T-TERRACE		CL-CLAY LOAM			VP-VERY PLASTIC
FP-FLOOD PLAIN		SCL-SANDY CLAY LOAM			
	IV	SC-SANDY CLAY	0.4-0.1		
		SIC-SILTY CLAY			
		O-ORGANIC			

STRUCTURE	MINERALOGY
SG-SINGLE GRAIN	SLIGHTLY EXPANSIVE
M-MASSIVE	
CR-CRUMB	EXPANSIVE
GR-GRANULAR	
SBK-SUBANGULAR BLOCKY	
ABK-ANGULAR BLOCKY	
PL-PLATY	
PR-PRISMATIC	

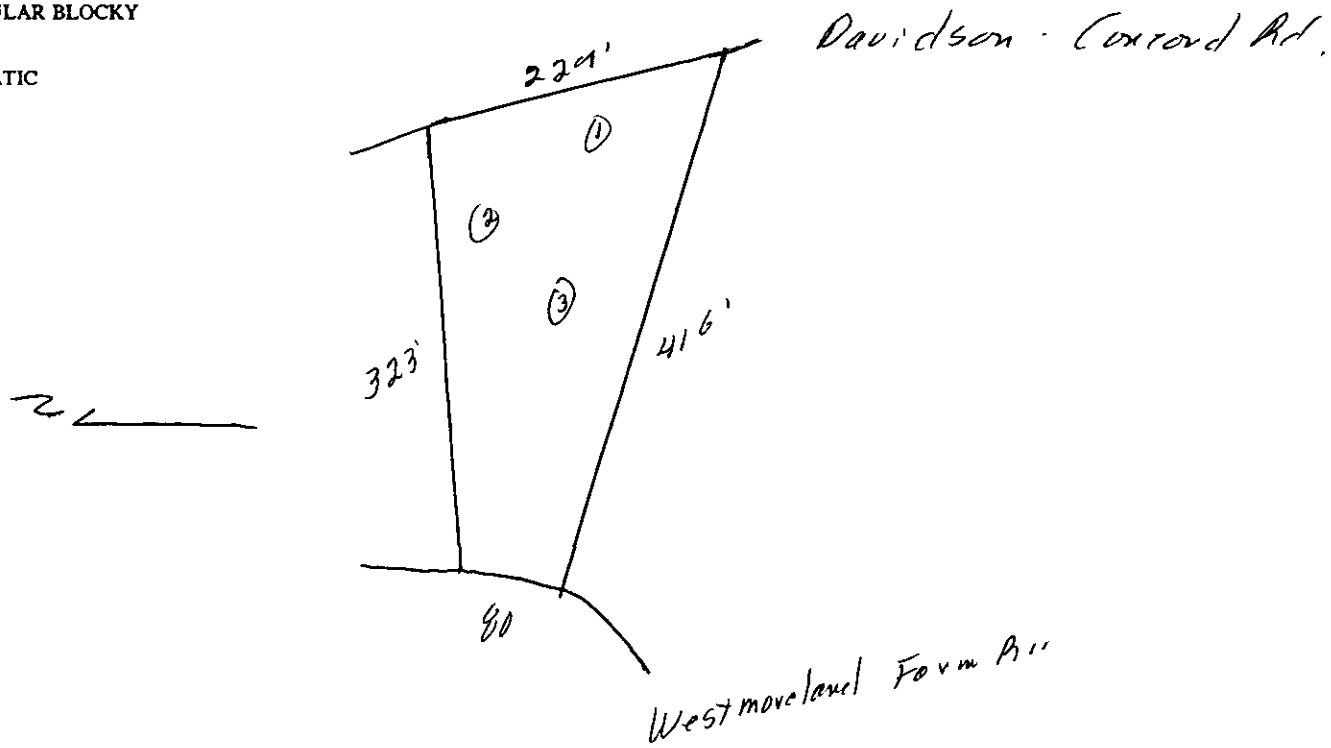

DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet: _____
Property ID: 007-423-02
Lot #: # 24
File #: 2792 B

#3 (4R)

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: James W. Herring APPLICANT: _____
ADDRESS: 605 Greene St, Greensboro, NC DATE EVALUATED: 5-11-99
PROPOSED FACILITY: residence PROPOSED DESIGN FLOW (.1949) _____ PROPERTY SIZE: 1.21
LOCATION OF SITE: Westmoreland Farm Acres PROPERTY RECORDED: _____
WATER SUPPLY: ☐Private ☑Public ☐Well ☐Spring ☐Other _____
EVALUATION METHOD: ☑Augur Boring ☐Pit ☐Cut
TYPE OF WASTEWATER: ☑Sewage ☐Industrial Process ☐Mixed

PROFILE #	.1940 Landscape Position/ Slope % (Slopes 2-6%)	Horizon Depth (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS &LTAR
1	LS	0-10"	M Mixed	F.I	732" TO soil wetness	32"	N/A	None	US
		10-32"	SBM/C	VF.I Mixed					
2	LS	0-13"	gr/sl	Fr/SE xP/ss/sp	736" TO soil wetness	36"	N/A	None	US
		13-36"	SBM/sc	VF.I Mixed					
			possible plow structure 33-34"						
3	LS	0-8"	gr/sl	Fr/SE xP/ss/sp	2.5Y 5/2 @ 20"	24"	N/A	None	US
		8-24"	SBM/sc	VF.I Mixed					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	US	US
System Type(s)		
Site LTAR		


OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): Unsuitable
EVALUATED BY: W.R. Marlin 5-17-99
OTHER(S) PRESENT: LSS

FILE #

COMMENTS 100b Repair

LANDSCAPE POSITION	GROUP	TEXTURE	.1955 LTAR	CONSISTENCE MOIST	CONSISTENCE WET
R-RIDGE	I	S-SAND	1.2-0.8		
S-SHOULDER SLOPE		LS-LOAMY SAND		VFR-VERY FRIABLE	NS-NON-STICKY
L-LINEAR SLOPE				FR-FRIABLE	SS-SLIGHTLYSTICKY
FS-FOOT SLOPE	II	SL-SANDY LOAM	0.8-0.6	FI-FIRM	S-STICKY
N-NOSE SLOPE		L-LOAM		VFI-VERY FIRM	VS-VERY STICKY
H-HEAD SLOPE				EFI-EXTREMELY FIRM	NP-NON-PLASTIC
CC-CONCLAVE SLOPE	III	SI-SILT	0.6-0.3		SP-SLIGHTLYSTICKY
CV-CONVEX SLOPE		SICL-SILTY CLAY LOAM			P-PLASTIC
T-TERRACE		CL-CLAY LOAM			VP-VERY PLASTIC
FP-FLOOD PLAIN		SCL-SANDY CLAY LOAM			
	IV	SC-SANDY CLAY	0.4-0.1		
		SIC-SILTY CLAY			
		O-ORGANIC			

STRUCTURE	MINERALOGY
SG-SINGLE GRAIN	SLIGHTLY EXPANSIVE
M-MASSIVE	
CR-CRUMB	EXPANSIVE
GR-GRANULAR	
SBK-SUBANGULAR BLOCKY	
ABK-ANGULAR BLOCKY	
PL-PLATY	
PR-PRISMATIC	

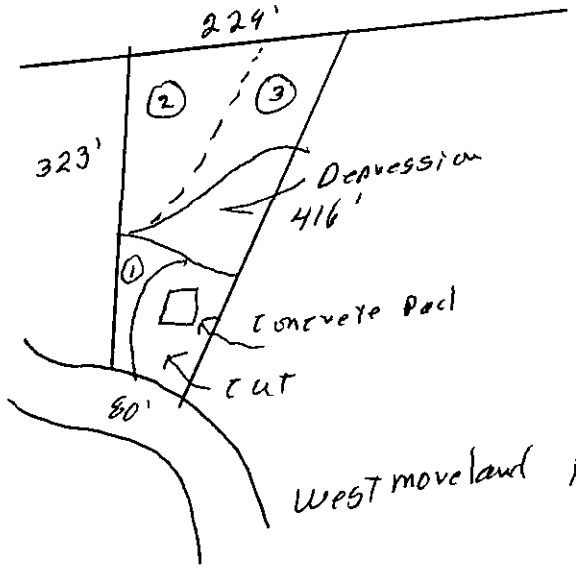

Mecklenburg County
Health Department

May 19, 1999

James Herring
605 Greene Street
Camden, SC 29020

Re: Westmoreland Farm Road
File: 2792B
Parcel: 007-423-02

Dear Property Owners:

Receipt of your Application for Improvement Permit for the above referenced property is acknowledged. A soil evaluation and a site visit have been conducted. The results of the evaluation indicated that the site is **UNSUITABLE** under Rules .1941 **SOIL CHARACTERISTICS (MORPHOLOGY)**, .1942 **SOIL WETNESS CONDITIONS**, .1943 **SOIL DEPTH**, and .1945 **AVAILABLE SPACE.** For these reasons your Application for Improvement Permit is denied. A possible way to develop the site exists under Rule .1948(d), which reads as follows:

> A site classified as **UNSUITABLE** may be used for a ground absorption sewage treatment and disposal system specifically identified in Rules .1955, .1956, or .1957 of this Section or a system approved under Rule .1969 if written documentation including engineering, hydrogeologic, geologic or soil studies, indicates to the local health department that the proposed system can be expected to function satisfactorily. Such sites shall be reclassified as **PROVISIONALLY SUITABLE** if the local health department determines that the substantiating data indicate that:
>
> (1) a ground absorption system can be installed so that the effluent will be non-pathogenic, non-infectious, non-toxic, and non-hazardous;
> (2) the effluent will not contaminate ground or surface water; and
> (3) the effluent will be exposed on the ground surface or be discharged to surface waters where it could come in contact with people, animals, or vectors.

The State shall review the substantiating date if requested by the local health department.

Please be advised that you have the right to an informal review by this department. You also have the right to appeal under G.S. 130A-24, and to have the appeal held in Mecklenburg County

If you have any questions regarding this matter, please call me at 336-5575.

Sincerely,

Kelly Randall, R.S.
Individual Water and Wastewater Systems

FEE: 110 CK# 1493

DATE: 12/10/98

APPLICATION FOR IMPROVEMENT PERMIT FOR RESIDENTIAL SITE INDIVIDUAL WATER AND WASTEWATER SYSTEMS PROGRAM

1 1/2 CRT

TYPE APPLICATION: __ NEW SYSTEM __ EXPANSION/ALTERATION OF EXISTING SYSTEM __ REPAIR OF EXISTING SYSTEM

NORTH CAROLINA
DEPARTMENT OF ENVIRONMENT,
HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

FILE #: 2728

PROPERTY INFORMATION (FROM ENGINEERING FORM) FOR JOB LOCATION:

TAX/PARCEL NUMBER: 007-423-02

STREET ADDRESS: Westmoreland Farm Rd

SUBDIVISION OR MOBILE HOME PARK NAME: WESTMORELAND FARM

LOT NUMBER: #24

TYPE OF BUILDING (CHECK ONE):

__ SINGLE MOBILE HOME(S)
__ DOUBLE WIDE (D)
✓ HOUSE (H)
__ MODULAR HOME (M)
__ MULTIPLE FAMILY (U)
__ OTHER (O)

TOWNSHIP (CHECK ONE):

__ 0 MECKLENBURG
__ 1 CHARLOTTE
✓ 2 DAVIDSON
__ 3 CORNELIUS
__ 4 PINEVILLE
__ 5 MATTHEWS
__ 6 HUNTERSVILLE
__ 7 MINT HILL

HEATED SQUARE FOOTAGE:

NUMBER OF BEDROOMS: 4 NUMBER OF OCCUPANTS: 4

CLOSING DATE _____

FOUNDATION FOR RESIDENCE:

__ WITHOUT BASEMENT
__ ON SLAB
✓ CRAWL SPACE
__ WITH BASEMENT /PLUMBING
__ WITH BASEMENT /NO PLUMBING

IF EXPANSION/ALTERATION OF EXISTING SYSTEM, DESCRIBE THE PROPOSED BUILDING ADDITION:

WILL THERE BE A HOME BUSINESS IN THE RESIDENCE: __ YES ✓ NO TYPE: _____

WATER SUPPLY (CHECK ONE):

__ COMMUNITY (C)
✓ MUNICIPAL (M)
__ PRIVATE WELL (P)
__ SHARED WELL (S)
__ OTHER 'SPRINGS' (O)

IF ANY OF THE FOLLOWING ARE LOCATED ON THE PROPERTY, PLEASE SHOW LOCATION ON PLAT:

BURIED CABLES, LANDFILLS, STUMPHOLES	__ YES ✓ NO	WELL, SPRINGS OR WATERLINES	__ YES ✓ NO
EXISTING WASTEWATER SYSTEMS	__ YES ✓ NO	DESIGNATED WETLANDS	__ YES ✓ NO
EASTMENTS OR RIGHT-OF-WAYS	__ YES ✓ NO		

PROPERTY OWNER:

NAME: HERRING JAMES W
(LAST) (FIRST) (MI)

ADDRESS: 605 GREENE ST 29020

CITY CAMDEN STATE: SC ZIP:

DAYTIME PHONE: (803-432-0239

LEGAL AGENT FOR PROPERTY OWNER, IF APPLICABLE:

NAME:
(LAST) (FIRST) (MI)

DAYTIME PHONE: ( ) —

WHAT DATE WAS THE PROPERTY ORIGINALLY DEEDED AND RECORDED? _____

An Improvement Permit is subject to suspension or revocation if site plans or the intended use change or if information submitted in this application is falsified or changed. The undersigned, owner, or legal agent for the owner, of the property described above as the "Job Location" has read the foregoing application, acknowledges that the contents of same are true, and authorizes agents of the Mecklenburg County Health Department to enter onto the property for the purpose of processing this request.

SIGNED: James Herring DATE: Dec 10 1998

MECKLENBURG COUNTY HEALTH DEPARTMENT
ENVIRONMENTAL HEALTH DIVISION
c/o HAL MARSHALL CTR., SUITE 211, 700 N. TRYON ST., CHARLOTTE, N.C. 28202., (704) 336-5102

PROPOSED PLOT PLAN


#24

HEALTH DEPARTMENT
ENVIRONMENTAL HEALTH DIVISION
700 NORTH TRYON STREET
CHARLOTTE, NC 28202
PHONE (704) 336-5102

FILE: 2792B

TC: 007-423-02

Draw in and name all roads adjoining the property. Draw in and accurately dimension the lot concerned. Accurately indicate property boundaries proposed and/or existing structures and driveways, underground utilities, and wells and springs within 100 feet of the proposed building or drainfield.

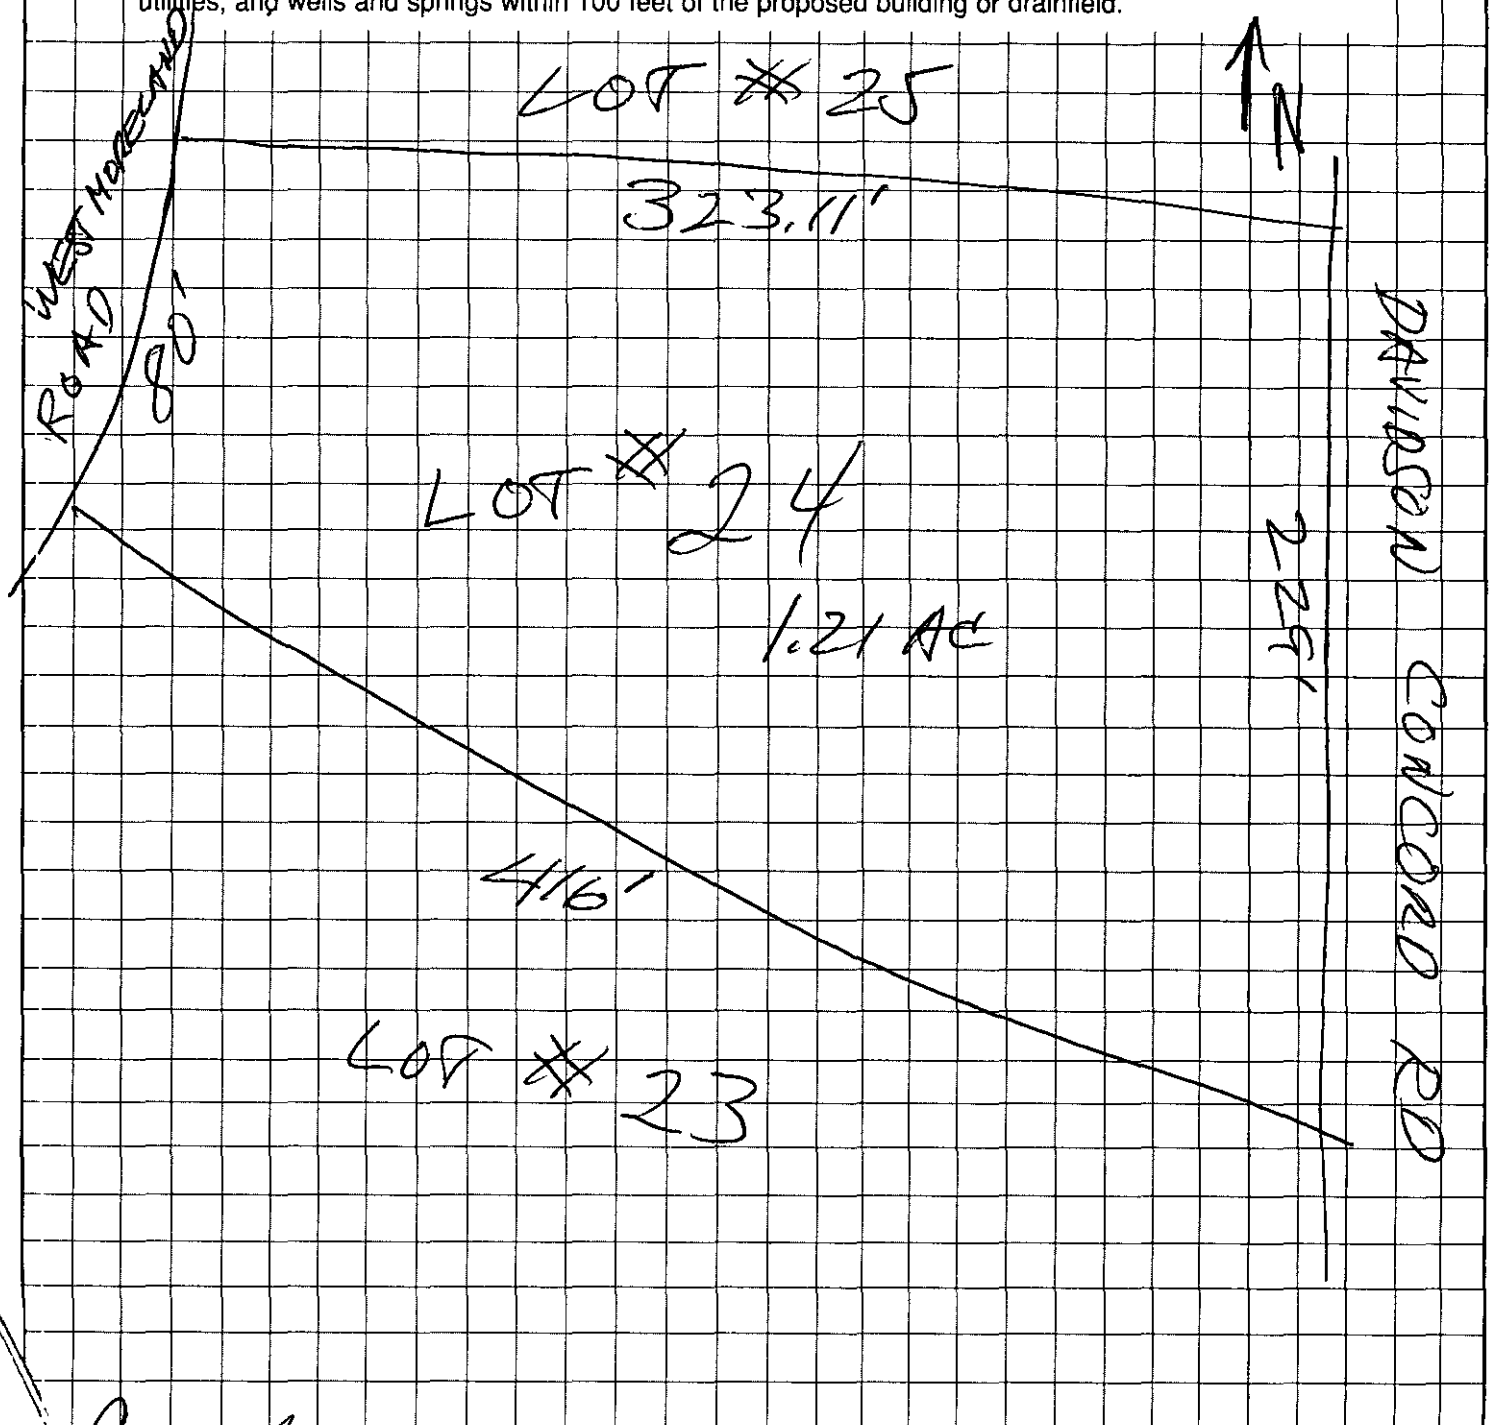


APPLICANT/AGENT SIGNATURE

Dec 10 1998

APPROVAL DATE

Health Department's Copy Canary - E.H.S. Copy Pink - Owner's Copy

HAGAR THE HORRIBLE

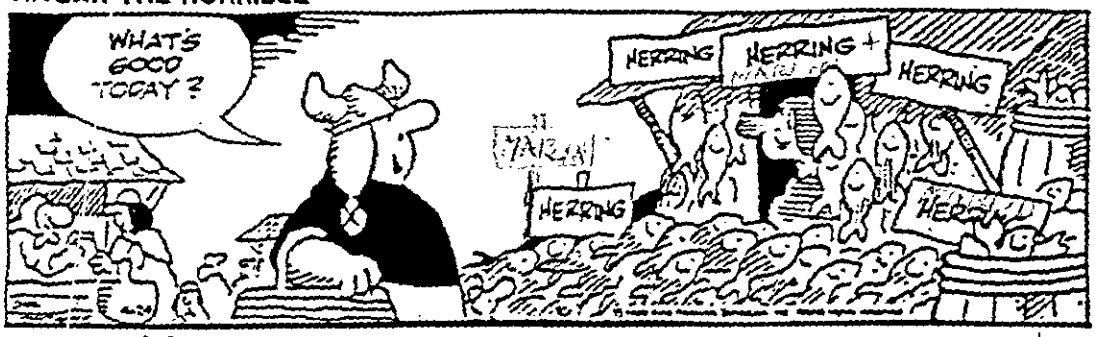

NOV 5 '99

Dear [illegible] &

There's my check for $200 for Test A Kept.

Please work with Tim Whittaker in corp

#23 #24 Westmoreland.

Thanks for your help.

Judy Henry

RECEIVED
NOV 08 '99
CLE #2148
11/9/99
JC

ENVIRONMENTAL HEALTH
700 N IRVON ST #211
CHARLOTTE, NC 28203

BATCH: 106
S-A-L-E-S O-R-A-F-I
73822355
086500158410

REF: 0001
CD TYPE: MASTERCARD
TR TYPE: MAIL/PHONE
INV: 0502
DATE: DEC 14, 00 09:55:53

AUS: EXACT MATCH
TOTAL $200.00*

ACCT: 5228541000276763 EXP: 01/06
AP: 014713

CARDMEMBER ACKNOWLEDGES RECEIPT OF GOODS AND/OR SERVICES IN THE AMOUNT OF THE TOTAL SHOWN HEREON AND AGREES TO PERFORM THE OBLIGATIONS SET FORTH BY THE CARDMEMBER'S AGREEMENT WITH THE ISSUER

007-423-02 L24 2792P

007-423-03 L23 2791P