

13305 CLAYSPARROW RD

19935306

1/8/2008

duponbj

Groundwater and Wastewater Services File Imaging Project
May 2007
Barcode Font = IDAutomationHC39M

Groundwater & Wastewater Services
Septic Project File & Data Review Worksheet

GWS File #: 54918 WASPS App #: 2561

Primary ES assigned to project: David Cornelius

Secondary ES assigned to project: Chris Stowell

Project Type: New System ☒ Alteration ☐ Repair ☐ Modified Plot Plan ☐

I. File Review:

Rule or Law	Permit Application			
.1937(d)	Is the Application complete	Yes ☑	No ☐	N/A ☐
.1937(d)	Is there a Site plan/Plat with application	Yes ☑	No ☐	N/A ☐
.1937(d)	Is the Facility shown?	Yes ☑	No ☐	N/A ☐
.1937(d)	Are appurtenances shown	Yes ☑	No ☐	N/A ☐
	Site Evaluation Information			
.1939 (a)(1)	Topography and Landscape Position Recorded?	Yes ☑	No ☐	N/A ☐
.1940 (a-g)	Slope % Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Texture Class Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Structure type Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Consistence Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(2)	Mineralogy Recorded?	Yes ☑	No ☐	N/A ☐
.1939 (a)(3)	Soil Wetness Condition Recorded?	Yes ☑	No ☐	N/A ☑
.1939 (a)(4)	Soil Depth to Rock or Parent Material Recorded When Encountered	Yes ☑	No ☐	N/A ☑
.1939 (a)(5)	Depth to Restrictive Horizons Recorded When Encountered?	Yes ☑	No ☐	N/A ☑
.1939 (a)(6)	Sufficient Available Space Recorded?	Yes ☑	No ☐	N/A ☐
.1937(m)	Are the Profile Locations Shown?			
.1939(a)	Are the S/PS Profiles in system & in repair area?	Yes ☑	No ☐	N/A ☐
& .1945(b)	Number of auger borings made: 4 Were sufficient auger borings made?	Yes ☑	No ☐	N/A ☐
.1939(d), .1955, .1956, .1957	LTAR 3	Yes ☑	No ☐	N/A ☐
	Improvement Permit/Construction Authorization			
.1937(g) 130A-336(a)	Proposed System Type stated-Initial	Yes ☑	No ☐	N/A ☐
.1945(b)	Proposed System Type stated-Repair	Yes ☑	No ☐	N/A ☐
130A-336 (a)(3)	System location identifiable by setbacks - Initial	Yes ☑	No ☐	N/A ☐
.1937(g) .1945(b)	System components shown – Initial	Yes ☑	No ☐	N/A ☐
.1945(b)	Repair area shown	Yes ☑	No ☐	N/A ☐
.1937 (f)(g)	Does System design match facility, flow & WWcharacteristics?	Yes ☑	No ☐	N/A ☐
.1937 (f)(g)	Is System design consistent with soil/site conditions?	Yes ☑	No ☐	N/A ☐
.1937 (f)(g)	Is the System located in the approved area?	Yes ☑	No ☐	N/A ☐
130A-336(a)	Is the Design flow (gpd) indicated?	Yes ☑	No ☐	N/A ☐

130A-336(a)	Number of Bedrooms, employees, seats, etc. indicated?	Yes ☑	No ☐	N/A ☐
.1937(g)	Trench depth indicated?	Yes ☑	No ☐	N/A ☐
.1937(g)	Trench width indicated?	Yes ☑	No ☐	N/A ☐
.1937(g)	Trench length indicated?	Yes ☑	No ☐	N/A ☐
130A-336(a)(1)	Proposed/existing well shown?	Yes ☐	No ☐	N/A ☑
130A-336(a)(1)	Property line lengths shown?	Yes ☑	No ☐	N/A ☐
130A-336(a)	Facility/appurtenance setbacks shown from fixed points?	Yes ☑	No ☐	N/A ☐
	Operation Permit			
.1937(i)	System type as described in table V(a) of rule .1961	Yes ☑	No ☐	N/A ☐
.1937(i)	Conditions for system performance, operation, maintenance, monitoring and reporting.	Yes ☑	No ☐	N/A ☐

II. WASPS Review:

Construction authorization issued	Yes ☐	No ☐	N/A ☐
Installation approval issued	Yes ☐	No ☐	N/A ☐
Operation permit issued	Yes ☐	No ☐	N/A ☐
Other related documentation	Yes ☐	No ☐	N/A ☐

Items requiring correction/modification: _____

Comments:

_____

_____

_____

_____

_____

IA issued date: 7-19-07

OP issued date: 8.8.07

Review performed by: IR Date performed: 9/5/07

MECKLENBURG COUNTY
LAND USE AND ENVIRONMENTAL SERVICES
Payment Receipt

Receipt Information

Date:	10/17/07	**Amount:**	150.00
Receipt #:	53217	**Tendered:**	0.00
Check / Auth #:	CHARGE	**Returned:**	0.00
Received By:	CRAIGGY		

Account Information

Account #: B84050
Contractor: ARCADIA HOMES INC
Attn:
Address: PO BOX 471941
Address:
City/State/Zip: CHARLOTTE, NC 28247-1941

Item	Description	Permit#	Quantity	Unit Price	Total Price
0734	Auth for Waste Wtr Sys Constr 13305 CLAYSPARROW RD/FILE 5491B		1	150.00	150.00

Outstanding Balances

Month-To-Date	Prior Month	30 Days	60 Days	90 Days	Balance
4,764.24					

MECKLENBURG COUNTY
LAND USE AND ENVIRONMENTAL SERVICES
Payment Receipt

Receipt Information

Date:	10/17/07	**Amount:**	150.00
Receipt #:	53218	**Tendered:**	0.00
Check / Auth #:	CHARGE	**Returned:**	0.00
Received By:	CRAIGGY		

Account Information

Account #: B84050
Contractor: ARCADIA HOMES INC
Attn:
Address: PO BOX 471941
Address:
City/State/Zip: CHARLOTTE, NC 28247-1941

Item	Description	Permit#	Quantity	Unit Price	Total Price
0703	Installation/Final Approval 13305 CLAYSPARROW RD/FILE 5491B		1	150.00	150.00

----------Outstanding Balances----------

Month-To-Date	Prior Month	30 Days	60 Days	90 Days	Balance
4,914.24					

Mecklenburg County Groundwater & Wastewater Services
700 N. Tryon St., Suite 211 Charlotte, NC 28202
Phone: (704) 336-5103 Fax: (704) 336-6894

NC DENR
Division of Environmental Health
On-Site Wastewater Section

OPERATION PERMIT for an ON-SITE WASTEWATER TREATMENT & DISPOSAL SYSTEM

File #: 5491B Permit #: _____ Tax Parcel #: 199-353-~~05~~ 05

Property Owner: ~~ARCADIA HOMES~~ THE SANCTUARY @ LAKE WYLIE

Job Location Address: ~~13325~~ CLAYSPARROW RD. (LOT #82)

City: CHARLOTTE 28105 State: NC Zip Code: 28278

Operation Permit Issuance Date: 8/8/07 Contractor Name: WT NORWOOD

Permitted Design Flow: 600 GPD

Liquid Capacity of Septic Tank: 1500 gallons

Liquid Capacity of Dosing Tank: 1500 gallons

Effluent Pump Model: WE 0712 HU

Drainfield Installation ☐ N/A

Trench Depth: ~~36~~ 24 inches

Trench Width: 3 feet

Line Spacing: 9 feet (O.C.)

Total line length: 500 feet

# of Lines: 5 @ 100 feet

Depth of Media: 12 inches (Type) INNOVATIVE

Depth of Cover: 12 inches

Distribution Device: PRESSURE MANIFOLD

Inspection Dates

Tank(s) Inspected: 8/8/07

Excavation Inspected: 8/8/07

Pump & Controls Inspected: 8/8/07

Bed Installation *(For Repair Installations ONLY.)* ☑ N/A

Bed Depth: _____ inches

Bed Width: _____ feet

Total line length: _____ feet

# of Lines: _____ @ _____ feet

Depth of Media: _____ inches (Type) _____

Depth of Cover: _____ inches

Distribution Device: _____

Water Supply Source

☑ Municipal ☐ Private Well ☐ Community Well

☐ Other _____


System Installation Setbacks

Distance from Building Foundation: 5 feet

Distance from Property Line: 10 feet

Distance from Water Supply Source: 10 feet

SKETCH OF SYSTEM INSTALLATION
(As-Built Drawing)

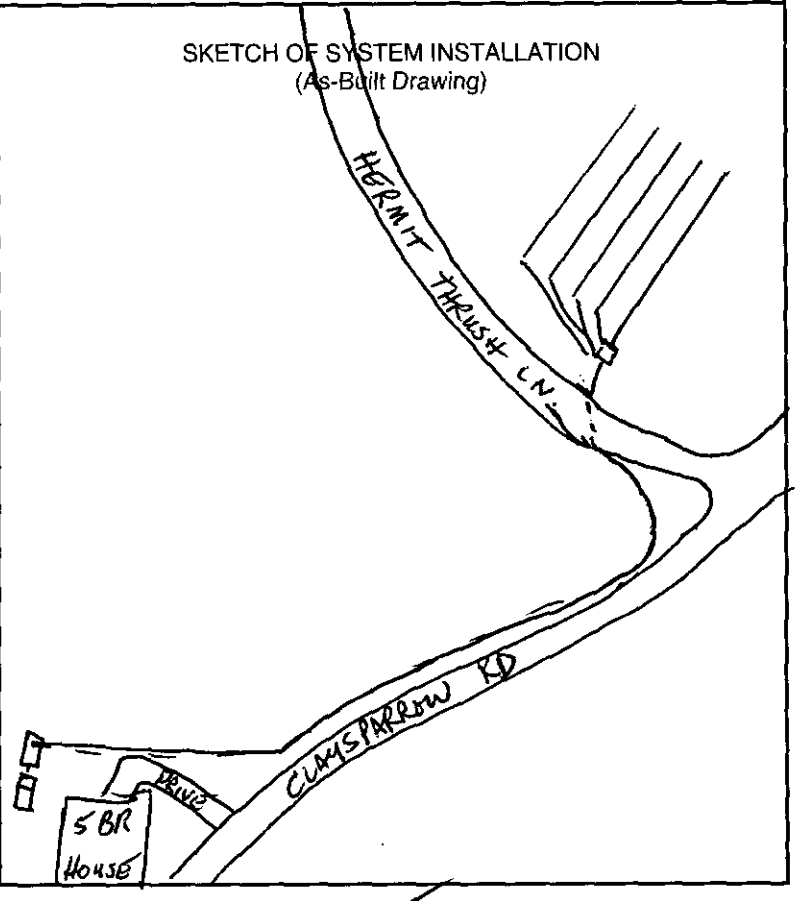

The undersigned has inspected the Septic Tank System described above, and certifies it has been ☑ installed ☐ altered ☐ repaired ☐ as detailed in the plot above ☑ in accordance with the permit issued and meets the provisions of 15A NCAC 18A. 1900, "Laws and Rules for Sewage Treatment and Disposal Systems" in effect on the date of issuance of the permit. The issuance of this Operation Permit does not in any way guarantee that the system will operate properly or relieve any person now or hereafter owning, controlling, or using such system from any liability resulting from the failure of the system to operate properly. This document is issued subject to those restrictions and conditions shown on the permit(s) and the provisions of 15A NCAC 18A. 1900 in addition to those listed below under "Comments." This document shall be null and void if any information contained in the application is untrue or if any additions are made to the property which would increase the requirements for said system.

Notice: Disturbance of the designated repair area may result in the Suspension or Revocation of this permit.

Comments: System Classification & Type: III b PUMP 25% REDUCTION; INFILTRATOR; INSTALLED PER , 1961; TO BE INSPECTED BY GWS / 5 YRS.

DENR Authorized Agent: Chris Sherrill, RS, LSS Signature: Chris Sherrill

Mecklenburg County Groundwater & Wastewater Services
700 N. Tryon St., Suite 211 Charlotte, NC 28202
Phone: (704) 336-5103 Fax: (704) 336-6894

NC DENR
Division of Environmental Health
On-Site Wastewater Section

OPERATION PERMIT for an
ON-SITE WASTEWATER TREATMENT & DISPOSAL SYSTEM

File #: 5491B Permit #: _____ Tax Parcel #: 199-353-06

Property Owner: ARCADIA HOMES

Job Location Address: 13325 CLAYSPARROW RD. (LOT #82)

City: CHARLOTTE State: NC Zip Code: 28278

OPERATION PERMIT CONDITIONS:

I. Performance: System shall perform in accordance with 15A NCAC 18A .1961.

II. Monitoring: System shall be monitored as required by 15A NCAC 18A .1961.

III. *Maintenance:* Ground absorption sewage treatment and disposal systems shall be checked, and the contents of the septic tank removed, periodically from all compartments, to ensure proper operation of the system. The contents shall be pumped whenever the solids level is found to be more than 1/3 of the liquid depth in any compartment.

IV. Operation: System shall be operated in accordance with 15A NCAC 18A .1961.

System Classification: IIIb

*Operation Permits for Type V and VI systems expire five (5) years from the date of issuance (in accordance with Table V(a)). The system owner must contact GWS six (6) months prior to expiration for permit renewal.

Subsurface system operator required: Yes ☐ No ☑

☐ *This type of system* requires the system owner to maintain a contract with a certified operator to perform system inspection, maintenance, and reporting as required in 15A NCAC 18A .1961. and Table V(a). The system owner is responsible for all fees associated with these services.

☐ System does not require inspection by GWS on a routine frequency.

☑ System requires inspection by GWS once every five (5) years. The system owner is responsible for all fees associated with the inspection.

☐ System requires inspection by GWS once every three (3) years. The system owner is responsible for all fees associated with the inspection.

☐ System requires inspection by GWS once every twelve (12) months. The system owner is responsible for all fees associated with the inspection.

☐ System requires inspection by GWS once every six (6) months. The system owner is responsible for all fees associated with the inspection.

V. Other:

_____

_____

_____

_____

DENR Authorized Agent: Chris Sherrill, RS, LSS Date: 8/8/07

Signature: Christopher M Sherrill

Mecklenburg County Groundwater & Wastewater Services
700 N. Tryon St., Suite 211 Charlotte, NC 28202
Phone: (704) 336-5103 Fax: (704) 336-6894

NC DENR
Division of Environmental Health
On-Site Wastewater Section

INSTALLATION APPROVAL for an ON-SITE WASTEWATER TREATMENT & DISPOSAL SYSTEM

199-353-05

File #: 5491B Permit #: _____ Tax Parcel #: ~~199-352-02~~

Property Owner: THE SANCTUARY AT LAKE WYLIE

Job Location Address: ~~13325~~ CLAYSPARROW RD (LOT #82)

City: CHARLOTTE 13305 State: NC Zip Code: 28278

Installation Approval Issuance Date: 7/19/07

Permission is hereby given to ☑ install ☐ alter ☐ repair an on-site wastewater treatment & and disposal system, with subsurface soil absorption and effluent discharge, as specified herein at the described location. This approval is granted based upon the application information submitted to our office. All work shall be completed on or before 8/20/07, after which date this approval shall be null and void. The system shall meet all of the construction requirements of 15A NCAC 18A. 1900 which are in effect on the date of granting this approval. An **Operation Permit** must be obtained from the Mecklenburg County Health Department before any system can be covered up or placed into service. The issuance of this permit does not in any way guarantee that the system anticipated to be constructed will operate properly, or relieve any person now of hereafter owning, controlling or using such system from any liability resulting from the failure of the system to operate properly.

***NOTICE: This system shall not be installed while soils are in a wet condition.**

Permitted Design Flow: 600 GPD

Site LTAR: 0.3 GPD/ft² (For new installations only.)

Liquid Capacity of Septic Tank: 1500 gallons

Liquid Capacity of Dosing Tank: 1500 gallons

Drainfield Design ☐ N/A

Trench Depth: 24 inches

Trench Width: 3 feet

Line Spacing: 9 feet (O.C.)

Total line length: 500 feet

# of Lines: 5 @ 100 feet

Depth of Media: 12 inches (Type) INNOVATIVE

Distribution Device: PRESSURE MANIFOLD

Bed Design *(For Repair Installations ONLY.)* ☑ N/A

Bed Depth: _____ inches

Bed Width: _____ feet

Total line length: _____ feet

# of Lines: _____ @ _____ feet

Depth of Media: _____ inches (Type) _____

Distribution Device: _____

Water Supply Source

☑ Municipal ☐ Private Well ☐ Community Well

☐ Other _____


Minimum System Setbacks

Distance from Building Foundation: 25 feet

Distance from Property Line: 10 feet

Distance from Water Supply Source: 10 feet

SKETCH OF SYSTEM LAYOUT
(Proposed Layout)

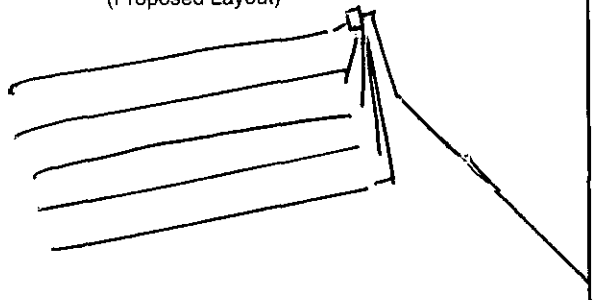

INSTALL PER PLANS ON FILE
CMS
7-19-07

Comments: System Classification & Type: IIIb PUMP 25% REDUCTION LOCATED IN OFF-SITE EASEMENT, HERMIT THRUSH LN.

DENR Authorized Agent: Chris Sherrill, RS, LSS Signature: Christopher M Sherrill

CONDITIONS OF IMPROVEMENT PERMIT

Permit Number: **5491B**

Tax Number: 199-353-05 ~~199-352-02~~

- The IMPROVEMNET PERMIT is subject to revocation if site plans or the intended use change. There is to be **NO** grading, filling, or disturbance of the soil in the area of the septic tank system or repair area.
- CONSTRUCTION AUTHORIZATION must be obtained prior to receiving a Building Permit. The Construction Authorization is **NOT** transferable. Do not clear, grade, fill or disturb soil prior to obtaining a Construction Authorization.
- Domestic-type wastewater only. No industrial process wastewater may be discharged into the system.

Basement: ☒ Yes ☐ No ☐ Partial Basement

Primary Wastewater System

Type: ☐ I ☐ II ☒ III ☐ IV ☐ V ☐ VI

☐ Conventional
☐ Prefabricated, permeable block panel system
☐ Shallow Placed Conventional
☐ Low Pressure Pipe
☐ Large Diameter Pipe
☐ Fill
☐ Other
☒ Innovative or Experimental:

0.3 Long-term acceptance rate (GPD/ft^2)	600 Max gallons/day wastewater flow	1500 Absorption Area (ft^2)	9 Trench spacing (min. on centers) (ft)
Serviced by private well: ☐ Yes ☒ No	1500 Gallon septic tank	500 Total trench length (ft)	24 Maximum trench depth (in) (At least 12" of provisionally suitable soil must remain between trench bottom and unsuitable soil conditions.)
5 Bedrooms in residence	1500 Gallon pump tank	na Depth of stone (in)	

Any surface water present: **No** Type: Minimum separation distance (ft):

Additional conditions: ***Install according to plans on file submitted by Toney Jacobs and associates.***
Install pressure manifold.

Repair Area System

Type: ☐ I ☐ II ☒ III ☐ IV ☐ V ☐ VI

☐ Conventional
☐ Prefabricated, permeable block panel system
☐ Shallow Placed Conventional
☐ Low Pressure Pipe
☐ Large Diameter Pipe
☐ Fill
☐ Other
☒ Innovative or Experimental:

1500 Absorption Area (ft^2) 500 Total trench length (ft)	na Depth of stone (in)	9 Trench spacing (min. on centers) (ft)	24 Maximum trench depth (in)

The undersigned, an authorized agent of the MECKLENBURG COUNTY HELTH DEPARTMENT, certifies that the Department has approved the Request for the Job Location contained in this document. The approval is granted in accordance with the provisions of Laws and Rules For Sewage, Treatment and Disposal in effect at the time of issuance of the permit and is subject to the following provisions:

*** No work shall be conducted on the septic tank system until an Installation, Construction, Alteration and/or Repair Approval is granted by this Department.

*** This Improvement permit is transferable.

DENR Authorized Agent Date 8/2/04

Owner/Agent Signature Date

MECKLENBURG COUNTY
HEALTH DEPARTMENT
ENVIRONMENTAL HEALTH DIVISION
c/o HAL MARSHALL CTR.
SUITE 211
700 N. TRYON ST.
CHARLOTTE, NC 28202
(704) 336-5103

NORTH CAROLINA DEPARTMENT OF
ENVIRONMENTAL, HEALTH, AND
NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

TONEY C. JACOBS & ASSOCIATES, INC.

Consulting Soil Scientists

Licensed by the North Carolina Board for Licensing of Soil Scientists
Certified by the American Registry of Certified Professionals in Agronomy, Crops and Soils

168 Broadbill Drive
Mooresville, NC 28117
Phone (704) 663-6905
Fax (704) 662-9845 E-mail jacobs@i-america.net

July 8, 2004

To: Mr. David Cornelius, R.S.
Mecklenburg County Env. Health Dept.

From : Toney C. Jacobs
Paul G. Penninger

RE: Request for an Improvement Permit for lot 82 at The Sanctuary:
MCHD file # 5491B

Crescent Resources is requesting an Improvement Permit for lot **82** at The Sanctuary Subdivision for a **5** bedroom, basement home. Mr. Bill Marlin of the MCHD evaluated the soils on 5-20-04 and determined the off-site septic area is PS at an 0.3 gpd/ft^2 LTAR. Toney C. Jacobs and Associates, Inc. has flagged a 25% reduction septic system and repair on the off-site septic area, as shown on the attached sketch.

We understand a building permit cannot be issued until your office issues an Authorization to Construct (ATC). The buyer of the lot will apply for the ATC. If the buyer's house pad does not fit in the "building envelope" shown on the Improvement Permit, we understand the proposed system may have to be modified prior to your office issuing the ATC. **No grading shall take place on lot prior to obtaining the ATC from the MCHD.**

Tri-County Wastewater (TCWW) is under contract to supply maintenance services for each septic system installed at The Sanctuary. TCWW will have a list of preferred septic contractors for the subdivision and will also have requirements for the installation of the septic systems that are greater that the state requirements. It will be the responsibility of TCWW to enforce any requirements above state requirements or the conditions on the Improvement Permit or ATC.

Please review the attached system sketch and design specifications for the Improvement Permit. Please call if you have and questions, comments, or corrections.

Design Specifications for Lot 82 at

The Sanctuary, MCHD File # 5491B

System Type:	primary: repair:	pressure manifold , 25% reduction pressure manifold , 25% reduction
Daily design flow:		600 gpd
Septic tank size:		1500 gal. (2 compartments)
Pumping tank size:		1500 gal.
Effluent loading rate:		0.3 gpd/ft^2 for primary and repair
Number and length of laterals:		5@ 100 ft., 25% reduction
Flow rate through the system:		27.5 gpm –use ½ in. SCH 80 taps with 2 ft. head pressure on pressure manifold (5.5 gpm per tap)
Pump requirements:		to be calculated by installer or owners agent when specific house and pump tank location are available
Dosing volume:		approx. 270 gal. – 2.2 doses/day at design flow
Depth of water pumped per dose:		calculated to specific tank by measure or dealer engineering specifications (1 cubic ft. of water equals 7.48 gal.)
Check valve:		YES
Siphon break hole:		No

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: PO 199-352-02
Lot #: 82, 83, off-site area
File #: 5491B
Code: 1

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Owner: The Sanctuary at Lake Wylie
Address: 10933 Ballantyne Crossing Ave., Charlotte, N. C. 28277
Proposed Facility: Residence Design Flow (.1949): 600gpd
Location of Site: Common open space, Hermith Thrush Lane
Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [x] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

Applicant: Toney Jacobs
Date Evaluated: 05/20/2004
Property Size: .5a
Property Recorded:

PROFILE #	1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY 1941 1941 Structure/ Texture	1941 Consistence Mineralogy	OTHER PROFILE FACTORS 1942 Soil Wetness/ Color	1943 Soil Depth (IN.)	1956 Sapro Class	1944 Restr Horiz	Profile Class & LTAR
1	LS, 8	0-5	GR/CL	FR/SEXP/SS/SP	>48" TO SOIL WETNESS	48	N/A	NONE	PS, IV
		5-48	SBK/C	FI/SEXP/S/P					.3GPD/FT^2
2	"	0-4	GR/CL	FR/SEXP/SS/SP	"	"	"	"	"
		4-48	SBK/C	FI/SEXP/S/P					
3	"	0-6	GR/CL	FR/SEXP/SS/SP	"	"	"	"	"
		6-42	SBK/C	FI/SEXP/S/P					
4	"	0-7	GR/CL	FR/SEXP/SS/SP	>39" TO SOIL WETNESS	39	"	"	"
		7-39	SBK/C	FI/SEXP/S/P					

Description	Initial System	Repair System
Available Space (.1945)	PS	PS
System Type(s)		
Site LTAR	.3GPD/FT^2	.3GPD/FT^2

Other Factors (.1946):
Site Classification (.1948): PROVISIONALLY SUITABLE
Evaluated By: W. R. Marlin, LSS, 5/27/2004, W. R. Marlin
Others Present:

COMMENTS:

Offsite areas for installation of systems for lots 82 & 83

Landscape Position	Group	Texture	.1955 LTAR
R-Ridge	I	S-Sand	1.2 - 0.8
SS-Shoulder Slope		LS-Loamy Sand	
LS-Linear Slope			
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6
NS-Nose Slope		L-Loam	
HS-Head Slope			
CC-Concave Slope	III	SI-Silt	0.6 - 0.3
CV-Convex Slope		SICL-Silty Clay Loam	
T-Terrace		CL-Clay Loam	
FP-Flood Plain		SCL-Sandy Clay Loam	
	IV	SC-Sandy Clay	0.4 - 0.1
		SIC-Silty Clay	
		C-Clay	


Structure
SG-Single Grain
M-Massive
CR-Crumb
GR-Granular
SBK-Subangular Blocky
ABK-Angular Blocky
PL-Platy
PR-Prismatic

Consistence
Moist
VFR-Very Friable
FR-Friable
FI-Firm
VFI-Very Firm
EFI-Extremely Firm

Consistence
Wet
NS-Non-Sticky
SS-Slightly Sticky
S-Sticky
VS-Very Sticky
NP-Non-Plastic
SP-Slightly Plastic
P-Plastic
VP-Very Plastic

Mineralogy
SEXP-Slightly Expansive
EXP-Expansive

Sketch of Soil Evaluation Locations

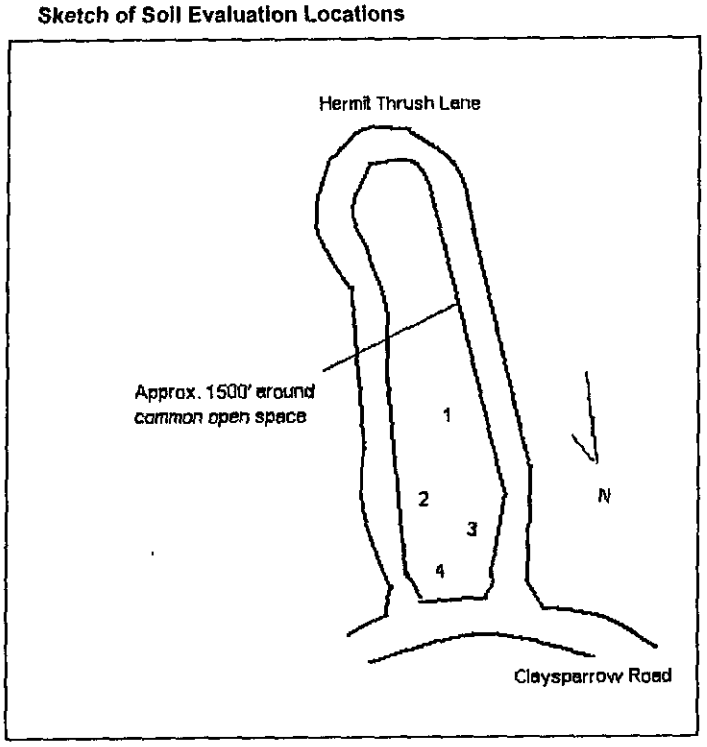

LEGEND
RW - RIGHT-OF-WAY

NOTES
ACREAGES ARE CALCULATED BY COORDINATE METHOD.
BEARINGS BASED ON NC GRID-NAD 83 - SPC 97
ALL DISTANCES SHOWN ARE GROUND DISTANCES TO OBTAIN GRID DISTANCES US THE GRID FACTOR OF 0.99984410
THIS PROPERTY LIES WITHIN THE LAKE WYLIE CRITICAL AND PROTECTIVE WATERSHED AREAS.
AT THIS TIME, THIS PROPERTY IS LOCATED WITHIN THE CITY OF CHARLOTTE'S EXTRA TERRITORIAL JURISDICTION.

THIS PLAT IS SUBJECT TO ANY EASEMENTS, AGREEMENTS, OR RIGHTS-OF-WAY OF RECORD PRIOR TO DATE OF THIS PLAT, WHICH WAS NOT VISIBLE AT THE TIME OF OUR INSPECTION.

GS 47-30(F)(11)(C1)
THIS SURVEY IS OF AN EXISTING PARCEL OF LAND AND DOES NOT CREATE A NEW STREET OR CHANGE AN EXISTING STREET.


THIS SURVEY NOT INTENDED TO MEET GS47-30 REQUIREMENTS. THIS SURVEY WAS PERFORMED PER THE STANDARDS OF PRACTICE FOR LAND SURVEYING IN NORTH CAROLINA WITH AN ERROR OF CLOSURE IN EXCESS OF 1:10,000.

PROPERTY CORNERS IDENTIFIED WERE LOCATED BY ACTUAL FIELD SURVEY. ALL DISTANCES ARE HORIZONTAL DISTANCES UNLESS OTHERWISE NOTED.

THIS MAP WAS PREPARED FOR THE PURPOSE OF RIGHT-OF-WAY OR EASEMENT ACQUISITION ONLY, AND IS NOT INTENDED TO BE A BOUNDARY SURVEY OF THE PROPERTY SHOWN.

I, JOSEPH E. WHALEY JR., STATE THAT THIS MAP WAS DRAWN UNDER MY SUPERVISION FROM AN ACTUAL FIELD SURVEY MADE BY YARBROUGH-WILLIAMS & HOULE, INC.

LOCATION MAP - NOT TO SCALE

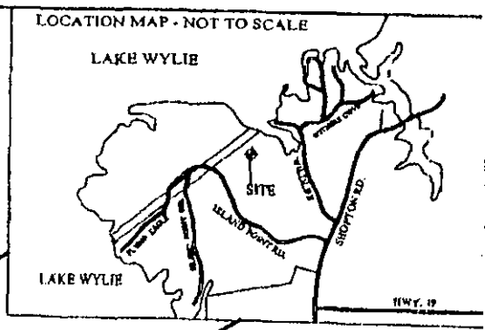

75

NOW OR FORMERLY
THE SANCTUARY AT
LAKE WYLIE, LLC.

CURVE TABLE					
CURVE	RADIUS	LENGTH	CHORD	BEARING	DELTA
C1	145.00	31.22	31.16	S46°07'36"W	12°20'12"

76

LOT 82A
NOW OR FORMERLY
THE SANCTUARY AT
LAKE WYLIE, LLC.
DEED:16493-360
TAX #199-091-50
35,148 SQUARE FEET
OR 0.807 ACRE

CLAYSPARROW ROAD
FUTURE 50' PUBLIC R/W

S38°47'20"E
71.94'
S81°07'18"E
59.60'
S84°13'40"E
67.23'
3.56'
C1
S39°57'30"W
N40°26'13"E
1264.58'

APPROX. LOCATION
SEPTIC DRAIN FIELD LINES

225.73'
S52°17'42"W

SUPPLY LINE FROM LOT 83

PSDE
PSDE
101.45'
N77°25'58"W
41.56'
N74°42'18"W

CLAYSPARROW ROAD
FUTURE 50' PUBLIC R/W

81

Lot 82

80 SEPTIC AREA.

NOW OR FORMERLY
THE SANCTUARY AT
LAKE WYLIE, LLC.

0 25 50 100 150
GRAPHIC SCALE 1 inch = 50 ft.

PRELIMINARY
NOT FOR RECORDATION, CONVEYANCES OR SALES

PLAT

MAP FOR: SEPTIC DRAIN FIELD EASEMENT
THE SANCTUARY AT LAKE WYLIE, LLC

SCALE	TOWNSHIP	COUNTY	STATE	DATE
1" = 50'	STEELE CREEK	MECK.	N.C.	

LOT 82A SEPTIC DRAIN FIELD EASEMENT
READING PROPERTY - .807 ACRES ON ISLAND POINT ROAD

SURVEYED
MAPPED JEW

YARBROUGH-WILLIAMS & HOULE, INC.
730 WINDSOR OAK COURT, CHARLOTTE, NC., 28273
PO BOX 7007 CHARLOTTE, N.C., 28241 704-556-1990

MAP RECORDED
CAB. E FILE 836
DEED RECORDED

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: PO 199-352-02
Lot #: 82
File #: 5491B
Code: 3

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

Owner: The Sanctuary at Lake Wylie
Address: 10933 Ballantyne Crossing Ave., Charlotte, N. C. 28277
Proposed Facility: Residence Design Flow (.1949): 600gpd
Location of Site: Claysparrow Road
Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [ ] Auger Boring [x] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

Applicant: Toney Jacobs
Date Evaluated: 05/18/2004
Property Size: .5a inv.
Property Recorded:

PROFILE #	1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY 1941 1941 Structure/ Texture	1941 Consistence Mineralogy	OTHER PROFILE FACTORS 1942 Soil Wetness/ Color	1943 Soil Depth (IN.)	1956 Sapro Class	1944 Restr Horiz	Profile Class & LTAR
1	LS, 15	0-2	GR/CL	FR/SEXP/SS/SP	>52" TO SOIL WETNESS	27	US	NONE	US
		2-27	ABK/SBK/C	VFI/EXP/VS/VP					
		27-52	M/CL	FR-FI/SEXP/SS/SP					
2	"	0-2	GR/L	FR/SEXP/NS/NP	>49" TO SOIL WETNESS	19	"	"	"
		2-19	SBK/C	VFI/EXP/VS/VP					
		19-49	M/CL	FR-FI/SEXP/SS/SP					
3	"	0-3	GR/L	FR/SEXP/NS/NP	>50" TO SOIL WETNESS	26	"	"	"
		3-26	ABK/C	VFI/EXP/VS/VP					
		26-50	M/SCL	FR/SEXP/SS/SP					

Description	Initial System	Repair System
Available Space (.1945)	US	US
System Type(s)		
Site LTAR		

Other Factors (.1946):
Site Classification (.1948): UNSUITABLE
Evaluated By: W. R. Marlin, LSS, 5/20/2004, W. R. Marlin
Others Present:


COMMENTS:

100% repair, drainfield to be located in common open space, Hermit Thrush Lane

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace		CL-Clay Loam		
FP-Flood Plain		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

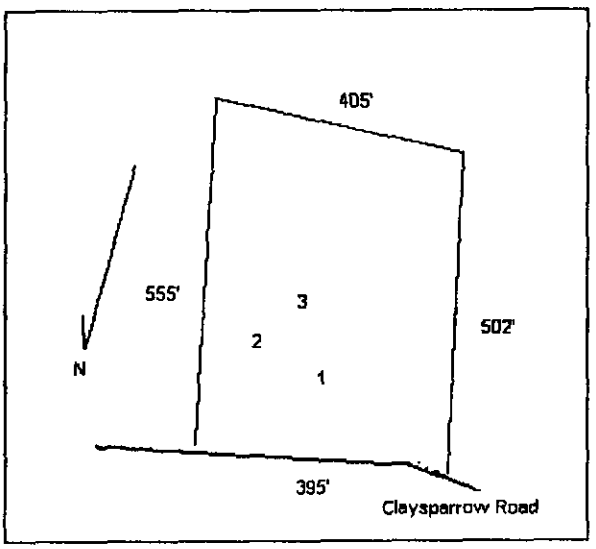

MECKLENBURG COUNTY
Health Department

May 24, 2004

The Sanctuary At Lake Wylie, LLC
10933 Ballantyne Crossing Avenue
Charlotte, NC 28277

Re: Application for improvement permit for Toney C. Jacobs
Property Site: Claysparrow Road, lot #82
Health Department file no. 5491B

Dear Property Owner or Owner's Agent:

The Mecklenburg County Health Department, Environmental Health Division on May 20, 2004 evaluated the above-referenced property at the site designated on the plat/site plan that accompanied your improvement permit application. According to your application the site is to serve a 5-bedroom residence, with a design wastewater flow of ___600____gallons per day. The evaluation was done in accordance with the laws and rules governing wastewater systems in North Carolina General Statute 130A-333 and related statutes and Title 15A, Subchapter 18A, of the North Carolina Administrative Code, Rule .1900 and related rules.

Based on the criteria set out in Title 15A, Subchapter 18A, of the North Carolina Administrative Code, Rules .1940 through .1948, the evaluation indicated that the site is **UNSUITABLE for** a ground absorption sewage system. Therefore, your request for an improvement permit is **DENIED.** A copy of the site evaluation is enclosed. The site is unsuitable based on the following:

_____Unsuitable soil topography and/or landscape position (Rule .1940)
___X___Unsuitable soil characteristics (structure or clay mineralogy) (Rule .1941)
_____Unsuitable soil wetness condition (Rule .1942)
___X___Unsuitable soil depth (Rule .1943)
_____Presence of restrictive horizon (Rule .1944)
_____Insufficient space for septic system and repair area (Rule .1945)
_____Unsuitable for meeting required setbacks (Rule .1950)
_____Other (Rule .1946)

These severe soil or site limitations could cause premature system failure, leading to the discharge of untreated sewage on the ground surface, into surface waters, directly to ground water or inside your structure.

The site evaluation included consideration of possible site modifications, and modified, innovative or alternative systems. However, the Health Department has determined that none of the above options will overcome the severe conditions on this site. A possible option might be a system designed to dispose of sewage to another area of suitable soil or off-site to additional property.

For the reasons set out above, the property is currently classified **UNSUITABLE,** and an improvement permit shall not be issued for this site in accordance with Rule .1948 (c).

However, the site classified as **UNSUITABLE** may be classified as **PROVISIONALLY SUITABLE** if written documentation is provided that meets the requirements of Rule .1948(d). A copy of this rule is enclosed. You may hire a consultant to assist you if you wish to try to develop a plan under which your site could be reclassified as **PROVISIONALLY SUITABLE.**

You have a right to an informal review of this decision. You may request an informal review by the soil scientist or environmental health supervisor at the local health department. You may also request an informal review by the N. C. Department of Environment and Natural Resources regional soil specialist. A request for informal review must be made in writing to the local health department.

You also have a right to a formal appeal of this decision. To pursue a formal appeal, you must file a petition for a contested case hearing with the Office of Administrative Hearings, 6714 Mail Center, Raleigh, NC 27699-6714. To get a copy of a petition form, you may write the Office of Administrative Hearings or call the office at (919) 733-0926 or from the OAH web site at www.oah.state.nc.us/form.htm. The petition for a contested case hearing must be filed in accordance with the provision of North Carolina General Statutes 130A-24 and 150B-23 and all other applicable provisions of Chapter 150B. N. C. General Statue 130A-335(g) provides that your hearing would be held in the county where your property is located.

Please note: If you wish to pursue a formal appeal, you must file the petition form with the Office of Administrative Hearings **WITHIN 30 DAYS OF THE DATE OF THIS LETTER.** The date of this letter is January 29, 2003. Meeting the 30-day deadline is critical to your right to a formal appeal. Beginning a formal appeal within 30 days will not interfere with any informal review that you might request. Do no wait for the outcome of any informal review if you wish to file a formal appeal.

If you file a petition for a contested case hearing with the Office of Administrative Hearings, you are required by law (N.C. General Statute 150B-23) to send a copy of your petition to the North Carolina Department of Environment and Natural Resources. Send the copy to: Office of General Counsel, N. C. Department of Environment and Natural Resources, 1601 Mail Service Center, Raleigh, NC. 27699-1601. Do **NOT** send the copy of the petition to your local health department. Sending a copy of your petition to the local health department will **NOT** satisfy the legal requirement in N.C. General Statute 150B-23 that you send a copy to the Office of General Counsel, NCDENR.

You may call or write the local health department if you need any additional information or assistance.

Sincerely,

David L. Cornelius, R.S.
Authorized Agent - DENR

Encl: (2)

...t of Environment, Health, and Natural Resources
...of Environmental Health
...Wastewater Section

Sheet: 1 of 2 199-353-05
Property ID: ~~PO 199-352-02~~
Lot #: 82, 83, off-site area
File #: 5491B
Code: 1

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Owner: The Sanctuary at Lake Wylie
Address: 10933 Ballantyne Crossing Ave., Charlotte, N. C. 28277
Proposed Facility: Residence Design Flow (.1949): 600gpd
Location of Site: Common open space, Hermith Thrush Lane
Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [x] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

Applicant: Toney Jacobs
Date Evaluated: 05/20/2004
Property Size: .5a
Property Recorded:

PROFILE #	1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY 1941		OTHER PROFILE FACTORS				
			1941 Structure/ Texture	1941 Consistence Mineralogy	1942 Soil Wetness/ Color	1943 Soil Depth (IN.)	1956 Sapro Class	1944 Restr Horiz	Profile Class & LTAR
1	LS, 8	0-5	GR/CL	FR/SEXP/SS/SP	>48" TO SOIL WETNESS	48	N/A	NONE	PS, IV
		5-48	SBK/C	FI/SEXP/S/P					.3GPD/FT^2
2	"	0-4	GR/CL	FR/SEXP/SS/SP	"	"	"	"	"
		4-48	SBK/C	FI/SEXP/S/P					
3	"	0-6	GR/CL	FR/SEXP/SS/SP	"	"	"	"	"
		6-42	SBK/C	FI/SEXP/S/P					
4	"	0-7	GR/CL	FR/SEXP/SS/SP	>39" TO SOIL WETNESS	39	"	"	"
		7-39	SBK/C	FI/SEXP/S/P					

Description	Initial System	Repair System
Available Space (.1945)	PS	PS
System Type(s)	III b	III b
Site LTAR	.3GPD/FT^2	.3GPD/FT^2

Other Factors (.1946):
Site Classification (.1948): PROVISIONALLY SUITABLE
Evaluated By: W. R. Marlin, LSS, 5/27/2004, W. R. Marlin
Others Present:

COMMENTS:
Offsite areas for installation of systems for lots 82 & 83

Landscape Position	Group	Texture	.1955 LTAR
R-Ridge	I	S-Sand	1.2 - 0.8
SS-Shoulder Slope		LS-Loamy Sand	
LS-Linear Slope			
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6
NS-Nose Slope		L-Loam	
HS-Head Slope			
CC-Concave Slope	III	SI-Silt	0.6 - 0.3
CV-Convex Slope		SICL-Silty Clay Loam	
T-Terrace		CL-Clay Loam	
FP-Flood Plain		SCL-Sandy Clay Loam	
	IV	SC-Sandy Clay	0.4 - 0.1
		SIC-Silty Clay	
		C-Clay	


Structure
SG-Single Grain
M-Massive
CR-Crumb
GR-Granular
SBK-Subangular Blocky
ABK-Angular Blocky
PL-Platy
PR-Prismatic

Consistence
Moist
VFR-Very Friable
FR-Friable
FI-Firm
VFI-Very Firm
EFI-Extremely Firm

Consistence
Wet
NS-Non-Sticky
SS-Slightly Sticky
S-Sticky
VS-Very Sticky
NP-Non-Plastic
SP-Slightly Plastic
P-Plastic
VP-Very Plastic

Mineralogy
SEXP-Slightly Expansive
EXP-Expansive

Sketch of Soil Evaluation Locations

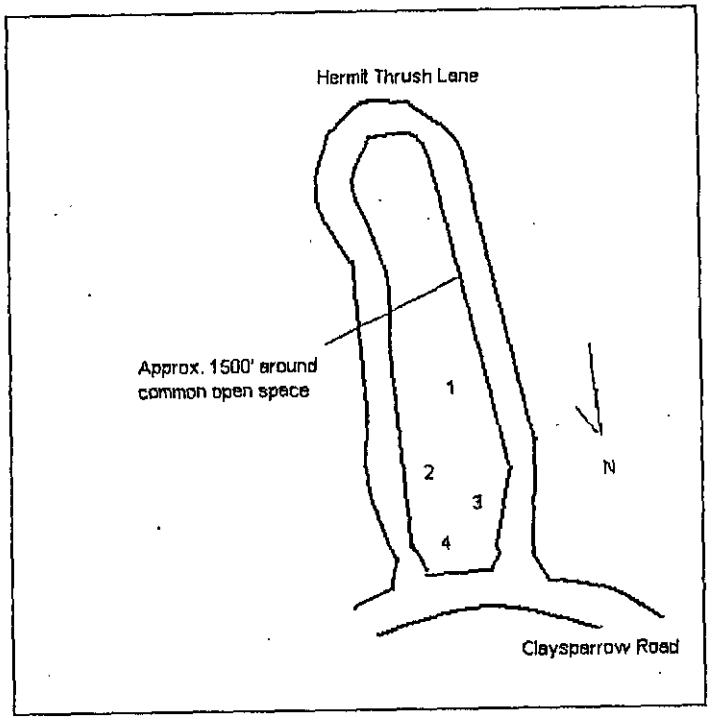

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: PO 199-352-02
Lot #: 82
File #: 5491B
Code: 3

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Owner: The Sanctuary at Lake Wylie
Applicant: Toney Jacobs
Address: 10933 Ballantyne Crossing Ave., Charlotte, N. C. 28277
Date Evaluated: 05/18/2004
Proposed Facility: Residence
Design Flow (.1949): 600gpd
Property Size: .5a inv.
Location of Site: Claysparrow Road
Property Recorded:
Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [ ] Auger Boring [x] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 .1941 Structure/ Texture	.1941 Consistence Mineralogy	OTHER PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
1	LS, 15	0-2	GR/CL	FR/SEXP/SS/SP	>52" TO SOIL WETNESS	27	US	NONE	US
		2-27	ABK/SBK/C	VFI/EXP/VS/VP					
		27-52	M/CL	FR-FI/SEXP/SS/SP					
2	"	0-2	GR/L	FR/SEXP/NS/NP	>49" TO SOIL WETNESS	19	"	"	"
		2-19	SBK/C	VFI/EXP/VS/VP					
		19-49	M/CL	FR-FI/SEXP/SS/SP					
3	"	0-3	GR/L	FR/SEXP/NS/NP	>50" TO SOIL WETNESS	26	"	"	"
		3-26	ABK/C	VFI/EXP/VS/VP					
		26-50	M/SCL	FR/SEXP/SS/SP					

Description	Initial System	Repair System
Available Space (.1945)	US	US
System Type(s)		
Site LTAR		

Other Factors (.1946):
Site Classification (.1948): UNSUITABLE
Evaluated By: W. R. Marlin, LSS, 5/20/2004, W.R. Marlin
Others Present:


COMMENTS:

100% repair, drainfield to be located in common open space, Hermit Thrush Lane

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Foot Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace		CL-Clay Loam		
FP-Flood Plain		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

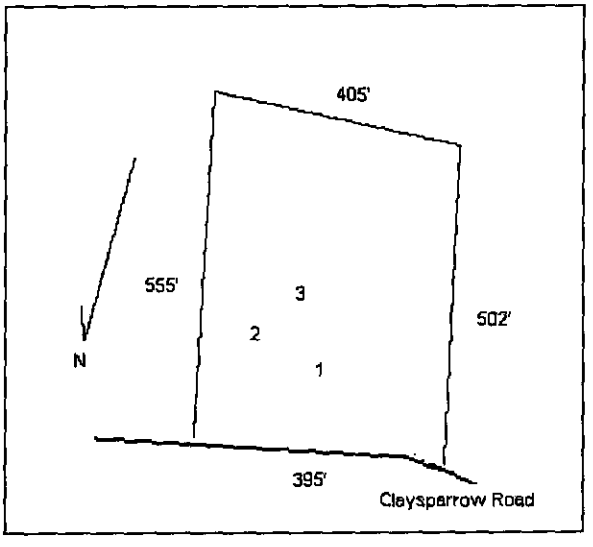

FEE: 200 JKA
DATE: 12/19/03

APPLICATION FOR IMPROVEMENT PERMIT FOR RESIDENTIAL SITE INDIVIDUAL WATER AND WASTEWATER SYSTEMS PROGRAM

2361 | CRT

TYPE APPLICATION: ___ NEW SYSTEM ___ EXPANSION/ ALTERATION OF EXISTING SYSTEM ___ REPAIR OF EXISTING SYSTEM

NORTH CAROLINA
DEPARTMENT OF ENVIRONMENT,
HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

FILE #: 54913

PROPERTY INFORMATION (FROM ENGINEERING FORM) FOR JOB LOCATION:

TAX/PARCEL NUMBER: 199-352-02

STREET ADDRESS: Clay Sparrow Rd

SUBDIVISION OR MOBILE HOME PARK NAME: The Sanctuary At Lake Wylie, LLC

LOT NUMBER: 82

TYPE OF BUILDING (CHECK ONE):

___ SINGLE MOBILE HOME(S)
___ DOUBLE WIDE (D)
___ HOUSE (H)
___ MODULAR HOME (M)
___ MULTIPLE FAMILY (U)
___ OTHER (O)

TOWNSHIP (CHECK ONE):

✓ 0 MECKLENBURG
___ 1 CHARLOTTE
___ 2 DAVIDSON
___ 3 CORNELIUS
___ 4 PINEVILLE
___ 5 MATTHEWS
___ 6 HUNTERSVILLE
___ 7 MINT HILL

HEATED SQUARE FOOTAGE:

NUMBER OF BEDROOMS: NUMBER OF OCCUPANTS:

CLOSING DATE_____

FOUNDATION FOR RESIDENCE:

___ WITHOUT BASEMENT ON SLAB
___ CRAWL SPACE
___ WITH BASEMENT /PLUMBING
___ WITH BASEMENT /NO PLUMBING

IF EXPANSION/ALTERATION OF EXISTING SYSTEM, DESCRIBE THE PROPOSED BUILDING ADDITION:

WILL THERE BE A HOME BUSINESS IN THE RESIDENCE: ___ YES ✓ NO TYPE: _____

WATER SUPPLY (CHECK ONE):

___ COMMUNITY (C)
___ SHARED WELL (S)
✓ MUNICIPAL (M)
___ OTHER 'SPRINGS' (O)
___ PRIVATE WELL (P)

IF ANY OF THE FOLLOWING ARE LOCATED ON THE PROPERTY, PLEASE SHOW LOCATION ON PLAT:

BURIED CABLES, LANDFILLS, STUMPHOLES ___ YES ✓ NO
EXISTING WASTEWATER SYSTEMS ___ YES ✓ NO
EASTMENTS OR RIGHT-OF-WAYS ✓ YES ___ NO
WELL, SPRINGS OR WATERLINES ___ YES ✓ NO
DESIGNATED WETLANDS ___ YES ✓ NO

PROPERTY OWNER:

NAME: (LAST) The Sanctuary at Lake Wylie, LLC (FIRST) (MI)

ADDRESS: 10933 Ballantyne Crossing Ave

CITY: Charlotte STATE: NC ZIP: 28277

DAYTIME PHONE: 704 544-0201 ext 226

LEGAL AGENT FOR PROPERTY OWNER, IF APPLICABLE:

NAME: (LAST) Jacobs (FIRST) Tonya (MI) C

DAYTIME PHONE: 704 663-6905

m 704 582 9219

704-295-1106 Linda Joe

Mobile 704-809 4663 Kevin Jones


WHAT DATE WAS THE PROPERTY ORIGINALLY DEEDED AND RECORDED?

An Improvement Permit is subject to suspension or revocation if site plans or the intended use change or if information submitted in this application is falsified or changed. The undersigned, owner, or legal agent for the owner, of the property described above as the "Job Location" has read the foregoing application, acknowledges that the contents of same are true, and authorizes agents of the Mecklenburg County Health Department to enter onto the property for the purpose of processing this request.

SIGNED: Tonya C Jacobs, CPA (Agent) DATE: 12/19/03

MECKLENBURG COUNTY HEALTH DEPARTMENT
ENVIRONMENTAL HEALTH DIVISION
c/o HAL MARSHALL CTR., SUITE 211, 700 N. TRYON ST., CHARLOTTE, N.C. 28202., (704) 336-5102

Sherry. 704- 309-4766

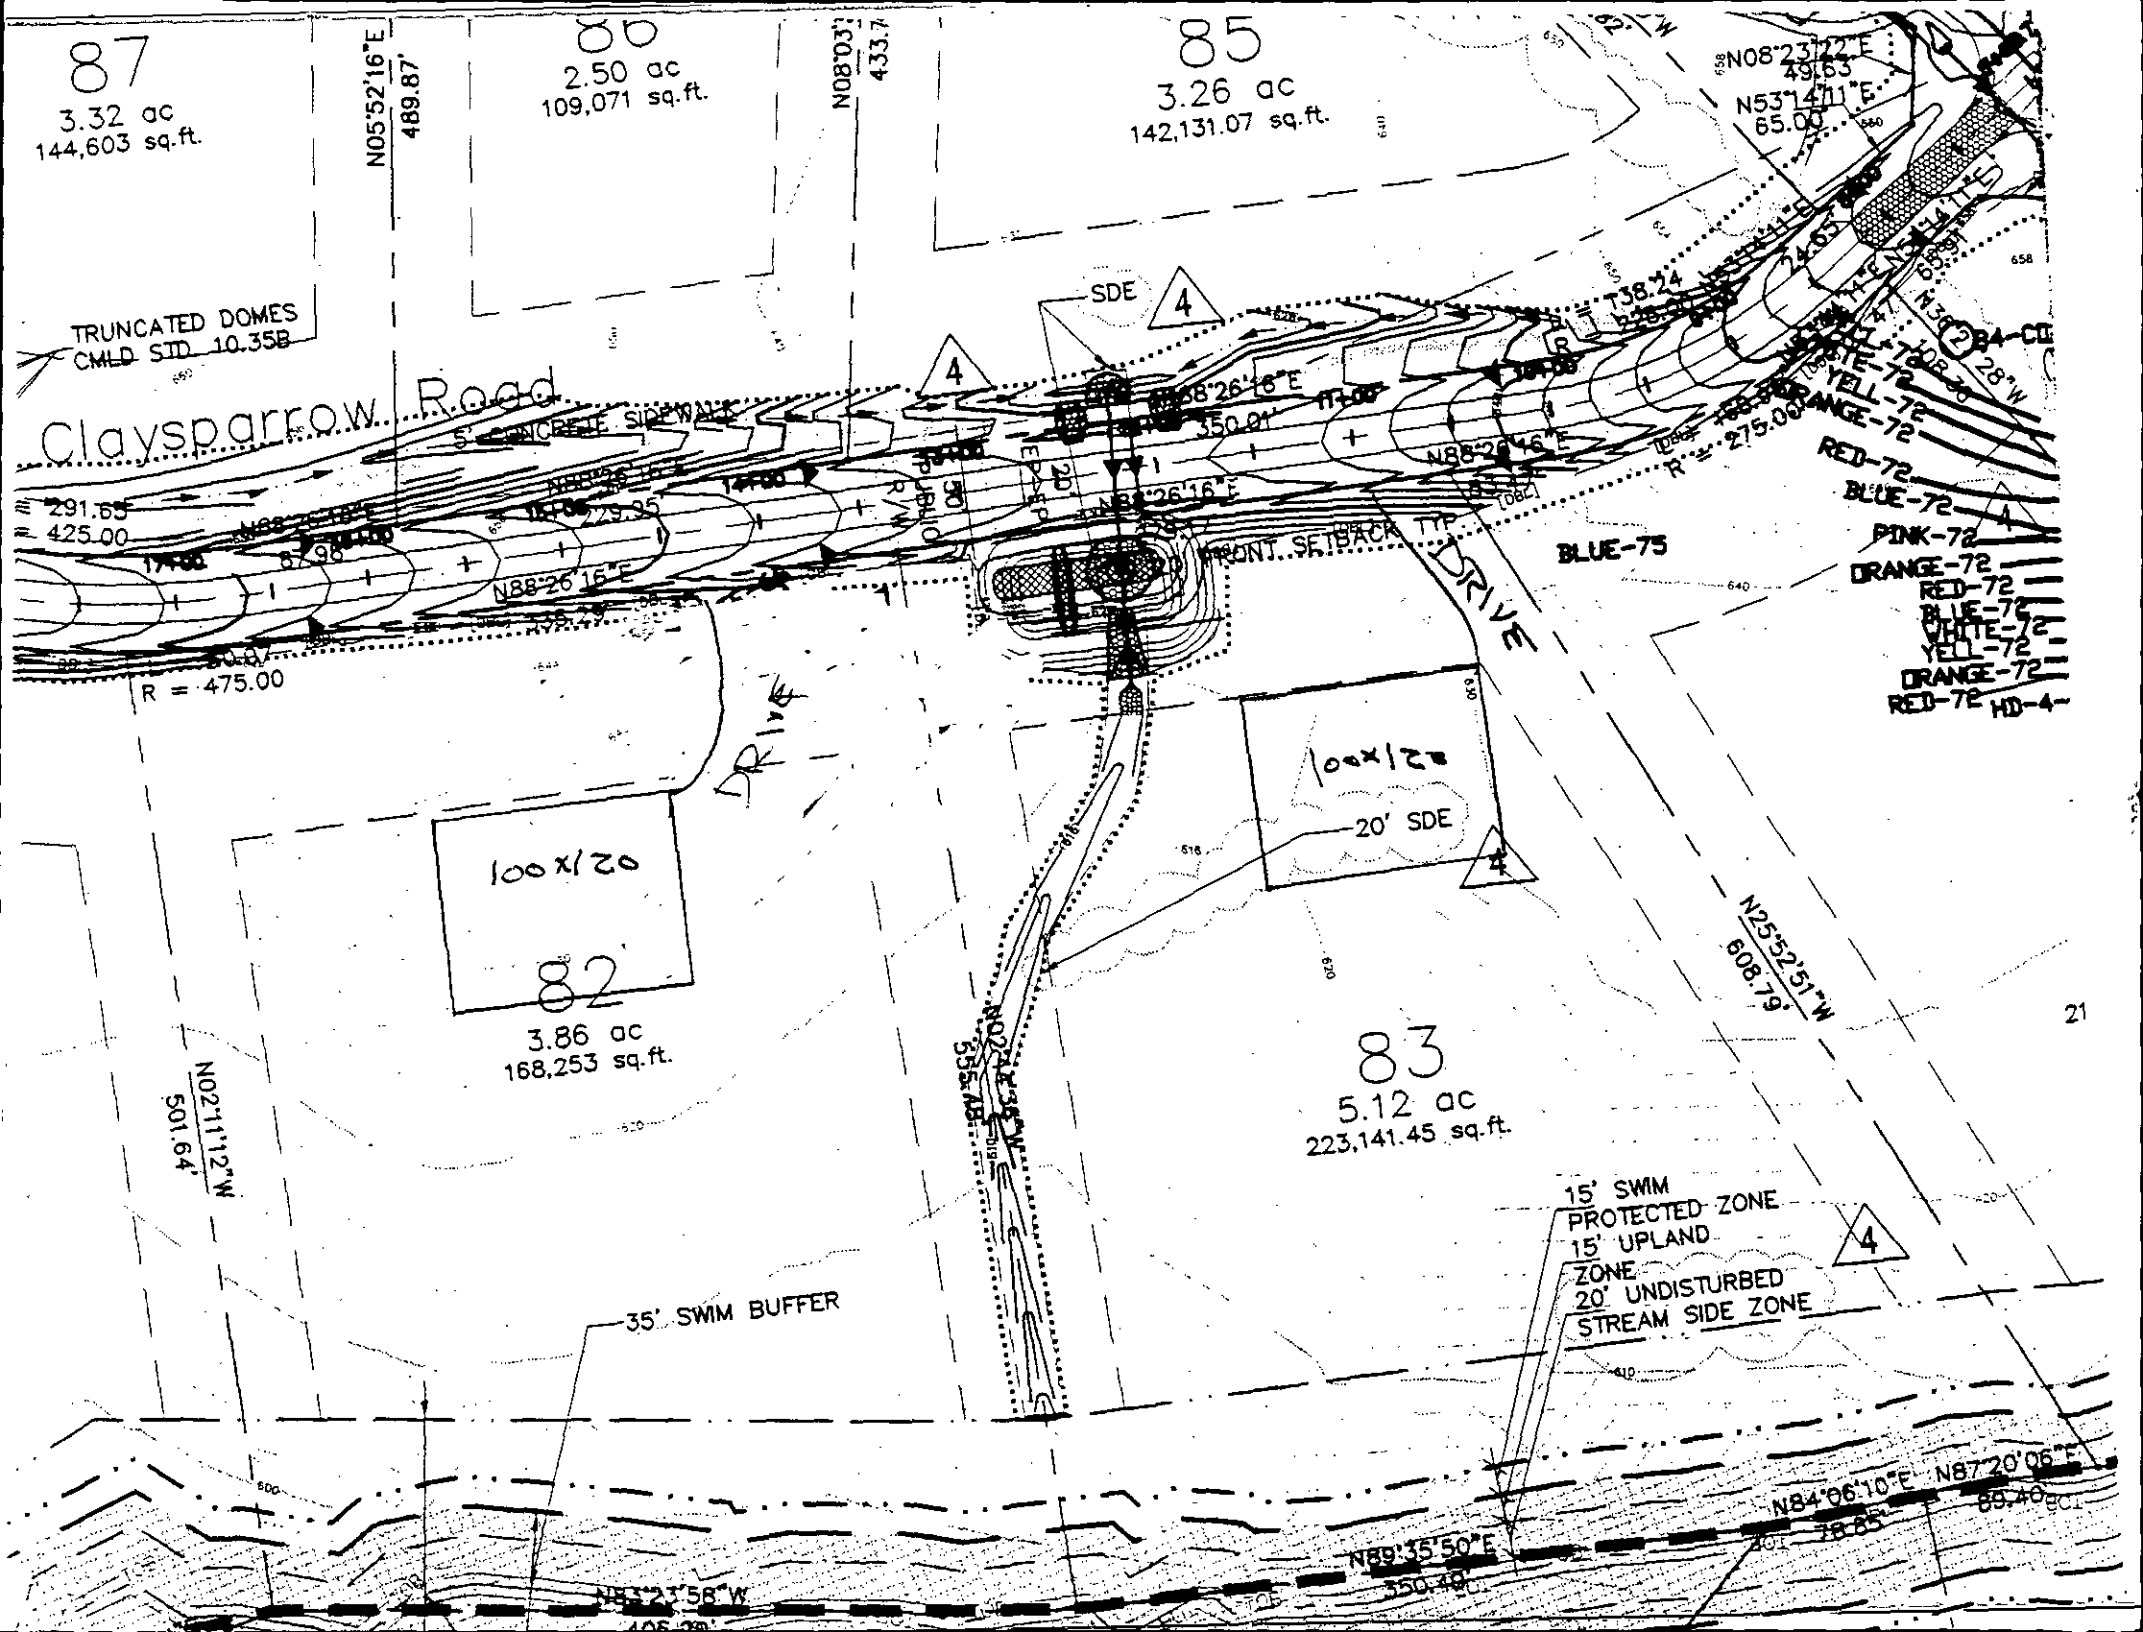
87
3.32 ac
144,603 sq.ft.
N05°52'16"E
489.87'
86
2.50 ac
109,071 sq.ft.
N08°03'
433.7
85
3.26 ac
142,131.07 sq.ft.
N08°23'22"E
49.63'
N53°14'11"E
65.00'
TRUNCATED DOMES
CMLD STD 10.35B
Clayspar row Road
5' CONCRETE SIDEWALK
SDE
4
N88°26'16"E
350.01'
11+00
R = 275.00'
RED-72
BLUE-72
PINK-72
ORANGE-72
RED-72
BLUE-72
WHITE-72
YELL-72
ORANGE-72
RED-72
HD-4-
= 291.65
= 425.00
14+00
N88°26'16"E
29.95'
FRONT SETBACK TYP.
DRIVE
BLUE-75
R = 475.00
100x120
82
3.86 ac
168,253 sq.ft.
100x120
20' SDE
N25°52'51"W
608.79'
21
N02°11'12"W
501.64'
N02°11'36"W
555.48'
83
5.12 ac
223,141.45 sq.ft.
15' SWIM
PROTECTED ZONE
15' UPLAND
ZONE
20' UNDISTURBED
STREAM SIDE ZONE
35' SWIM BUFFER
N89°35'50"E
350.49'
N84°06'10"E
38.85'
N87°20'06"E
89.40'
N83°23'58"W
405.28'

Nova Partner LD B 84050

Arcadia Homes

704 889-4663 Accounting
x21 Accts Payable

Heather Owens CMonVM 10/8 11:50

CMonVM 10/9/07 10:20

~~pc for totaling c/o~~

Her system is down, will research and call me back when her system comes back up.

10/17/07

Nova received call back charged account for $300 for balance of system fee.

JC