S. I. R. NO. 16345

NORTH CAROLINA
DEPARTMENT OF HUMAN RESOURCES
DIVISION OF HEALTH SERVICES
RALEIGH, NORTH CAROLINA

APPENDIX II
SITE EVALUATION

T. C. # 037-111-11

(Ground Absorption Sewage Disposal)

OWNER: DONALD W. WHITE
ADDRESS: 3017 DALECREST DR.
COUNTY: Charlotte 28213
LOCATION OF SITE: Linda Vista RD

DATE REQUESTED: 11-28-79
PLAT NO.:
LOT SIZE: 8.3A

FACTORS	AREA 1	AREA 2	AREA 3	AREA 4
1. SLOPE (%)	S (PS) U 2-10	S PS (U) 10-30	S PS U	S PS U
2. SOIL TEXTURE (12-36 in.) (Sandy, loamy clayey, Note 2:1 Clay)	S PS (U) Clay 2-1	S PS (U) Clay 2-1	S PS U	S PS U
3. SOIL STRUCTURE (12-36 in.) (Clayey Soils)	S PS (U) Massive	S PS (U) MASSIVE	S PS U	S PS U
4. SOIL DEPTH (In.)	S PS (U) <48	S PS (U) <48	S PS U	S PS U
5. RESTRICTIVE HORIZONS (In.) (Impervious Strata Rock)	S PS (U) Clay	S PS (U) CLAY	S PS U	S PS U
6. SOIL DRAINAGE/GROUNDWATER (External & internal)	S PS (U) SLOW	S PS (U) SLOW	S PS U	S PS U
7. SOIL PERMEABILITY (Percolation Rate)	S (PS) U SLOW	S PS (U) SLOW	S PS U	S PS U
8. OTHER (Specify)	S PS U	S PS U	S PS U	S PS U
9. SITE CLASSIFICATION	Unsuitable	UNSUITABLE		
SOIL SERIES	IREDELL & HELENA	IREDELL & HELENA		

S - Suitable PS - Provisionally Suitable U - Unsuitable

* See Diagram on Back (Include: Soil areas, property lines, roads, streams, gullies wet areas, fill areas, wells, water bodies, slope patterns, etc

Recommendations/Comments:

Described By: W. B. Ramsey

Title: Soil Scientist Date: 12-6-79

DHS Form 2601
Sanitation
EHD 539 (3/79)

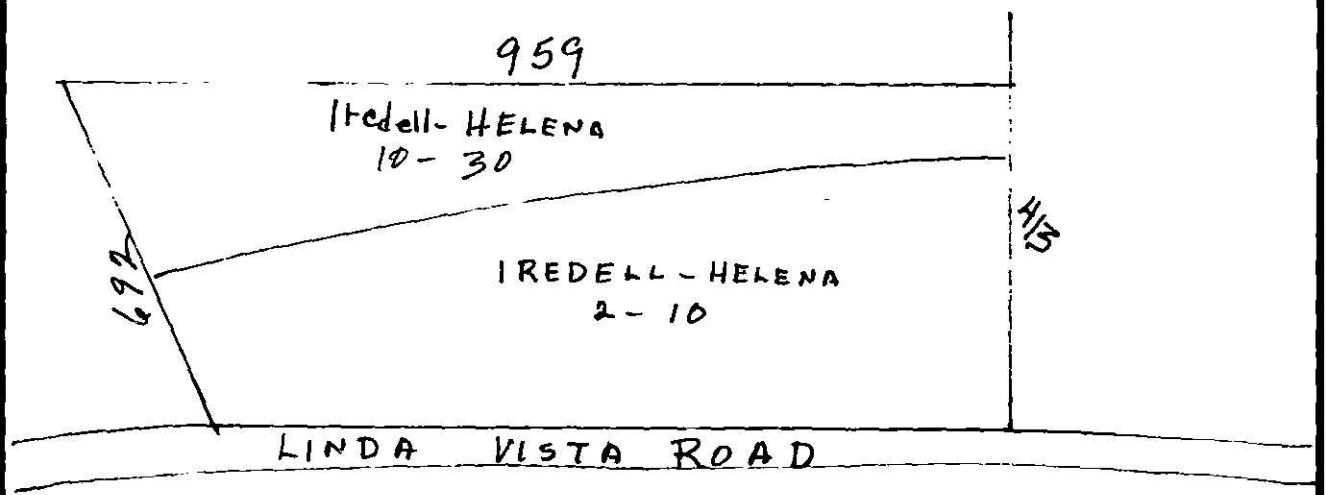
959
Iredell- HELENA
10- 30
IREDELL - HELENA
2 - 10
692
413
LINDA VISTA ROAD

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH
1200 BLYTHE BOULEVARD
CHARLOTTE, NORTH CAROLINA 28203

SITE INVESTIGATION REPORT
INDIVIDUAL SEPTIC TANK SYSTEM
WITH SUBSURFACE,
SOIL ABSORPTION,
EFFLUENT DISCHARGE

SIR.NO. 16345
T.C.NO 037-111-11
MAP DATE
DATE Dec. 10, 1979

NAME OF OWNER White, Donald W.

ADDRESS OF OWNER 3017 Dalecrest Drive, Charlotte, NC 28213

LOCATION OF LOT Linda Vista Road

At your request and pursuant to Section .1900 of the North Carolina Administrative Code, Title 10, Department of Human Resources, Chapter 10, Health Services, Subchapter 10A, a site evaluation has been made for an on premises ground absorption sewage disposal system on the property designated above and the following conditions were found:

Soil Structure Massive
Soil Depth Unsuitable (less than 48 inches)
Soil Permeability Unsuitable

Sites classified as Unsuitable are not acceptable for soil absorption of sewage effluent. However, if engineering, geologic, soil, and environmental studies indicate that a suitable septic tank system or a suitable alternate system can be expected to function satisfactorily, such sites may be re-classified as Provisionally Suitable. (Section 10 of the North Carolina Administrative Code 10 A, 1910)

If you desire to file for permission to install an "alternate or modified" system, you should present this office with your proposals in the form of plans and specifications. These would be reviewed and if it is found that the system may reasonably be expected to function satisfactorily, approval may be given on the execution by you of a "Septic Tank Agreement Form" available in this office.

John R. Adkisson

John R. Adkisson, Environmentalist