Date Received

APT No.

T. C. No.

Map Date

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH

APPLICATION FOR SOIL INVESTIGATION

1) NAME OF OWNER Spratt (LAST) Julian (FIRST) Robert (MIDDLE)

2) ADDRESS OF OWNER 1701 Garden Terrace ZIP 28203

3) PHONE NO Home 372-0002 Office 333-8631 am 375-0666 pm

4) LOCATION OF PROPERTY


STREET OR COUNTY ROAD

5) SUBDIVISION LOT NO BLOCK NO

MAP BOOK NO 3 PAGE NO

6) DEED REFERENCE DEED BOOK PAGE NO

Application is hereby made to the Mecklenburg County Department of Environmental Health for the conduct of a soil investigation and an on site inspection of the lot hereinabove described for the purpose of determining if the lot is suitable for the installation of an individual septic tank wastewater treatment system with subsurface soil absorption effluent discharge

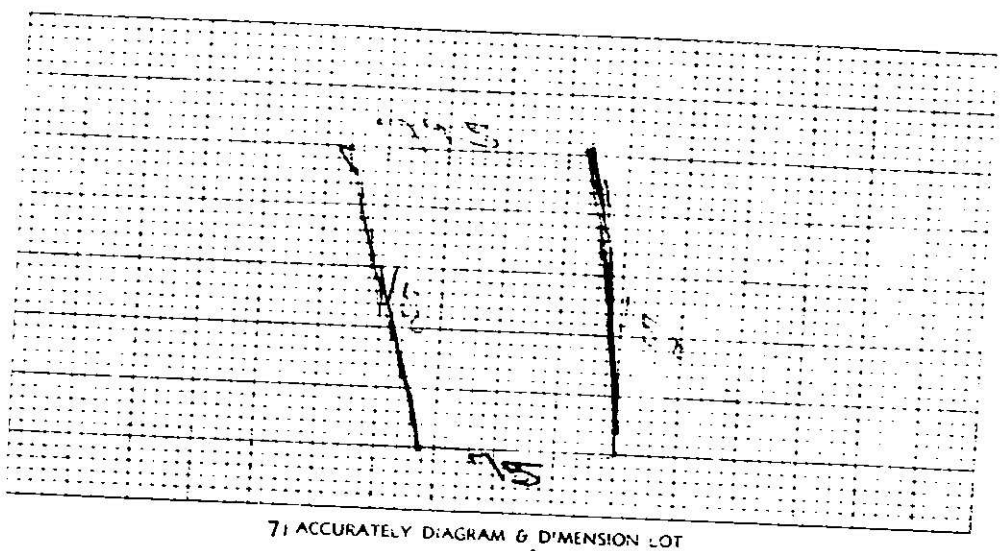

7) ACCURATELY DIAGRAM & DIMENSION LOT

Julian R. Spratt
OWNER

EHD-5-76

Environmental Health Department's Copy

NORTH CAROLINA
DEPARTMENT OF HUMAN RESOURCES
DIVISION OF HEALTH SERVICES
RALEIGH, NORTH CAROLINA

APPENDIX H
SITE EVALUATION

APT 15-88'7

(Ground Absorption Sewage Disposal)

OWNER: Julian R. Pratt
ADDRESS: 1701 Garden Terrace
COUNTY: Charlotte, N.C.
LOCATION OF SITE: 160 Hanson Drive

DATE REQUESTED:
PLAT NO.: TC 153-09210 6076314
LOT SIZE: 11,550

FACTORS	AREA 1	AREA 2	AREA 3	AREA 4
1. SLOPE (%)	S (PS) 20-30% U	(S) PS 2-6% U	S PS U	S PS U +
2. SOIL TEXTURE (12-36 in.) (Sandy, loamy, clayey, Note 2:1, Clay)	S (PS) clay U	S 2:1 PS clay (U)	S PS U	S PS U
3. SOIL STRUCTURE (12.36 in.) (Clayey Soils)	S (PS) Blocky U	S Massive PS (U)	S PS U	S PS U
4. SOIL DEPTH (In.)	(S) 48" PS U	(S) 48" PS U	S PS U	S PS U
5. RESTRICTIVE HORIZONS (In.) (Impervious Strata, Rock)	(S) None PS U	(S) None PS U	S PS U	S PS U
6. SOIL DRAINAGE/GROUNDWATER (External & Internal)	(S) >6' To PS ground U water	S seasonal PS high (U) water table	S PS U	S PS U
7. SOIL PERMEABILITY (Percolation Rate)	S (PS) Moderate U	S PS V slow (U)	S PS U	S PS U
8. OTHER (Specify)	S Inadequate PS Area (U)	S PS U	S PS U	S PS U
9. SITE CLASSIFICATION	unsuitable	unsuitable		
SOIL SERIES	Cecil	Monacan		

S - Suitable PS - Provisionally Suitable U - Unsuitable

* See Diagram on Back (Include: Soil areas, property lines, roads, streams, gullies, wet areas, fill areas, wells, water bodies, slope patterns, etc)


Recommendations/Comments: * lot size

Described By: William A. Martin

Title: Soil Scientist Date: 7-19-79

DHS Form 2604 (2/77)
Sanitation

2

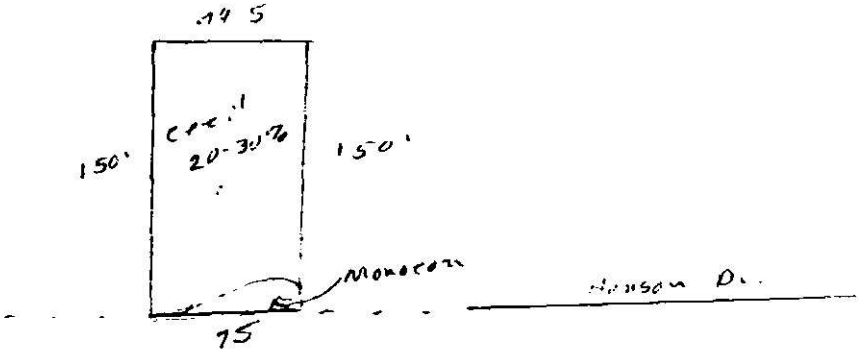
145
150'
Corn
20-30%
150'
Monocon
Hanson D.
75

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH
[illegible] BOULEVARD
CHARLOTTE, NORTH CAROLINA 28203

SITE INVESTIGATION REPORT
INDIVIDUAL SEPTIC TANK SYSTEM
WITH SUBSURFACE,
SOIL ABSORPTION,
EFFLUENT DISCHARGE

SIR. NO. 15887
T.C. NO. 153-092-10
MAP DATE 7/1/79
DATE 7/19/79

NAME OF OWNER Spratt, Julian Robert

ADDRESS OF OWNER 1701 Garden Terrace Charlotte, NC 28203

LOCATION OF LOT Hanson Drive Lots 3 and 4

As determined under the Rules and Regulations promulgated by the Commission for Health Services, Division of Health Services, North Carolina Department of Human Resources, Raleigh, North Carolina, the soils on the lot described above were found to be unsuitable for the installation of an individual septic tank - soil absorption system. This site cannot be approved for a septic tank system due to the following reason:

Inadequate area available for installation of ground absorption sewage disposal system in accordance with North Carolina Department of Human Resources specifications.

John R. Adkisson

John R. Adkisson, Environmentalist

R

SEE INSTRUCTIONS ON BACK

Date Received 1-9-79

ICAR(S) Application No. 1587

T. C. No. 58, 192-10


Map Date 7-1-79

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH

Application for an
Installation, Construction, Alteration, and/or Repair Permit
(Individual Septic Tank System with Subsurface, Soil Absorption, Effluent Discharge)

The owner of that property described hereinafter hereby applies to the Mecklenburg County Department of Environmental Health for a permit to:

1) X Install or Construct 2) _____ Alter or Repair an individual septic tank wastewater treatment system with a subsurface, soil absorption, effluent discharge.

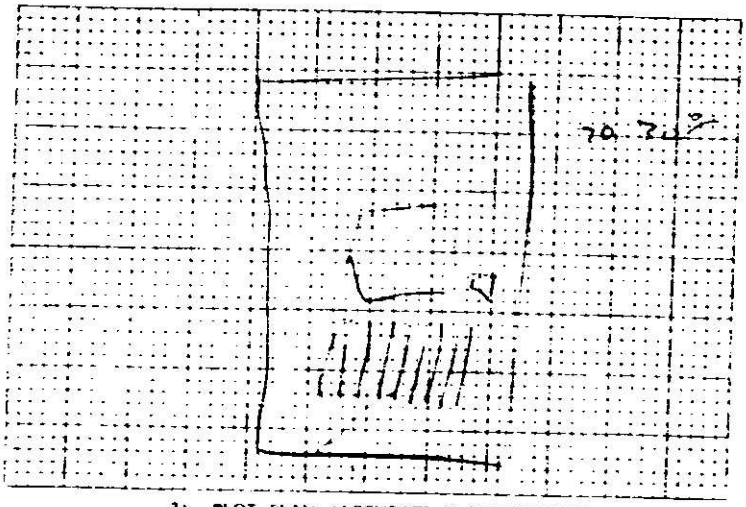

3) PLOT PLAN (ACCURATELY DIMENSIONED)

Mobile Home ____Yes ____No
Residence X Yes ____No
4) No of Bedrooms 2
5) Business Use - Max No Employees ____
6) Washing Machine X Yes ____No
7) Garbage Disposal ____Yes X No
8) Dishwasher ____Yes ____No
9) Water Supply
A) Individual Well ____
B) Governmental System X
C) Community System
1 Well source ____
2 Governmental source ____
10) Sewage System
House located within 200 feet of public sewer ____Yes X No
House located within 200 feet of community sewer ____Yes X No
11) FHA Case No ____
12) VA Case No ____

13) NAME OF OWNER Spratt (LAST) Julian (FIRST) Robert (MIDDLE)

14) ADDRESS OF OWNER 1701 Garden Terrace 28203

15) PHONE NO Home 372-8002 Office 333-8631 am 375-0666

16) LOCATION OF SYSTEM [illegible] (STREET OR COUNTY ROAD)

17) SUBDIVISION ____ Lot No. 3 + 4 Block No. ____

Map Book No ____ Page No. ____

18) DEED REFERENCE — DEED BOOK ____ AT PAGE ____

19) HAS A SOIL INVESTIGATION BEEN RUN? ____ YES ____ NO DATE RUN ____

20) PTR NUMBER (See Instructions) ____

The undersigned person hereby agrees that he has read the foregoing application and that the contents of same are true. It is understood that any permit applied for herein shall be void and of no effect if any of the above facts are not true.

DATE OF APPLICATION ____

Julian R Spratt
OWNER

EHD-5-76

ENVIRONMENTAL HEALTH DEPARTMENT'S COPY