

7031 SAMPLE RD

02320102

LOT 9

1/11/2008

duponbj

Groundwater and Wastewater Services File Imaging Project
May 2007
Barcode Font = IDAutomationHC39M

EHS OJ

67478 County Permit Review Worksheet

Reviewer RBL

Rule or Law		1	2	3	4	5	6	7	8	9	10
	Permit Application										
.1937(d)	Is the Application complete	✓									
.1937(d)	Is there a Site plan/Plat with application	✓									
.1937(d)	Is the Facilityshown?	✓									
.1937(d)	Are appurtenances shown	✓									
	Site Evaluation Information										
.1939 (a)(1)	Topography and Landscape Position Recorded?	✓									
.1940 (a-g)	Slope % Recorded?	✓									
.1939 (a)(2)	Texture Class Recorded?	✓									
.1939 (a)(2)	Structure type Recorded?	✓									
.1939 (a)(2)	Consistence Recorded?	✓									
.1939 (a)(3)	Mineralogy Recorded?	✓									
.1939 (a)(4)	Soil Wetness Condition Recorded?	✓									
	Soil Depth to Rock or Parent Material Recorded When Encountered?	✓									
.1939 (a)(5)	Depth to Restrictive Horizons Recorded When Encountered?	✓									
.1939 (a)(6)	Sufficient Available Space Recorded?	✓									
.1937(m)	Are the Profile Locations Shown?	✓									
.1939(a) & .1945(b)	Are the S/PS Profiles in system & in repair area?	✓									
	Number of auger borings made:	4									
.1939(d), .1955, .1956, .1957	Were sufficient auger borings made?	✓									
	LTAR	3									
	IP/CA										
G.S. 130A-336(a) & .1937(g)	Proposed System Type stated-Initial	✓									
.1945(b)	Proposed System Type stated-Repair	✓									
G.S. 130A-336(a)(3)	System location identifiable by setbacks - Initial	✓									
.1937(g) & .1945(b)	System components shown - Initial	✓									
.1945(b)	Repair area shown	✓									
.1937 (f)(g)	Does System design match facility, flow & WW characteristics?	✓									
.1937 (f)(g)	Is System design consistent with soil/site conditions?	✓									
.1937 (f)(g)	Is the System located in the approved area?	✓									
G.S. 130A-336(a)	Is the Design flow (gpd) indicated?	✓									
G.S. 130A-336(a)	Number of Bedrooms, employees, seats, etc. indicated?	✓									
.1937(g)	Trench depth indicated?	✓									
.1937(g)	Trench width indicated?	✓									
.1937(g)	Trench length indicated?	✓									
G.S. 130A-336(a)(1)	Proposed/existing well shown?	✓									
G.S. 130A-336(a)(1)	Property line lengths shown?	✓									
G.S. 130A-336(a)	Facility/appurtenance setbacks shown from fixed points?	✓									
	OP										
.1937(i)	System type as described in table V(a) of rule .1961										
.1937(i)	Conditions for system performance, operation, maintenance, monitoring and reporting.										

System design is incorrect or inconsistent with site conditions, indicate why for each below

#1358

SEPTIC FEE: 200 CK
DATE: 9/7/06
CRT [ ]

PERMIT APPLICATION FOR A RESIDENTIAL SITE
IMPROVEMENT PERMIT / CONSTRUCTION AUTHORIZATION
FOR ON-SITE WASTEWATER SYSTEM
NEW WELL INSTALLATION OR REPAIR OF EXISTING WELL
MECKLENBURG COUNTY GROUNDWATER & WASTEWATER SERVICES

GWS – RES. APP 07/05

WELL FEE: _____
DATE: _____
CRT [ ]

FILE # 6747B

SEPTIC / TYPE APPLICATION: ☐ NONE ☑ NEW SYSTEM ☐ ALTERATION ☐ REPAIR ☐ MODIFY PLOT PLAN

WELL / TYPE APPLICATION: ☑ NONE ☐ NEW WELL ☐ MAJOR REPAIR ☐ ABANDONMENT

JOB LOCATION INFORMATION:
TAX/PARCEL #: 02320102 PO
STREET ADDRESS: Sample Road
CITY: Huntersville
STATE: NC ZIP: 28078
SUBDIVISION OR MOBILE HOME PARK NAME:
LOT #: 9
TOWNSHIP:
☐ 0-MECKLENBURG ☐ 4-PINEVILLE
☐ 1-CHARLOTTE ☐ 5-MATTHEWS
☐ 2-DAVIDSON ☑ 6-HUNTERSVILLE
☐ 3-CORNELIUS ☐ 7-MINT HILL

BUILDING INFORMATION:
TYPE OF BUILDING:
☐ SINGLE MOBILE HOME (S) ☐ MODULAR HOME (M)
☐ DOUBLE WIDE (D) ☐ MULTIPLE FAMILY (U)
☑ HOUSE (H) ☐ OTHER
HEATED SQUARE FOOTAGE: ~5000
NUMBER OF BEDROOMS: 4
NUMBER OF OCCUPANTS: 8

FOUNDATION FOR RESIDENCE:
☐ CONCRETE SLAB ☐ BASEMENT WITH PLUMBING
☑ CRAWLSPACE ☐ BASEMENT WITH NO PLUMBING

IF PLANNING TO EXPAND/ALTER THE EXISTING SYSTEM INDICATE THE FOLLOWING CHANGES:
NUMBER OF BEDROOMS TO BE ADDED: NUMBER OF ADDITIONAL OCCUPANTS IN THE RESIDENCE:
WILL THERE BE A HOME BUSINESS IN THE RESIDENCE? ☐ YES ☐ NO TYPE:

WATER SUPPLY:
☑ MUNICIPAL (M) ☐ PUBLIC (C) ☐ PRIVATE WELL (P) ☐ SHARED WELL (S) ☐ OTHER 'SPRINGS' (O)

PROPOSED USE OF WELL: ☐ N/A ☐ IRRIGATION ☐ POTABLE ☐ GEOTHERMAL ☐ OTHER

ARE ANY OF THE FOLLOWING LOCATED ON THE PROPERTY? IF SO, PLEASE SHOW LOCATION ON SITE PLAN/PLAT.

BURIED CABLES, LANDFILLS, STUMPHOLES	☐ YES	☑ NO	WELLS, SPRINGS, OR WATER LINES	☐ YES	☑ NO
EXISTING WASTEWATER SYSTEMS	☐ YES	☑ NO	DESIGNATED WETLANDS	☐ YES	☑ NO
EASEMENTS OR RIGHT-OF-WAYS	☐ YES	☑ NO	GRADING/SOIL REMOVAL PERFORMED	☐ YES	☑ NO

PROPERTY OWNER:
NAME: Faison - Sample Road, LLC
ADDRESS: 121 W. Trade St., 27th Floor
CITY: Charlotte
STATE: NC ZIP: 28202-5399
HOME PHONE: WORK PHONE: 704 972 2674
MOBILE PHONE: FAX: 972 2676

LEGAL AGENT FOR PROPERTY OWNER, IF APPLICABLE:
NAME: SITE Tony Jacobs
ADDRESS: 385 Timber Rd
CITY: Mooresville
STATE: NC ZIP: 28115-7899
HOME PHONE: WORK PHONE: 704-662-8625
MOBILE PHONE: 704 582-9219 FAX: 662-8735

WHAT DATE WAS THE PROPERTY ORIGINALLY DEEDED AND RECORDED? 2006
WHAT IS THE ANTICIPATED CLOSING DATE FOR THIS PROPERTY? 2006

*An Improvement Permit is subject to suspension or revocation if site plans or the intended use change or if information submitted in this application is falsified or changed. The undersigned, owner, or legal agent for the owner, of the property described above as the "Job Location" has read the foregoing application, acknowledges that the contents of same are true, and authorizes the Mecklenburg County Health Department to enter onto the property for the purpose of processing this request.

Tony C Jacobs, LSS 9/7/06
Owner's/Agent's Signature Date

NORTH CAROLINA DEPARTMENT OF
ENVIRONMENT & NATURAL RESOURCES DIVISION
OF ENVIRONMENTAL HEALTH ON-SITE
WASTEWATER SECTION

*A Well Permit is subject to suspension or revocation if site plans or the intended use change or if information submitted in this application is falsified or changed. The undersigned, owner, or legal agent for the owner, of the property described above as the "Job Location" has read the foregoing application, acknowledges that the contents of same are true, and authorizes the Mecklenburg County Health Department to enter onto the property for the purpose of processing this request.

Owner's/Agent's Signature Date

MECKLENBURG COUNTY HEALTH DEPARTMENT
GROUNDWATER & WASTEWATER SERVICES
700 N. TRYON ST., SUITE 211
CHARLOTTE, NC 28202 704-336-5103 / FAX: 704-336-6894

Mecklenburg County Groundwater & Wastewater Services
700 N. Tryon St, Suite 211 Charlotte, NC 28202
Phone: (704) 336-5103 Fax: (704) 336-6894

NC DENR
Division of Environmental Health
On-Site Wastewater Section

IMPROVEMENT PERMIT for a RESIDENTIAL ON-SITE WASTEWATER TREATMENT & DISPOSAL SYSTEM

Permit #: **30001358** GWS File #: **6747B** Tax Parcel #: **023-201-02**

- This IMPROVEMENT PERMIT is subject to revocation if site plans or the intended use change. There is to be **NO** grading, filling, or disturbance of the soil in the area of the septic tank system or repair area.
- CONSTRUCTION AUTHORIZATION must be obtained prior to receiving a Building Permit. The Construction Authorization is **NOT** transferable. Do not clear, grade, fill or disturb soil prior to obtaining a Construction Authorization.
- Domestic-type wastewater only. No industrial process wastewater may be discharged into the system.

I. This Improvement Permit Shall: Expire in Five (5) Years **Expiration Date (If Applicable):** 4/24/2012

Type of Installation: Residential - New System Lot Number: 9

Structure Type: HOUSE Size (ft^2): 5000 # Bedrooms: 4 # Occupants: 8

Building Foundation: Crawl Space Water Supply: Municipal

II. Initial System Type: PPBPS (pressurized) **System Classification:** IVa

Initial System Specifications:

Design Flow (gpd):	480	LTAR (gpd/ft^2):	0.3	Septic Tank Size (gal):	1500	Pump Tank Size (gal):	1500
Trench Width (ft):	3	Trench Spacing (ft):	9	Absorption Area (ft^2):	801	Total Trench Length (ft):	267
Maximum Trench Depth (in):	30	Depth of Media (in):	N/A	Distribution Device:	Manifold (LPP Distri		

III. Repair System Type: PPBPS (pressurized) **System Classification:** IVa

Repair System Specifications:

Design Flow (gpd):	480	LTAR (gpd/ft^2):	0.3	Septic Tank Size (gal):	1500	Pump Tank Size (gal):	1500
Trench Width (ft):	3	Trench Spacing (ft):	9	Absorption Area (ft^2):	800	Total Trench Length (ft):	267
Maximum Trench Depth (in):	30	Depth of Media (in):	N/A	Distribution Device:	Manifold (LPP Distri		

IV. Permit Conditions/Comments:

(Please See the Following Page for Permit Conditions.)

The undersigned, an authorized agent of the MECKLENBURG COUNTY HEALTH DEPARTMENT, certifies that the Department is issuing an IMPROVEMENT PERMIT for the above referenced property. This permit is being issued in accordance with the *Laws and Rules For Sewage Treatment, and Disposal Systems* and is subject to the following provisions:

- No work shall be conducted on the septic system until an INSTALLATION APPROVAL is granted by the Department.
- The septic system installer shall be a registered septic contractor with Mecklenburg County Health Department.
- The permitted system shall be installed in accordance with the included PLOT PLAN.
- This IMPROVEMENT PERMIT is transferable.

DENR Authorized Agent: Jeremy Michelone

Signature: Jeremy Michelone

Date Issued: 4/24/2007

Owner/Legal Agent: Jacob Presley
Print Name

Signature: Jacob Presley

Mecklenburg County Groundwater & Wastewater Services
700 N. Tryon St, Suite 211 Charlotte, NC 28202
Phone: (704) 336-5103 Fax: (704) 336-6894

NC DENR
Division of Environmental Health
On-Site Wastewater Section

IMPROVEMENT PERMIT for a RESIDENTIAL ON-SITE WASTEWATER TREATMENT & DISPOSAL SYSTEM

Permit #: **30001358** GWS File #: **6747B**

IV. Permit Conditions/Comments:

- This type of septic system requires an inspection once every 3 years by our office. The system owner is responsible for any fees, as determined by the Mecklenburg County Board of Commissioners, associated with this inspection.
- This type of septic system requires a Certified Operator to maintain the system. A system maintenance contract with a Certified Operator must be on file prior to issuance of an Operation Permit.

The undersigned, an authorized agent of the MECKLENBURG COUNTY HEALTH DEPARTMENT, certifies that the Department is issuing an IMPROVEMENT PERMIT for the above referenced property. This permit is being issued in accordance with the *Laws and Rules For Sewage Treatment and Disposal Systems* and is subject to the following provisions:

- No work shall be conducted on the septic system until an INSTALLATION APPROVAL is granted by the Department.
- The septic system installer shall be a registered septic contractor with Mecklenburg County Health Department.
- The permitted system shall be installed in accordance with the included PLOT PLAN.
- This IMPROVEMENT PERMIT is transferable.

DENR Authorized Agent: Jeremy Michelone

Signature: Jeremy Michelone, R.S.

Date Issued: 4/24/2007

Owner/Legal Agent: Jacob Presley
Print Name

Signature: Jacob Presley

S&ME

GWS Septic System Design Review

	Approved	Disapproved
GWS File #: 6747 B		
Design Review: TCT 3-21-07	☒	☐
Field Review:	☒	☐

*Projects are not considered "APPROVED" until both sections above are completed and indicate an APPROVED status.

Date: March 12, 2007

To: Mr. Jeremy Michelone, R.S.
Mecklenburg County Env. Health Dept.

From: Jacob B. Presley, LSS
Toney C. Jacobs, LSS

RE: Request for an Improvement Permit for Lot 9 off of Sample Road.
MCHD File #6747B

FCD Development , LLC, is requesting an Improvement Permit for the above referenced lot. Mr. Christopher Sherrill has evaluated the soils (see attached MCHD soil sheets) and S&ME, Inc. has flagged the system and repair on the lot. The septic lines have been located by S&ME and are shown on the attached maps. The attached sketch and specifications are not an Improvement Permit and are intended only to assist the MCHD in permitting the referenced lot off of Sample Rd.

We understand that a building permit cannot be issued until your office issues an Authorization to Construct (ATC). The buyer will apply for the ATC. If the buyer's house pad does not fit in the "building envelope" shown on the Improvement Permit, we understand that the proposed system may have to be modified prior to your office issuing the ATC. **No grading shall take place on the lot prior to obtaining the ATC from the MCHD.**

Please review the attached system sketch and design specifications for the Improvement Permit. Any additions or revisions you feel are necessary can be made on the Improvement Permit. Please call if you have questions or comments.


Design Specifications for Lot 9 off of Sample Rd.
MCHD File # 6747B

√TCT 3-21-07

Daily Design Flow:	480 gpd
Number Bedrooms:	4 bdr.
Basement or Crawlspace:	Crawl Space
Septic Tank Size:	1500 gal
Pump Tank Size:	1500 gal
Primary System Loading Rate:	**0.3 gpd/ft^2**
Primary System:	**LP PPBPS**
Number and length of laterals:	1 line @ 120 ft. centerfed 1 line @ 86 ft. centerfed 1 line @ 61 ft. endfed
Total ft. of primary system:	267 ft. (267' required)
Number of T&J Panels:	1 line @ 120 ft., 27 panels 1 line @ 86 ft., 19 panels 1 line @ 61 ft., 14 panels Total of 60 panels
Flow Rate through system:	30 gpm – use 5/32 in. holes with 3 ft. head pressure
Pump Requirements:	to be calculated by installer when specific house and pump tank locations are available
Dosing Volume:	approx. 216 gal. – (3.6 gal per panel)* 2.2 doses/day
Depth of effluent pumped per dose:	calculated to specific tank by measure or dealer engineering specifications (1 cubic ft. of water equals 7.48 gal.)
Check Valve:	yes
Siphon break hole:	yes

Repair System Loading Rate:	0.3 gpd/ft^2
Repair System:	LP PPBPS
Total ft. of repair	267 ft. (267' required)

Notes: Before placement of cap block, one panel on each line, near the center of the field should be observed filling to make certain that it does not overflow the top chamber into the air chambers. If overflow occurs, reduce floats by 25 gallons and reset until no overflow is observed.

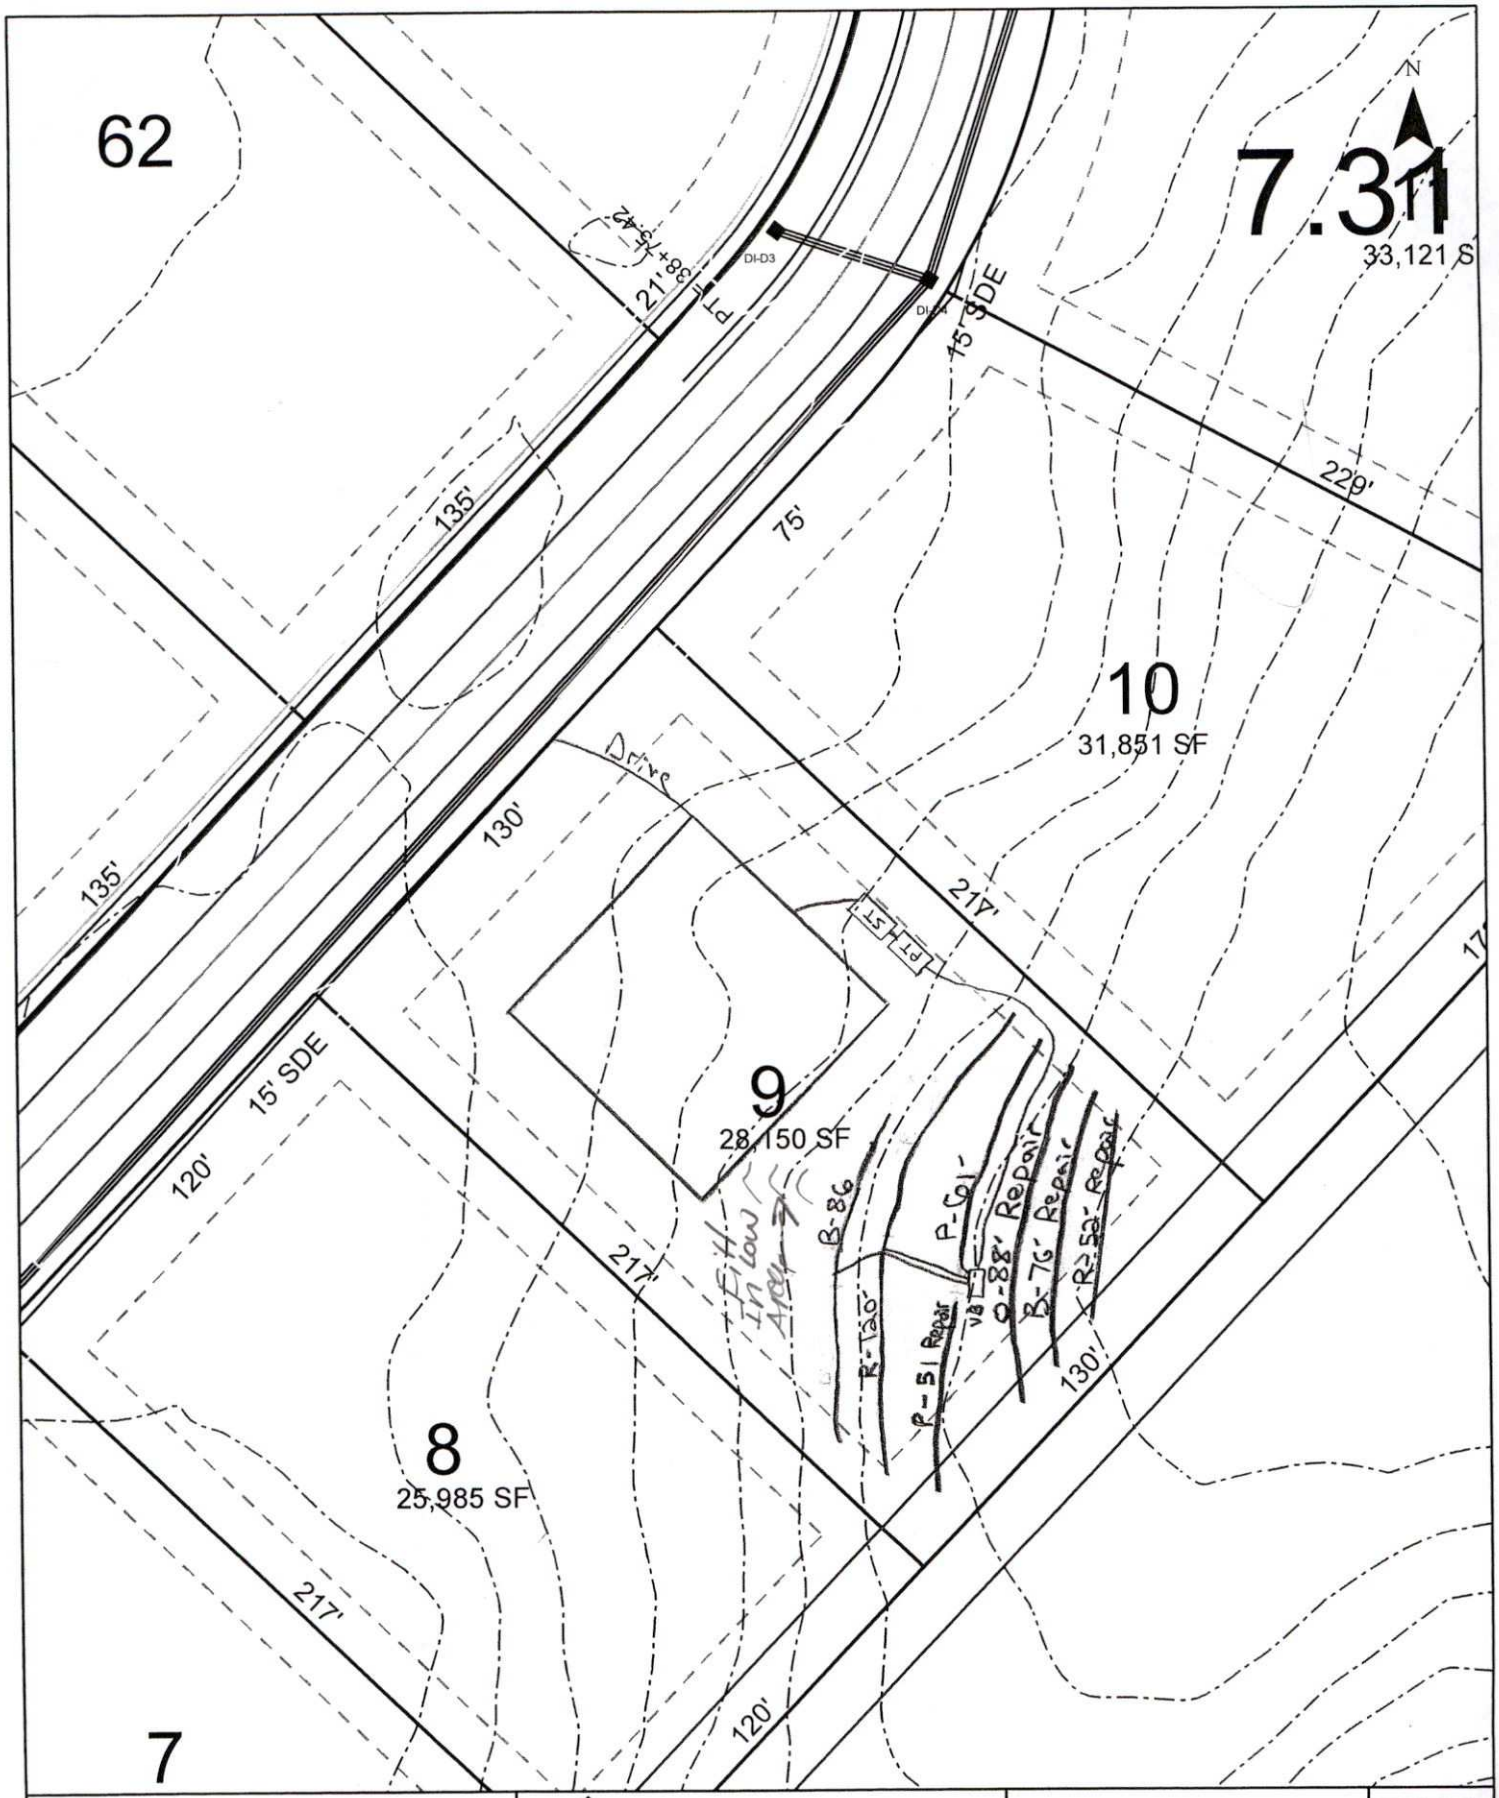

Scale: 1 inch equals 50 feet	S&ME	Faison-Sample Road, LLC	FIGURE
Drawn by: JBP		Lot 9	1
Reviewed by: Jeremy P. Michelone, RS		Mecklenburg County, NC	
Date: February, 2007	ENVIRONMENTAL SERVICES · ENGINEERING · TESTING	S&ME Project #1588-05-091	

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: PO 023-201-02
Lot #: 9
File #: 6747B
Code: 2

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Owner: Faison-Sample Road, LLC
Applicant: Toney Jacobs
Address: 121 W. Trade St., 27th Floor, Charlotte, NC 28202-5399
Date Evaluated: 1/3/2007
Proposed Facility: Residence
Design Flow (.1949): 480 gpd
Property Size:
Location of Site: Sample Road
Property Recorded:
Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [x] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941		OTHER PROFILE FACTORS				Profile Class & LTAR
			.1941 Structure/ Texture	.1941 Consistence Mineralogy	.1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	
1	LS,8	0-13	GR/CL	FR/SS/SP/SEXP	>48" TO SOIL WETNESS	48	NA	NONE	PS,IV
		13-48	SBK/C	FI/S/P/SEXP					.3 GPD/FT^2
2	"	0-6	GR/CL	FR/SS/SP/SEXP	"	"	"	"	"
		6-42	SBK/C	FI/S/P/SEXP					
		42-48	SBK/CL	FR/S/P/SEXP					
3	LS,12	0-15	GR/CL	FR/SS/SP/SEXP	"	"	"	"	"
		15-48	SBK/C	FI/S/P/SEXP					
4	"	0-2	GR/CL	FR/SS/SP/SEXP	"	"	"	"	"
		2-48	SBK/C	FI/S/P/SEXP					

Description	Initial System	Repair System
Available Space (.1945)	PS	US
System Type(s)		
Site LTAR	.3 GPD/FT^2	.3 GPD/FT^2

Other Factors (.1946):
Site Classification (.1948): Unsuitable
Evaluated By: Chris Sherrill, RS, LSS 1/3/07
Others Present: None


Christopher M Sherrill

COMMENTS: 100% Repair Area Required

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Food Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace		CL-Clay Loam		
FP-Flood Plain		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

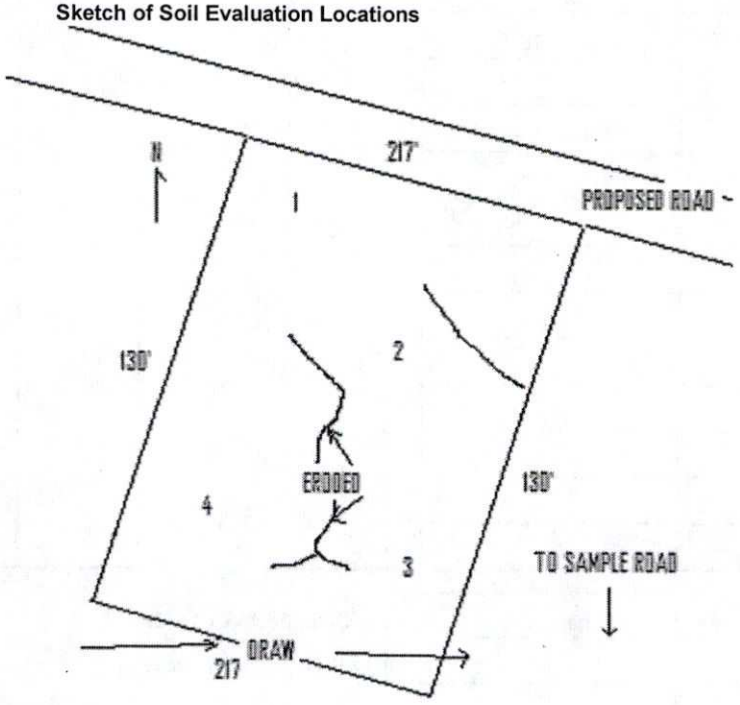

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: PO 023-201-02
Lot #: 9
File #: 6747B
Code: 2

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Owner: Faison-Sample Road, LLC
Applicant: Toney Jacobs
Address: 121 W. Trade St., 27th Floor, Charlotte, NC 28202-5399
Date Evaluated: 1/3/07
Proposed Facility: Residence
Design Flow (.1949): 480 gpd
Property Size:
Location of Site: Sample Road
Property Recorded:
Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [x] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941		OTHER PROFILE FACTORS				Profile Class & LTAR
			.1941 Structure/ Texture	.1941 Consistence Mineralogy	.1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	
1	LS,8	0-13	GR/CL	FR/SS/SP/SEXP	>48" TO SOIL WETNESS	48	NA	NONE	PS,IV
		13-48	SBK/C	FI/S/P/SEXP					.3 GPD/FT^2
2	"	0-6	GR/CL	FR/SS/SP/SEXP	"	"	"	"	"
		6-42	SBK/C	FI/S/P/SEXP					
		42-48	SBK/CL	FR/S/P/SEXP					
3	LS,12	0-15	GR/CL	FR/SS/SP/SEXP	"	"	"	"	"
		15-48	SBK/C	FI/S/P/SEXP					
4	"	0-2	GR/CL	FR/SS/SP/SEXP	"	"	"	"	"
		2-48	SBK/C	FI/S/P/SEXP					

Description	Initial System	Repair System
Available Space (.1945)	PS	PS
System Type(s)	Iva	Iva
Site LTAR	.3 GPD/FT^2	.3 GPD/FT^2


Other Factors (.1946):
Site Classification (.1948): PS
Evaluated By: Chris Sherrill, RS, LSS 1/3/07
Others Present: None

COMMENTS: 100% Repair Area Required

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Food Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace				
FP-Flood Plain		CL-Clay Loam		
		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

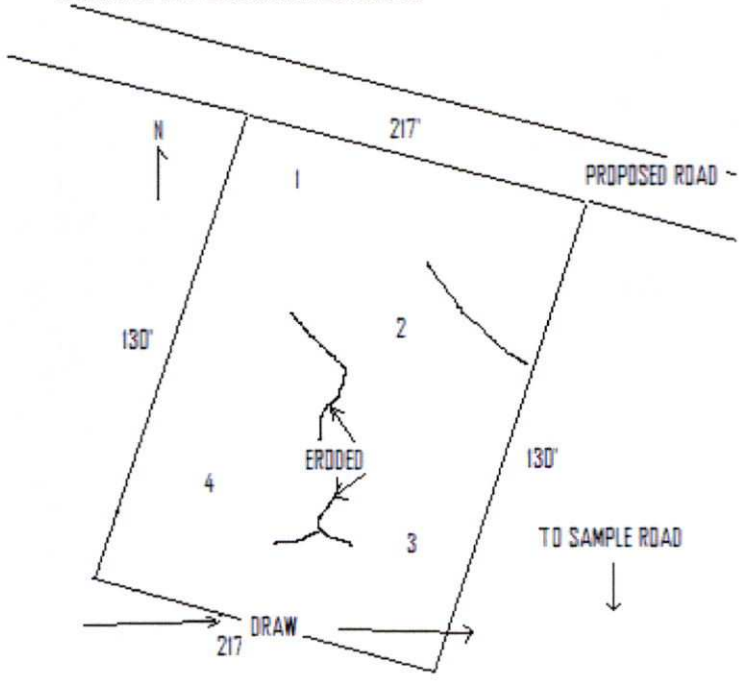

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 2
Property ID: PO 023-201-02
Lot #: 9
File #: 6747B
Code: 2

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Owner: Faison-Sample Road, LLC
Applicant: Toney Jacobs
Address: 121 W. Trade St., 27th Floor, Charlotte, NC 28202-5399
Date Evaluated: 1/3/2007
Proposed Facility: Residence
Design Flow (.1949): 480 gpd
Property Size:
Location of Site: Sample Road
Property Recorded:
Water Supply: [x] Public [ ] Individual [ ] Well [ ] Spring [ ] Other
Evaluation Method: [x] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [x] Sewage [ ] Industrial Process [ ] Mixed

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941		OTHER PROFILE FACTORS				Profile Class & LTAR
			.1941 Structure/ Texture	.1941 Consistence Mineralogy	.1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	
1	LS,8	0-13	GR/CL	FR/SS/SP/SEXP	>48" TO SOIL WETNESS	48	NA	NONE	PS,IV
		13-48	SBK/C	FI/S/P/SEXP					.3 GPD/FT^2
2	"	0-6	GR/CL	FR/SS/SP/SEXP	"	"	"	"	"
		6-42	SBK/C	FI/S/P/SEXP					
		42-48	SBK/CL	FR/S/P/SEXP					
3	LS,12	0-15	GR/CL	FR/SS/SP/SEXP	"	"	"	"	"
		15-48	SBK/C	FI/S/P/SEXP					
4	"	0-2	GR/CL	FR/SS/SP/SEXP	"	"	"	"	"
		2-48	SBK/C	FI/S/P/SEXP					

Description	Initial System	Repair System
Available Space (.1945)	PS	US
System Type(s)		
Site LTAR	.3 GPD/FT^2	.3 GPD/FT^2

Other Factors (.1946):
Site Classification (.1948): Unsuitable
Evaluated By: Chris Sherrill, RS, LSS 1/3/07
Others Present: None

COMMENTS: 100% Repair Area Required

Landscape Position	Group	Texture	.1955 LTAR	Structure
R-Ridge	I	S-Sand	1.2 - 0.8	SG-Single Grain
SS-Shoulder Slope		LS-Loamy Sand		M-Massive
LS-Linear Slope				CR-Crumb
FS-Food Slope	II	SL-Sandy Loam	0.8 - 0.6	GR-Granular
NS-Nose Slope		L-Loam		SBK-Subangular Blocky
HS-Head Slope				ABK-Angular Blocky
CC-Concave Slope	III	SI-Silt	0.6 - 0.3	PL-Platy
CV-Convex Slope		SICL-Silty Clay Loam		PR-Prismatic
T-Terrace				
FP-Flood Plain		CL-Clay Loam		
		SCL-Sandy Clay Loam		
	IV	SC-Sandy Clay	0.4 - 0.1	
		SIC-Silty Clay		
		C-Clay		

Consistence Moist	Consistence Wet	Mineralogy
VFR-Very Friable	NS-Non-Sticky	SEXP-Slightly Expansive
FR-Friable	SS-Slightly Sticky	EXP-Expansive
FI-Firm	S-Sticky	
VFI-Very Firm	VS-Very Sticky	
EFI-Extremely Firm	NP-Non-Plastic	
	SP-Slightly Plastic	
	P-Plastic	
	VP-Very Plastic	

Sketch of Soil Evaluation Locations

