Groundwater & Wastewater Services
Septic Project File & Data Review Worksheet

GWS File #: 9937B WASPS App #: 13091

Primary ES assigned to project: B. Shelton

Secondary ES assigned to project:

Project Type: New System ☐ Alteration ☐ Repair ☒ Modified Plot Plan ☐

I. File Review:

Rule or Law	Permit Application			
.1937(d)	Is the Application complete	Yes ☐	No ☐	N/A ☐
.1937(d)	Is there a Site plan/Plat with application	Yes ☐	No ☐	N/A ☐
.1937(d)	Is the Facility shown?	Yes ☐	No ☐	N/A ☐
.1937(d)	Are appurtenances shown	Yes ☐	No ☐	N/A ☐
	Site Evaluation Information			
.1939 (a)(1)	Topography and Landscape Position Recorded?	Yes ☐	No ☐	N/A ☐
.1940 (a-g)	Slope % Recorded?	Yes ☐	No ☐	N/A ☐
.1939 (a)(2)	Texture Class Recorded?	Yes ☐	No ☐	N/A ☐
.1939 (a)(2)	Structure type Recorded?	Yes ☐	No ☐	N/A ☐
.1939 (a)(2)	Consistence Recorded?	Yes ☐	No ☐	N/A ☐
.1939 (a)(2)	Mineralogy Recorded?	Yes ☐	No ☐	N/A ☐
.1939 (a)(3)	Soil Wetness Condition Recorded?	Yes ☐	No ☐	N/A ☐
.1939 (a)(4)	Soil Depth to Rock or Parent Material Recorded When Encountered	Yes ☐	No ☐	N/A ☐
.1939 (a)(5)	Depth to Restrictive Horizons Recorded When Encountered?	Yes ☐	No ☐	N/A ☐
.1939 (a)(6)	Sufficient Available Space Recorded?	Yes ☐	No ☐	N/A ☐
.1937(m)	Are the Profile Locations Shown?			
.1939(a)	Are the S/PS Profiles in system & in repair area?	Yes ☐	No ☐	N/A ☐
& .1945(b)	Number of auger borings made: 1 Were sufficient auger borings made?	Yes ☐	No ☐	N/A ☐
.1939(d), .1955, .1956, .1957	LTAR Repair B.P.J. used.	Yes ☐	No ☐	N/A ☐
	Improvement Permit/Construction Authorization			
.1937(g) 130A-336(a)	Proposed System Type stated-Initial	Yes ☐	No ☐	N/A ☐
.1945(b)	Proposed System Type stated-Repair	Yes ☐	No ☐	N/A ☐
130A-336 (a)(3)	System location identifiable by setbacks - Initial	Yes ☐	No ☐	N/A ☐
.1937(g) .1945(b)	System components shown – Initial	Yes ☐	No ☐	N/A ☐
.1945(b)	Repair area shown	Yes ☐	No ☐	N/A ☐
.1937 (f)(g)	Does System design match facility, flow & WWcharacteristics?	Yes ☐	No ☐	N/A ☐
.1937 (f)(g)	Is System design consistent with soil/site conditions?	Yes ☐	No ☐	N/A ☐
.1937 (f)(g)	Is the System located in the approved area?	Yes ☐	No ☐	N/A ☐
130A-336(a)	Is the Design flow (gpd) indicated?	Yes ☐	No ☐	N/A ☐

9937B
#13091

22 APR '22 PM12:35

MECKLENBURG COUNTY
HEALTH DEPARTMENT

APPLICATION FOR A RESIDENTIAL SITE IMPROVEMENT PERMIT/ CONSTRUCTION AUTHORIZATION FOR AN ON-SITE WASTEWATER SYSTEM, NEW WELL INSTALLATION, OR REPAIR OF EXISTING WELL

1. SEPTIC / TYPE APPLICATION: ○ N/A ◉ NEW SYSTEM ○ ALTERATION ● REPAIR ○ MODIFIED PLOT PLAN

2. WELL / TYPE APPLICATION: ◉ N/A ○ NEW WELL ○ MAJOR REPAIR ○ ABANDONMENT

3. JOB LOCATION INFORMATION:

TAX PARCEL NUMBER: 137-281-07
STREET ADDRESS: 7408 Truelight Church Road
CITY: Mint Hill
STATE: NC ZIP: 28227
SUBDIVISION NAME: N/A
LOT #: _____ LOT SIZE (acres): .97
TOWNSHIP:

○ MECKLENBURG ○ CORNELIUS ○ HUNTERSVILLE
○ DAVIDSON ○ CHARLOTTE ○ PINEVILLE
○ MATTHEWS ◉ MINT HILL

4. BUILDING INFORMATION:

BUILDING TYPE:

○ SINGLE MOBILE HOME ○ MODULAR HOME
○ DOUBLE WIDE ○ MULTIPLE FAMILY
◉ HOUSE ○ OTHER _____

HEATED SQUARE FOOTAGE: 1800
NUMBER OF BEDROOMS: 2
NUMBER OF OCCUPANTS: 4

FOUNDATION TYPE:

○ CONCRETE SLAB ○ BASEMENT WITH PLUMBING
◉ CRAWL SPACE ○ BASEMENT WITH NO PLUMBING

5. IF PLANNING TO EXPAND OR ALTER THE EXISTING SEPTIC SYSTEM PLEASE COMPLETE THE FOLLOWING SECTION: ☐ N/A

NUMBER OF BEDROOMS TO BE ADDED: X NUMBER OF ADDITIONAL OCCUPANTS IN THE RESIDENCE: 0

6. WATER SUPPLY: ○ MUNICIPAL ◉ PRIVATE WELL ○ PUBLIC WELL ○ SHARED WELL ○ OTHER _____

7. PROPOSED USE OF WELL: ◉ N/A ○ IRRIGATION ○ POTABLE (DRINKING WATER) ○ OTHER _____

8. PLEASE INDICATE AND RANK DESIRED SEPTIC SYSTEM TYPE(S) IN ORDER OF PREFERENCE *(1-MOST DESIRED 5-LEAST DESIRED):*

☐ N/A ☑ ANY TYPE ☐ CONVENTIONAL ☐ ACCEPTED ☐ INNOVATIVE ☐ ALTERNATIVE ☐ OTHER _____

8A. RANK: ____ ____ ____ ____ ____

9. DO ANY OF THE FOLLOWING APPLY TO THE PROPERTY IN QUESTION? IF "YES" PLEASE ATTACH SUPPORTING DOCUMENTATION.

BURIED CABLES, LANDFILLS, STUMPHOLES	○ YES ◉ NO	GRADING/SOIL REMOVAL PERFORMED	○ YES ◉ NO
EXISTING WASTEWATER (SEPTIC) SYSTEMS	◉ YES ○ NO	JURISDICTIONAL WETLANDS	○ YES ◉ NO
WELLS, SPRINGS, OR WATER LINES	◉ YES ○ NO	APPROVAL REQUIRED BY ANY OTHER PUBLIC AGENCY	○ YES ◉ NO
EASEMENTS OR RIGHT-OF-WAYS	○ YES ◉ NO	WASTEWATER OTHER THAN DOMESTIC SEWAGE	○ YES ◉ NO
CHEMICAL/PETROLEUM STORAGE TANKS	○ YES ◉ NO	KNOWN UNDERGROUND CONTAMINATION	○ YES ◉ NO
WASTE STORAGE	○ YES ◉ NO	GROUNDWATER USE RESTRICTIONS/VARIANCES	○ YES ◉ NO

10. WHAT DATE WAS THE PROPERTY ORIGINALLY DEEDED AND RECORDED? _____ ☑ UNKNOWN

11. WHAT IS THE ANTICIPATED CLOSING DATE FOR THIS PROPERTY? _____ ☑ N/A

12. PROPERTY OWNER:

NAME: Brandy Santana
ADDRESS: 7408 Truelight Church Road
CITY: Mint Hill
STATE: NC ZIP: 28227
WORK PHONE: _____
MOBILE PHONE: 704-626-9309
FAX: _____
E-MAIL: Brandysantana11@gmail.com

13. OWNER'S LEGAL REPRESENTATIVE, IF APPLICABLE:

NAME: _____
ADDRESS: _____
CITY: _____
STATE: _____ ZIP: _____
WORK PHONE: _____
MOBILE PHONE: _____
FAX: _____
E-MAIL: _____

MECKLENBURG COUNTY – GROUNDWATER & WASTEWATER SERVICES
700 N. TRYON ST. SUITE 211 CHARLOTTE, NC 28202, OFFICE: 980-314-1680, FAX: 704-336-6894
Email: Wellreg@MecklenburgCountyNC.gov

Revised on: 4/20/17

14. SEPTIC SYSTEM PERMIT APPLICATION:

If the information in this application is falsified, changed, or the site is altered, then the Improvement Permit and Authorization to Construct shall become invalid. I have read this application and certify that the information provided herein is true, complete and correct. Authorized county and state officials are granted right of entry to conduct necessary inspections to determine compliance with applicable laws and rules. I understand that I am solely responsible for the proper identification and labeling of all property lines and corners and making the site accessible so that a complete site evaluation can be performed. The permit is valid for either sixty (60) months or is non-expiring depending upon the documentation submitted: complete site plan = 60 months, complete plat = non-expiring. BS (Initial here for septic system applications)

15. WELL PERMIT APPLICATION:

If the information in this application is falsified, changed, or the site is altered, then the Well Permit shall become invalid. I have read this application and certify that the information provided herein is true, complete and correct. Authorized county and state officials are granted right of entry to conduct necessary inspections to determine compliance with applicable laws and rules. I understand that I am solely responsible for the proper identification and labeling of all property lines and corners and making the site accessible so that a complete site evaluation can be performed. The permit is valid for a period of twelve (12) months from the date of issuance.

_____ (Initial here for well applications)

16. APPLICATION SIGNATURE SECTION:

ONLY COMPLETE APPLICATIONS WILL BE PROCESSED. A proper signature is required in order to process your application. Please review the application carefully and sign in the space provided below. A PROPOSED PLOT PLAN is required to be submitted with each application.

Brandy South
Property Owner's or Owner's Legal Representative Signature

4/20/22
Date

OFFICE USE ONLY

○ SURVEY PLAT TO SCALE SUBMITTED ○ SCALED SITE PLAN SUBMITTED ○ UN-SCALED SITE PLAN SUBMITTED

SEPTIC APPLICATION FEE RECEIVED: $ _____ DATE FEE RECEIVED: _____

WELL APPLICATION FEE RECEIVED: $ _____ DATE FEE RECEIVED: _____

APPLICATION PROCESSED BY: _____

GWS FILE NUMBER ASSIGNED: _____

APPLICATION ID NUMBER ASSIGNED: _____

COMMENTS:

_____

_____

_____

_____

_____

_____

_____

_____

_____

_____

MECKLENBURG COUNTY – GROUNDWATER & WASTEWATER SERVICES
700 N. TRYON ST. SUITE 211 CHARLOTTE, NC 28202, OFFICE: 980-314-1680, FAX: 704-336-6894
Email: Wellreg@MecklenburgCountyNC.gov

File #: _____


PROPOSED PLOT PLAN

A drawing showing the locations of the following items is required: existing and proposed property lines with dimensions, easements or right-of-ways, proposed building pad(s) or existing building footprint(s), all appurtenances (garage, driveway, deck, pool, etc.), location of existing or proposed well(s), location of existing or proposed sewer lines and sewage disposal systems, surface water bodies, and any aboveground or underground storage tanks. Provide names for all roads that adjoin the property.

Street Address: 7408 Truelight Church Rd Tax Parcel #: 137-281-07

Subdivision Name: _____ Lot #: _____

See Survey - Some Septic area

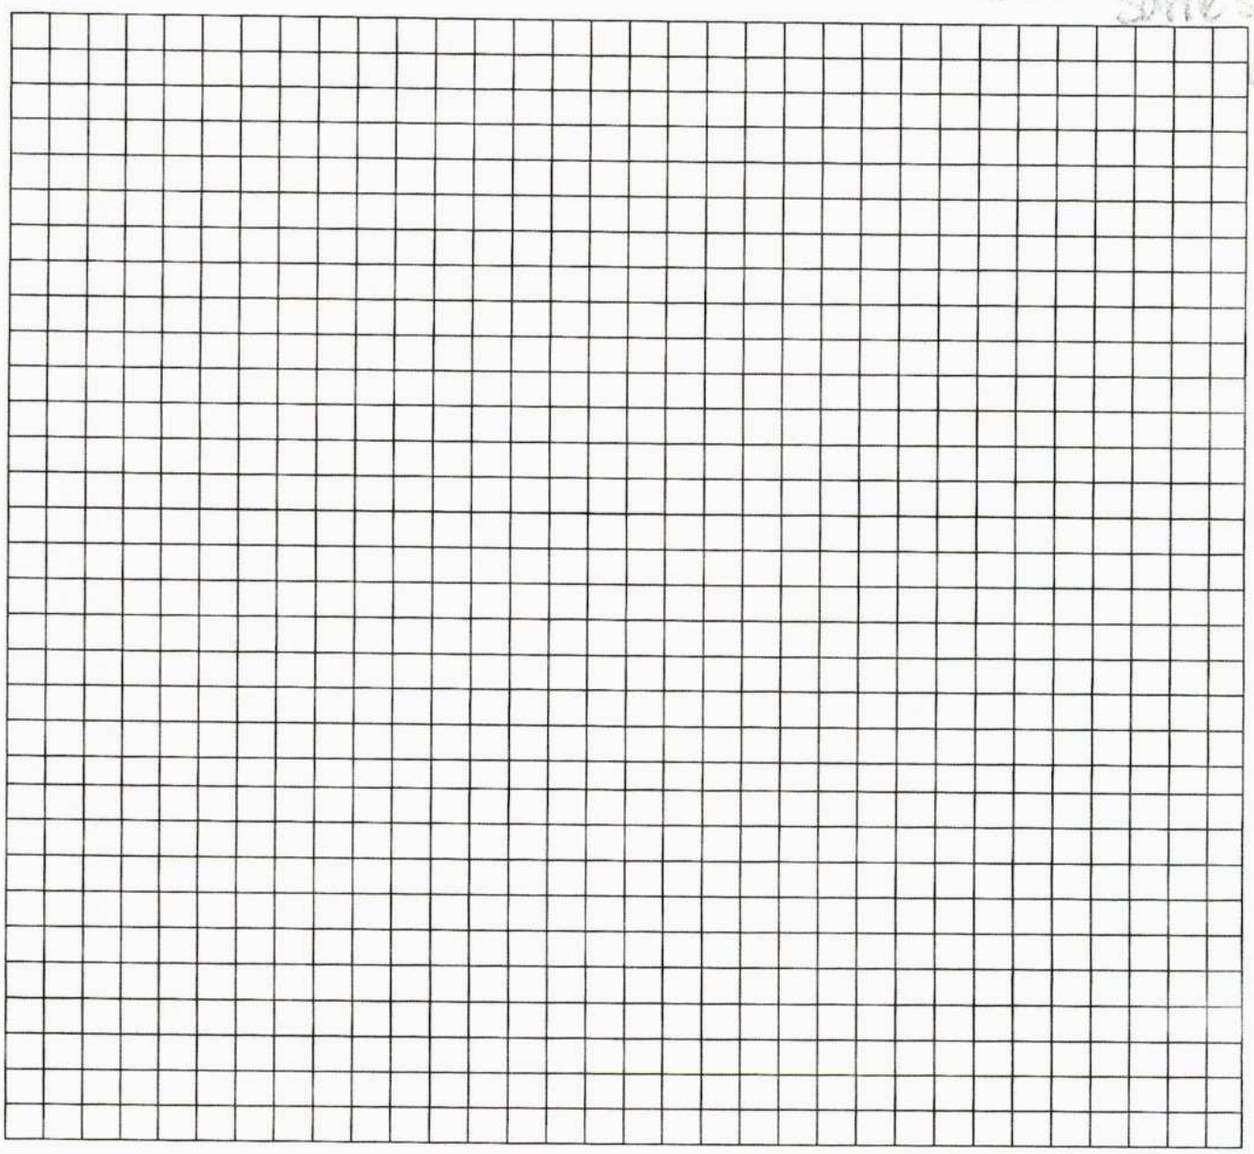

_____ _____

Property Owner's or Owner's Legal Representative Signature Date

MECKLENBURG COUNTY – GROUNDWATER & WASTEWATER SERVICES
700 N. TRYON ST. SUITE 211 CHARLOTTE, NC 28202, OFFICE: 980-314-1680, FAX: 704-336-6894
Email: Wellreg@MecklenburgCountyNC.gov

Revised on: 4/20/17

I CERTIFY THAT THIS MAP WAS DRAWN UNDER MY SUPERVISION FROM AN ACTUAL SURVEY MADE UNDER MY SUPERVISION (MAP RECORDED IN BOOK 8, PAGE 125; THAT THE BOUNDARIES NOT SURVEYED ARE INDICATED AS DRAWN FROM INFORMATION AS SHOWN ON PLAT; THAT THE RATIO OF PRECISION OR POSITIONAL ACCURACY IS 1:10,000+; AND THAT THIS MAP MEETS THE REQUIREMENTS OF THE STANDARDS OF PRACTICE FOR LAND SURVEYING IN NORTH CAROLINA (21 NCAC 56. 1600). THIS 23rd DAY OF MAY, 2016.

SIGNED _____

JOHN D. SKIDMORE III, NCPLS L-3837




VICINITY MAP
(NOT TO SCALE)

NOTES:

- AREA BY COORDINATE METHOD
- THIS IS A SURVEY OF AN EXISTING PARCEL OR PARCELS OF LAND AND DOES NOT CREATE A NEW STREET OR CHANGE AN EXISTING STREET
- THIS MAP IS NOT INTENDED TO MEET G.S. 47-30 AND IS NOT TO BE RECORDED AS A PLAT
- SUBJECT PROPERTY MAY BE SUBJECT TO RECORDED OR UNRECORDED EASEMENTS, RIGHT OF WAYS, SETBACKS AND/OR RESTRICTIVE COVENANTS NOT SHOWN HEREON

NORTH CAROLINA PROFESSIONAL SEAL L-3837 LAND SURVEYOR JOHN D. SKIDMORE III

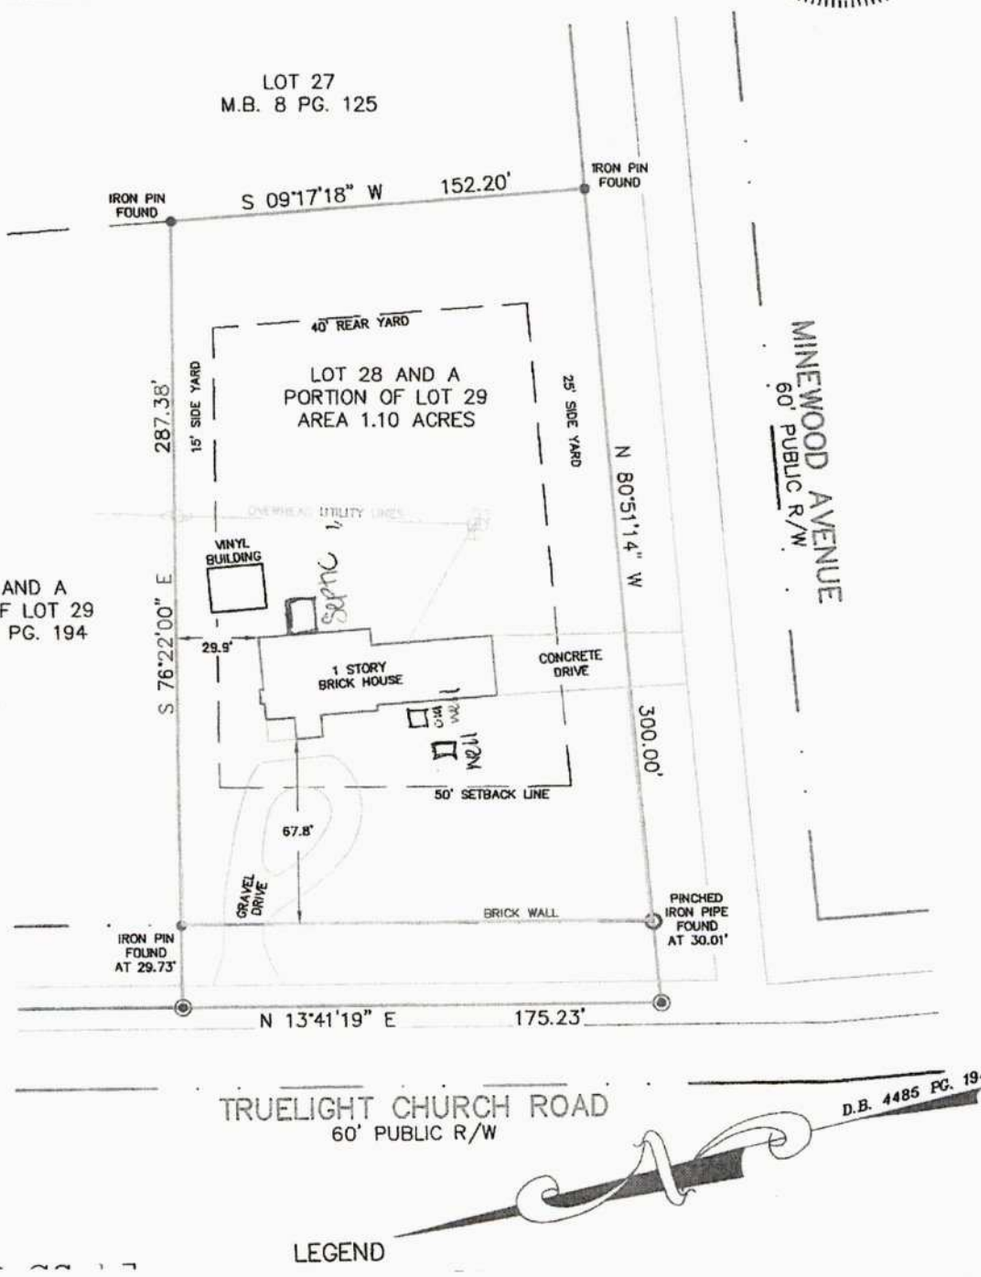

LEGEND

Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 of 3
Property ID: 137-281-07
Lot #:
File #: 9937B
AppID: 13091

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Property Owner: Brandy Santana
Address: 7400 Truelight Church rd
2 Bedroom house
Design Flow (.1949): 240 GPD
Location of Site: 7400 Truelight Church rd.
Water Supply: [ ] Public [X] Individual [X] Well
Evaluation Method: [x] Auger Boring [] Pit
Type of Wastewater: [X] Sewage [ ] Industrial Process

Applicant: owner
Date Evaluated: 6/16/22
Property Size: .97 Acre
Property Recorded:
[ ] Spring [ ] Municipal
[ ] Cut
[ ] Mixed

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 .1941 Structure/ Texture	.1941 Consistence Mineralogy	b PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	General Comments	Profile Class & LTAR	Maximum Trench Bottom Depth for 3' Wide Conventional Trench
Pit #1	L 2%	0-48"	sbk/abk C	SS SP FR SEXP		48"+	NA	NA		**PS IV**	**36"**

Description	Initial System	Repair System
Available Space (.1945)		
System Type(s)	Repair	
Site LTAR (gpd/sq ft)		

REPAIR, Drainfield is compromised.

Other Factors (.1946):
Soil Evaluation By: Braedon Shelton, REHS,
Others Present:
Site Classification (.1948): SS
Site Evaluation By: Braedon Shelton
Others Present:

Landscape Position
R-Ridge
SS-Shoulder Slope
LS-Linear Slope
FS-Foot Slope
NS-Nose Slope
HS-Head Slope
CC-Concave Slope
CV-Convex Slope
T-Terrace
FP-Flood Plain
D-Drainage Way

Group	Texture	.1955 LTAR
I	S-Sand LS-Loamy Sand	1.2 - 0.8
II	SL-Sandy Loam L-Loam	0.8 - 0.6
III	Si-Silt SiCL-Silty Clay Loam CL-Clay Loam SCL-Sandy Clay Loam SiL-Silt Loam	0.6 - 0.3
IV	SC-Sandy Clay SiC-Silty Clay C-Clay	0.4 - 0.1

Structure
sg-Single Grain
mass-Massive
cr-Crumb
gr-Granular
sbk-Subangular Blocky
abk-Angular Blocky
pl-Platy
pr-Prismatic
Sap-Saprolite

Structure Prefixes
w-weak
m-moderate
s-strong
f-fine
m-medium
c-coarse


Consistence
Moist
VFR-Very Friable
FR-Friable
FI-Firm
VFI-Very Firm
EFI-Extremely Firm

Consistence
Wet
SS-Slightly Sticky
S-Sticky
VS-Very Sticky
NP-Non-Plastic
SP-Slightly Plastic
P-Plastic
VP-Very Plastic

Mineralogy
SEXP-Slightly Expansive
EXP-Expansive

Classification
US-Unsuitable
PS-Provisionally Suitable
S-Suitable
NA-Not Applicable

Sketch of Soil Evaluation Locations

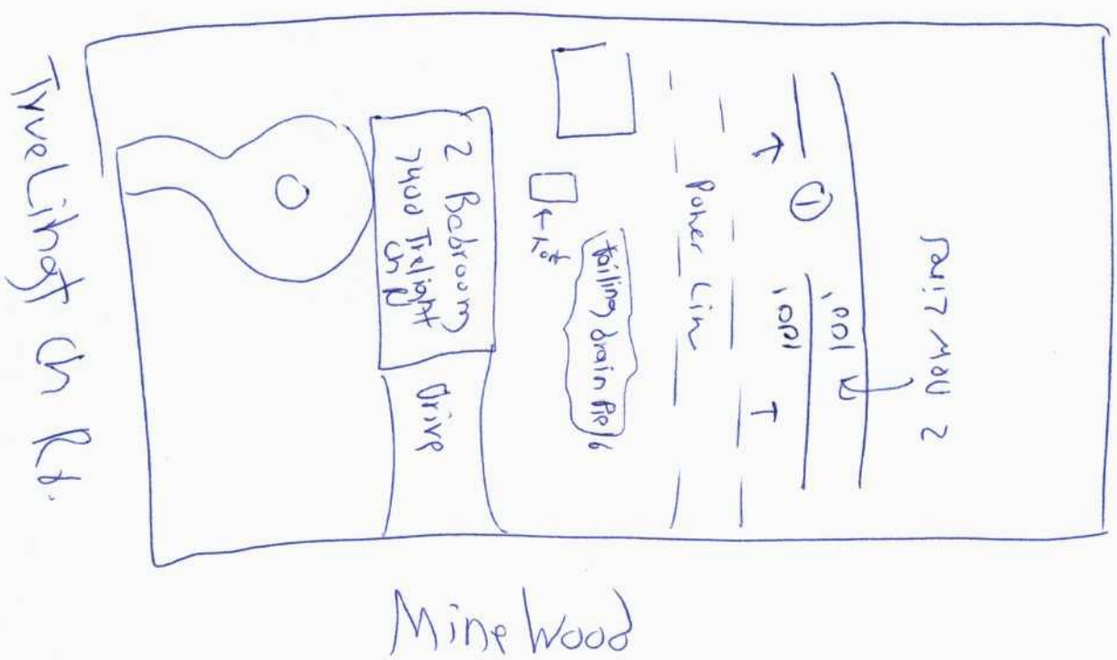

Mecklenburg County Groundwater & Wastewater Services
3205 Freedom Dr. Suite 8000 Charlotte, NC 28208
Phone: (980) 314-1680 Fax: (704) 336-6894

NC DHHS
Division of Environmental Health
On-Site Wastewater Section

IMPROVEMENT PERMIT/CONSTRUCTION AUTHORIZATION for REPAIRING an ON-SITE WASTEWATER TREATMENT & DISPOSAL SYSTEM

File #: 9937 B Permit #: 13091 Tax Parcel #: 137-281-07

Property Owner: Brandy Santana

Job Location Address: 7408 TrueLight Church Rd

City: Mint Hill State: NC Zip Code: 28227

Improvement Permit Issuance Date: 4/28/22 **Construction Authorization Issuance Date:** 4/28/22

Permission is hereby given to **repair** an on-site wastewater treatment & and disposal system, with subsurface soil absorption and effluent discharge, as specified herein at the described location. This approval is granted based upon the application information submitted to our office. All work shall be completed on or before _____. The system shall meet all of the construction requirements of 15A NCAC 18A. 1900 which are in effect on the date of granting this approval. An **Operation Permit** must be obtained from the Mecklenburg County Health Department before any system can be covered up or placed into service. The issuance of this permit does not in any way guarantee that the system anticipated to be constructed will operate properly, or relieve any person now of hereafter owning, controlling or using such system from any liability resulting from the failure of the system to operate properly.

Permitted Design Flow: Existing GPD Site LTAR: \ GPD/ft²

Liquid Capacity of Septic Tank: 1500 gallons Liquid Capacity of Dosing Tank: \ gallons

Drainfield Design ☐ N/A

Trench Depth: _____ inches

Trench Width: _____ feet

Line Spacing: _____ feet (O.C.)

Total line length: _____ feet

# of Lines: _____ @ _____ feet

Depth of Media: _____ inches (Type) _____

Distribution Device: _____

* Reconnect to existing drain field

Bed Design *(For Repair Installations ONLY.)* ☐ N/A

Bed Depth: _____ inches

Bed Width: _____ feet

Total line length: _____ feet

# of Lines: _____ @ _____ feet

Depth of Media: _____ inches (Type) _____

Distribution Device: _____

Water Supply Source

☐ Municipal ☒ Private Well ☐ Community Well

☐ Other _____


Minimum System Setbacks

Distance from Building Foundation: ≥5 feet

Distance from Property Line: ≥10 feet

Distance from Water Supply Source: ≥50 feet

SKETCH OF SYSTEM LAYOUT
(Proposed Layout)

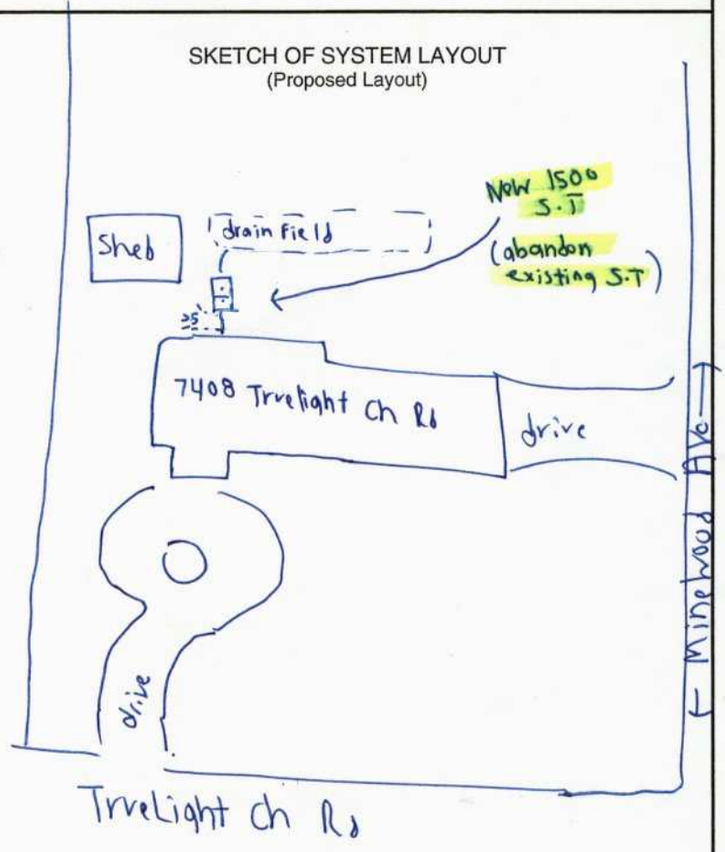


Comments: System Classification & Type: TANK only, Re-Connect to existing drain field

Authorized Agent: Braedon Shelton Signature: Braedon Shelton

Owner Signature: _____ Date: _____

⊕ TrueLight Ch N → 6/16/22

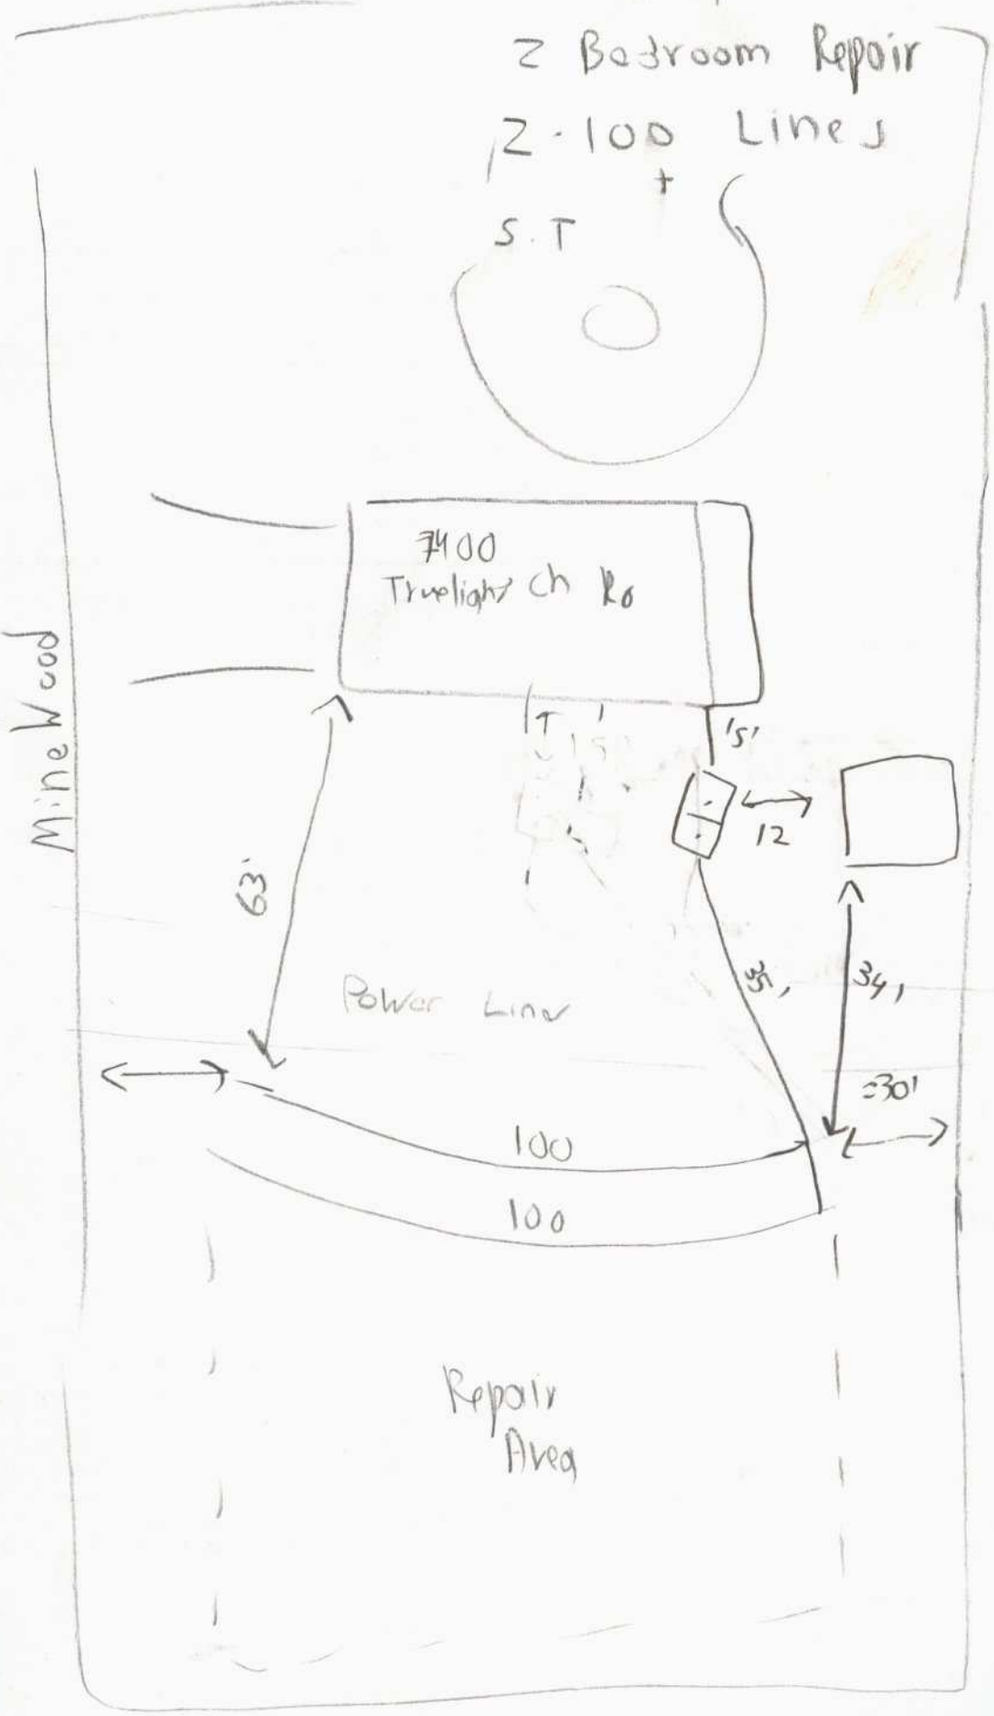

1500
Shoaf
Risers
5/9/22
100
Instaster
@ Rich-4

Mecklenburg County Groundwater & Wastewater Services
3205 Freedom Dr. Suite 8000 Charlotte, NC 28208
Phone: (980) 314-1680 Fax: (704) 336-6894

NC DHHS
Division of Environmental Health
On-Site Wastewater Section

IMPROVEMENT PERMIT/CONSTRUCTION AUTHORIZATION for REPAIRING an ON-SITE WASTEWATER TREATMENT & DISPOSAL SYSTEM

File #: 9937 B Permit #: 13091 Tax Parcel #: 137 281 07

Property Owner: Brandy Santana *Repair

Job Location Address: 7400 Trvelight Church Rd

City: Mint Hill State: NC Zip Code: 28227

Improvement Permit Issuance Date: 6/16/22 **Construction Authorization Issuance Date:** 6/16/22

Permission is hereby given to **repair** an on-site wastewater treatment & and disposal system, with subsurface soil absorption and effluent discharge, as specified herein at the described location. This approval is granted based upon the application information submitted to our office. All work shall be completed on or before _____. The system shall meet all of the construction requirements of 15A NCAC 18A. 1900 which are in effect on the date of granting this approval. An **Operation Permit** must be obtained from the Mecklenburg County Health Department before any system can be covered up or placed into service. The issuance of this permit does not in any way guarantee that the system anticipated to be constructed will operate properly, or relieve any person now of hereafter owning, controlling or using such system from any liability resulting from the failure of the system to operate properly.

Permitted Design Flow: 240 GPD Site LTAR: _____ GPD/ft²

Liquid Capacity of Septic Tank: 1500 gallons Liquid Capacity of Dosing Tank: _____ gallons

owner request

Drainfield Design ☐ N/A

Trench Depth: 24 inches

Trench Width: 3 feet

Line Spacing: 9 feet (O.C.)

Total line length: 200 feet

# of Lines: 2 @ 100 feet Accepted chambers

Depth of Media: 12 inches (Type) _____

Distribution Device: Serial

Bed Design *(For Repair Installations ONLY.)* ☒ N/A

Bed Depth: _____ inches

Bed Width: _____ feet

Total line length: _____ feet

# of Lines: _____ @ _____ feet

Depth of Media: _____ inches (Type) _____

Distribution Device: _____

Water Supply Source

☐ Municipal ☒ Private Well ☐ Community Well

☐ Other _____


Minimum System Setbacks

Distance from Building Foundation: ≥10 feet

Distance from Property Line: ≥10 feet

Distance from Water Supply Source: ≥50 feet

SKETCH OF SYSTEM LAYOUT
(Proposed Layout)

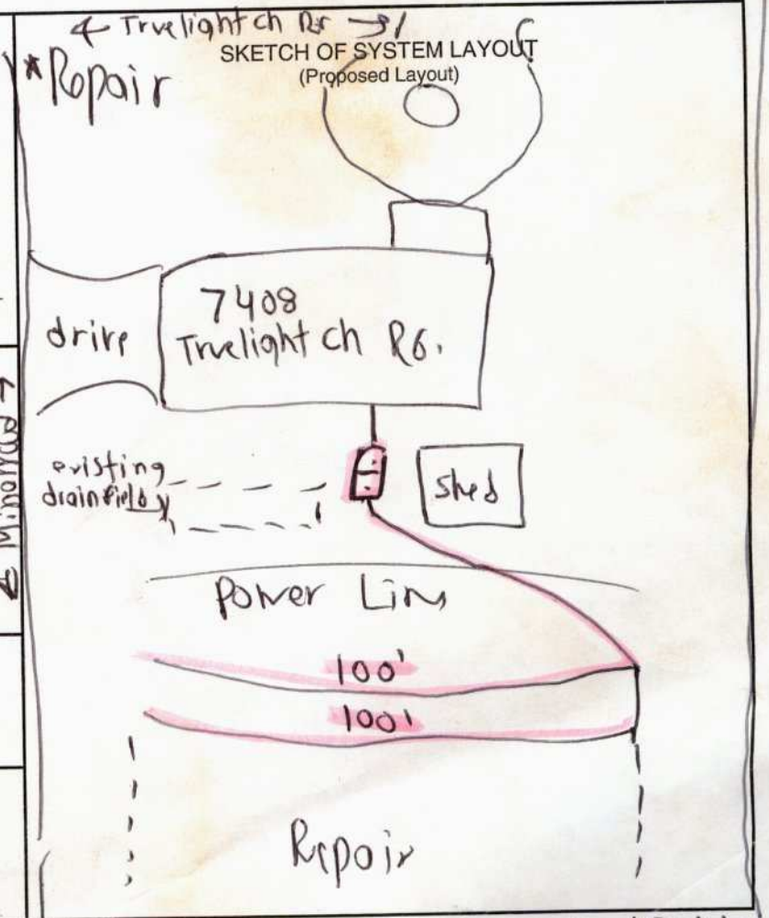

Comments: System Classification & Type: IIIg 25% Reduction Accepted system 2-100' Lines Existing drainfield is compromised. 2 Bedroom System

Authorized Agent: Braedon Shelton Signature: Braedon Shelton

Owner Signature: _____ Date: _____

Mecklenburg County Groundwater & Wastewater Services
3205 Freedom Dr. Suite 8000 Charlotte, NC 28208
Phone: (980) 314-1680 Fax: (704) 336-6894

Septic System Pre-Construction Meeting Checklist

File # 9937B App# 13091 Tax Parcel# 137-281-07

Property Owner: Brandy Santana

Job Location Address: 7400 TrueLight Church Rd

City: Mint Hill State: NC Zip Code: 28227

1. **Does System design match facility, flow & wastewater characteristics?**

   ☒ YES ☐ NO

   Comments:

2. **Is there sufficient available space for the septic systems initial and repair areas?**

   ☒ YES ☐ NO

   Comments:

3. **Can the septic system be installed per the permit conditions and drawing on file?**

   ☒ YES ☐ NO

   Comments: * Contractor observed drain field Compromised. Therefore new drainfield needed.

*If "NO" is checked for any of the above the existing permit may need to be revoked.

Permission is hereby given to ☒ install ☐ alter ☐ repair an on-site wastewater treatment & and disposal system, with subsurface soil absorption and effluent discharge meeting all of the construction requirements of 15A NCAC 18A .1900 which are in effect on the date of granting this approval. System shall not be installed while soils are in wet condition.

Braedon Shelton
Authorized Agent

6/16/22
Date

Others Present

Mecklenburg County Groundwater & Wastewater Services
3205 Freedom Dr. Suite 8000, Charlotte, NC 28208
Phone: (980) 314-1680 Fax: (704) 336-6894

NC DHHS
Division of Environmental Health
On-Site Wastewater Section

OPERATION PERMIT for an ON-SITE WASTEWATER TREATMENT & DISPOSAL SYSTEM

File #: 9937 B Permit #: 13091 Tax Parcel #: 137-281-07

Property Owner: Brandy Santana

Job Location Address: 7400 Truelight Church Rd

City: Charlotte State: NC Zip Code: 28227

Operation Permit Issuance Date: 6/21/22 Contractor Name: Greenway Septic

Permitted Design Flow: 240 GPD Liquid Capacity of Dosing Tank: \ gallons

Liquid Capacity of Septic Tank: 1500 gallons Tank Manufacture Shoaf Effluent Pump Model: ___

Drainfield Installation ☐ N/A

Trench Depth: 24 inches

Trench Width: 3 feet

Line Spacing: 9 feet (O.C.)

Total line length: 200 feet

# of Lines: 2 @ 100 feet Infiltrator

Depth of Media: 12 inches (Type) Quick-4

Depth of Cover: ≥6 inches

Distribution Device: Serial

Bed Installation *(For Repair Installations ONLY.)* ☒ N/A

Bed Depth: _____ inches

Bed Width: _____ feet

Total line length: _____ feet

# of Lines: _____ @ _____ feet

Depth of Media: _____ inches (Type) _____

Depth of Cover: _____ inches

Distribution Device: _____

Water Supply Source

☐ Municipal ☐ Private Well ☐ Community Well

☐ Other _____

System Installation Setbacks

Distance from Building Foundation: ≥5 feet

Distance from Property Line: ≥10 feet


Distance from Water Supply Source: ≥50 feet

Inspection Dates

Tank(s) Inspected: 6/16/22

Excavation Inspected: 6/16/22

Pump & Controls Inspected: \

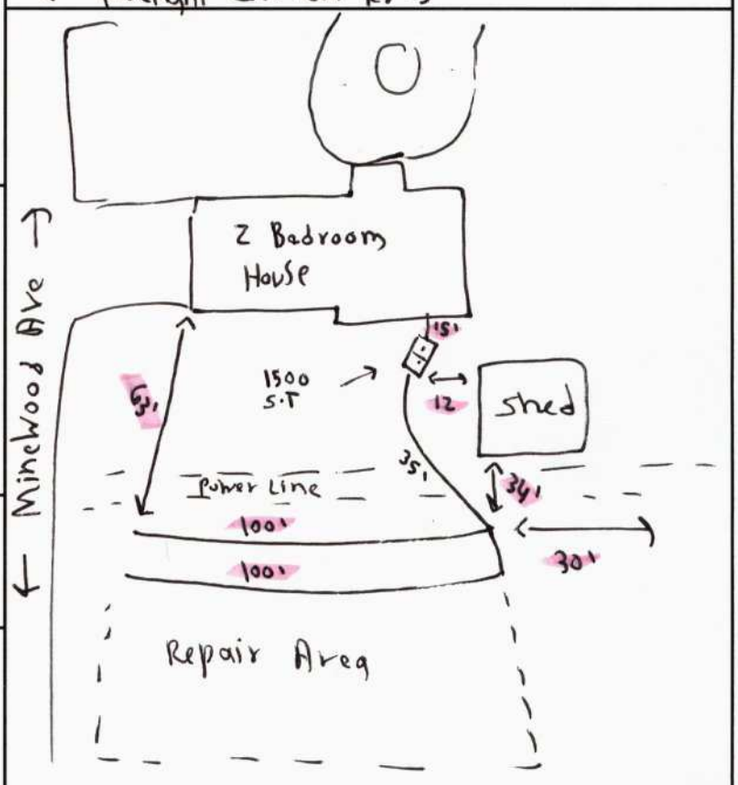

The undersigned has inspected the Septic Tank System described above, and certifies it has been ☒ installed ☐ altered ☐ repaired ☒ as detailed in the plot above ☒ in accordance with the permit issued and meets the provisions of 15A NCAC 18A. 1900, "Laws and Rules for Sewage Treatment and Disposal Systems" in effect on the date of issuance of the permit. The issuance of this Operation Permit does not in any way guarantee that the system will operate properly or relieve any person now or hereafter owning, controlling, or using such system from any liability resulting from the failure of the system to operate properly. This document is issued subject to those restrictions and conditions shown on the permit(s) and the provisions of 15A NCAC 18A. 1900 in addition to those listed below under "Comments." This document shall be null and void if any information contained in the application is untrue or if any additions are made to the property which would increase the requirements for said system.

Notice: Disturbance of the designated repair area may result in the Suspension or Revocation of this permit.

Comments: System Classification & Type: III q ChM-36 2-100 Infiltrator Quick-4 chamber Lines. Existing drain field compromised. Therefore, new drain field installed.

DENR Authorized Agent: Braedon Shelton Signature: Braedon Shelton

Mecklenburg County Groundwater & Wastewater Services
3205 Freedom Dr. Suite 8000, Charlotte, NC 28208
Phone: (980) 314-1680 Fax: (704) 336-6894

NC DHHS
Division of Environmental Health
On-Site Wastewater Section

OPERATION PERMIT for an
ON-SITE WASTEWATER TREATMENT & DISPOSAL SYSTEM

File #: 9937 Permit #: 13091 Tax Parcel #: 137-281-07

Property Owner: Brandy Santana

Job Location Address: 7400 Truelight Church Rd

City: Mint Hill State: NC Zip Code: 28227

OPERATION PERMIT CONDITIONS:

I. Performance: System shall perform in accordance with 15A NCAC 18A .1961.

II. Monitoring: System shall be monitored as required by 15A NCAC 18A .1961.

III. Maintenance: Ground absorption sewage treatment and disposal systems shall be checked, and the contents of the septic tank removed, periodically from all compartments, to ensure proper operation of the system. The contents shall be pumped whenever the solids level is found to be more than 1/3 of the liquid depth in any compartment.

IV. Operation: System shall be operated in accordance with 15A NCAC 18A .1961.

System Classification: III 9

*Operation Permits for Type V and VI systems expire five (5) years from the date of issuance (in accordance with Table V(a)). The system owner must contact GWS six (6) months prior to expiration for permit renewal.

Subsurface system operator required: Yes ☐ No ☒

☐ This type of system requires the system owner to maintain a contract with a certified operator to perform system inspection, maintenance, and reporting as required in 15A NCAC 18A .1961. and Table V(a). The system owner is responsible for all fees associated with these services.

☒ System does not require inspection by GWS on a routine frequency.

☐ System requires inspection by GWS once every five (5) years. The system owner is responsible for all fees associated with the inspection.

☐ System requires inspection by GWS once every three (3) years. The system owner is responsible for all fees associated with the inspection.

☐ System requires inspection by GWS once every twelve (12) months. The system owner is responsible for all fees associated with the inspection.

☐ System requires inspection by GWS once every six (6) months. The system owner is responsible for all fees associated with the inspection.

V. Other: * Repair. Originally just a S.T. Contractor discovered drainfield being Compromised. 1500 S.T + 2-100 Lines Infiltrator Quick-4 lines 2 Bedroom System

DENR Authorized Agent: Braedon Shelton Date: 6/21/22

Signature: Braedon Shelton