Date Received ____________

AUG 2 0 1979

APT No. 16095

T. C. No. 165-121-13,14

Map Date ____________

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH

APPLICATION FOR SOIL INVESTIGATION

1) NAME OF OWNER FORREST (LAST) JOSEPH (FIRST) BENNETT (MIDDLE)

2) ADDRESS OF OWNER 200 EMERSON AVE, CHARLOTTE ZIP 28204

3) PHONE NO Home 375-3595 Office 372-3890


4) LOCATION OF PROPERTY CITY VIEW ACRES (EAST LANE DRIVE) STREET OR COUNTY ROAD

5) SUBDIVISION CITY VIEW ACRES LOT NO 107, 108, 109, 110, 107A, 108A, 109A, 110A BLOCK NO. 2

MAP BOOK NO 6 PAGE NO 941

6) DEED REFERENCE DEED BOOK 1666 ~~PAGE 43~~ PAGE NO ~~941~~ 43

Application is hereby made to the Mecklenburg County Department of Environmental Health for the conduct of a soil investigation and an on site inspection of the lot hereinabove described for the purpose of determining if the lot is suitable for the installation of an individual septic tank wastewater treatment system with subsurface, soil absorption, effluent discharge

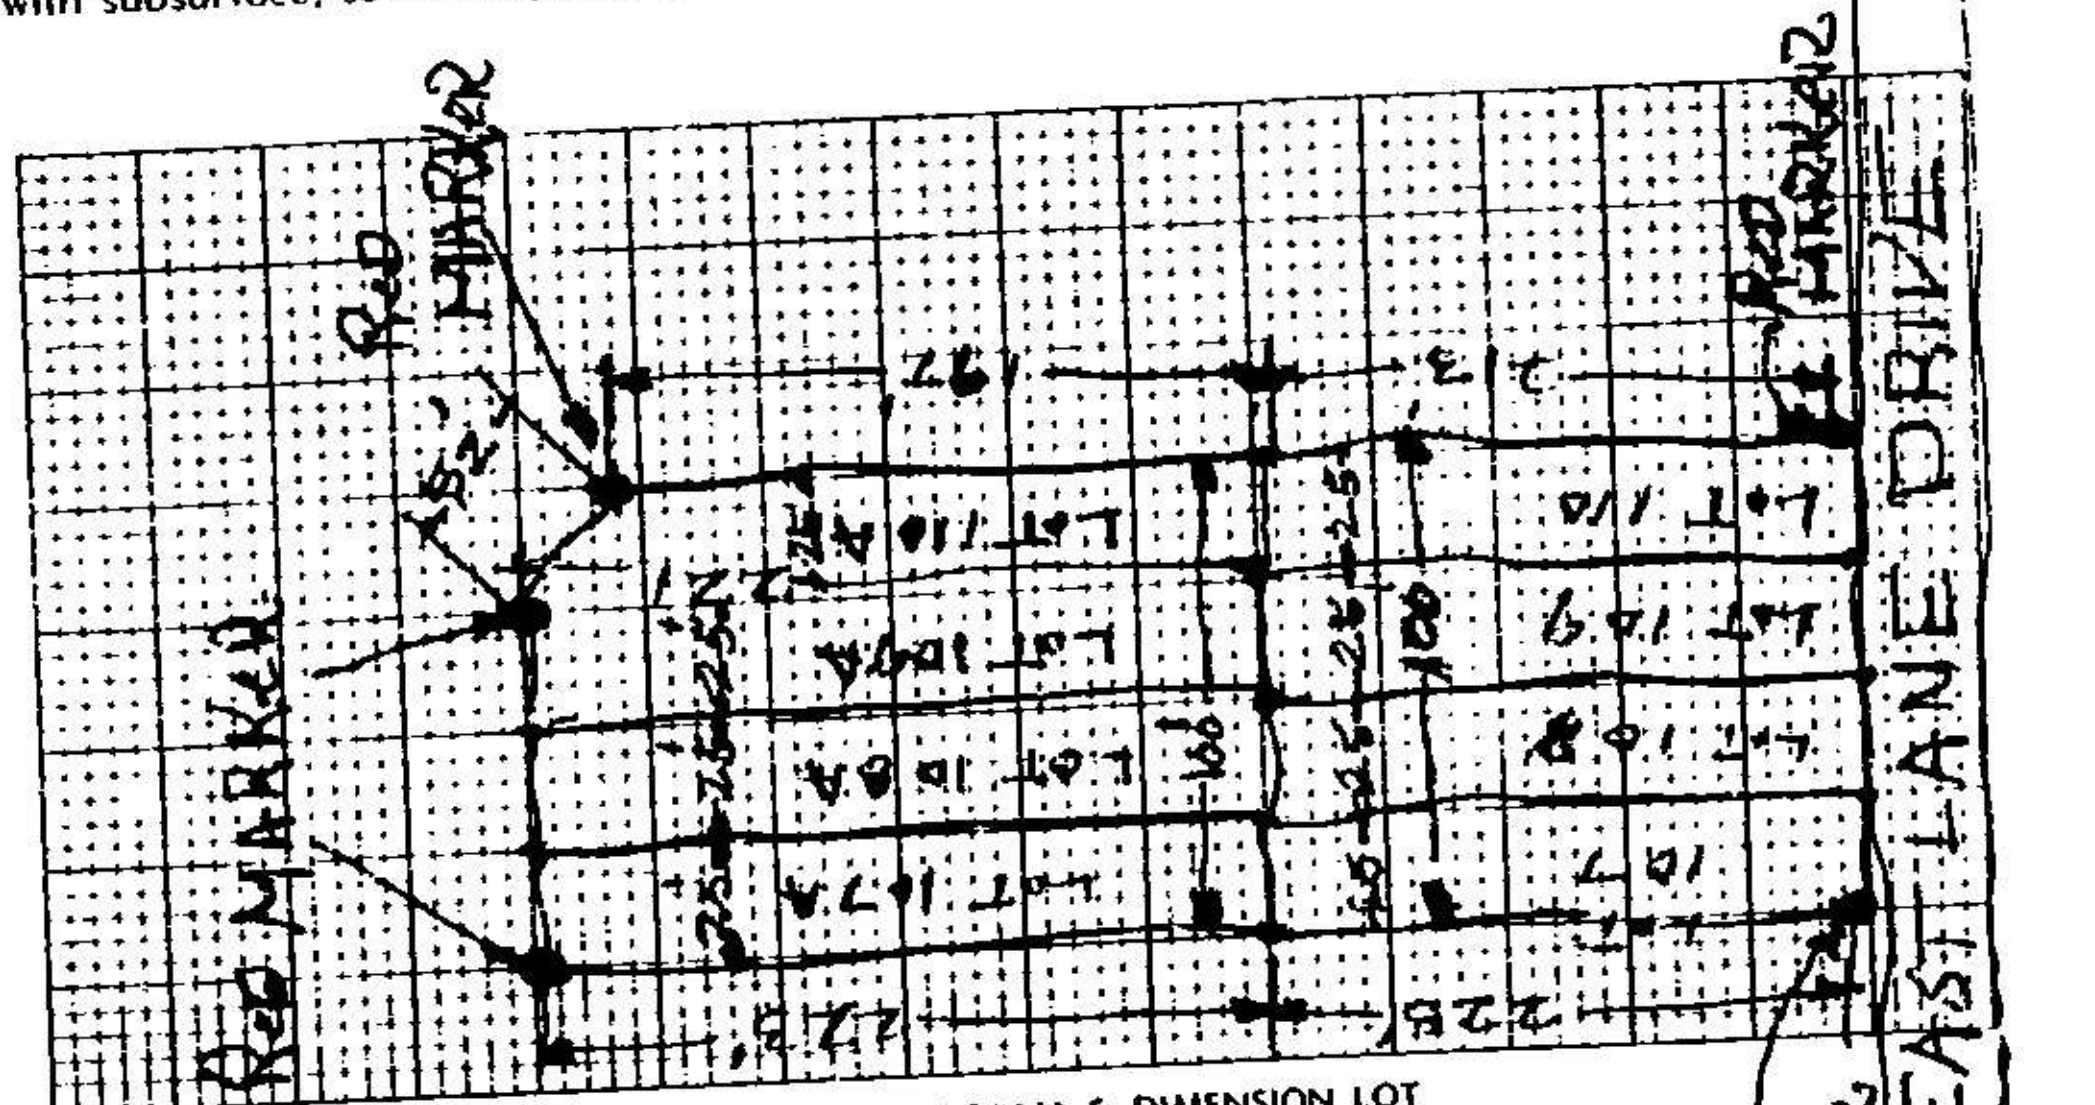

7) ACCURATELY DIAGRAM & DIMENSION LOT

____
OWNER

EHD-5-74

Environmental Health Department's Copy

S. I. R. NO. _____

NORTH CAROLINA
DEPARTMENT OF HUMAN RESOURCES
DIVISION OF HEALTH SERVICES
RALEIGH, NORTH CAROLINA

APPENDIX II
SITE EVALUATION

T. C. # _____

(Ground Absorption Sewage Disposal)

OWNER: _____ DATE REQUESTED: _____
ADDRESS: _____ PLAT NO.: _____
COUNTY: _____ LOT SIZE: _____
LOCATION OF SITE: _____

FACTORS	AREA 1	AREA 2	AREA 3	AREA 4
1. SLOPE (%)	(S) PS U 2 to 7%	S (PS) U complex slopes	(S) PS U 2 to 7%	S PS U
2. SOIL TEXTURE (12-36 in.) (Sandy, loamy, clayey, note 2:1 Clay)	S (PS) U clay	S (PS) U some 2:1 clay	S PS (U) 2:1 clay	S PS U
3. SOIL STRUCTURE (12.36 in.) (Clayey Soils)	S (PS) U Blocky	S (PS) U Blocky	S (PS) U Blocky	S PS U
4. SOIL DEPTH (In.)	(S) PS U 40"	S (PS) U variable	S (PS) U 40"	S PS U
5. RESTRICTIVE HORIZONS (In.) (Impervious Strata, Rock)	(S) PS U None	(S) PS U None	(S) PS U None	S PS U
6. SOIL DRAINAGE/GROUNDWATER (External & Internal)	(S) PS U Good drainage, no water	S (PS) U Evident Perch Water table	(S) PS U Good drainage, no water	S PS U
7. SOIL PERMEABILITY (Percolation Rate)	S (PS) U Moderate	S (PS) U moderately slow	S (PS) U slow	S PS U
8. OTHER (Specify)	(S) PS U Somewhat Limited Area	S PS U	S PS U	S PS U
9. SITE CLASSIFICATION	Provisionally suitable	unsuitable	unsuitable	
SOIL SERIES	Cecil	Complex slopes	Iotla	

S - Suitable PS - Provisionally Suitable U - Unsuitable

* See Diagram on Back (Include: Soil areas, property lines, roads, streams, gullies wet areas, fill areas, wells, water bodies, slope patterns, etc.


Recommendations/Comments: Final soil and system plans to be approved before permit is issued

Described By: _____

Title: _____ Date: _____

DHS Form 2601
Sanitation
EHD 539 (8/79)

2

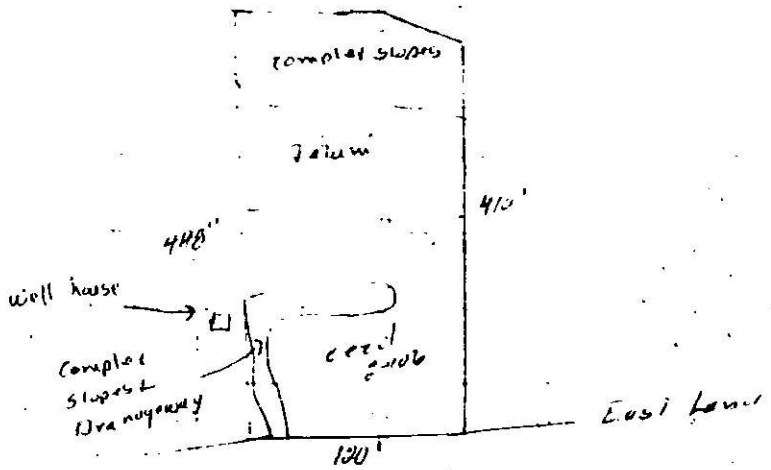
complex slopes
Talus
410'
440'
well house
Complex slopes & Ravine
East Lower
100'

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH
1200 BLYTHE BOULEVARD
CHARLOTTE NORTH CAROLINA 28203

SITE INVESTIGATION REPORT
INDIVIDUAL SEPTIC TANK SYSTEM
WITH SUBSURFACE,
SOIL ABSORPTION,
EFFLUENT DISCHARGE

S.I.R. # 16095

T.C. # 165-121-13.14

DATE Sept. 11, 1979

NAME OF OWNER Forrest, Joseph B.

ADDRESS OF OWNER 200 Emerson Avenue, Charlotte, NC28204

LOCATION OF LOT East Lane Drive (107-110 and 107A-110A)

As determined under the Rules and Regulations promulgated by the Commission for Health Services, Division of Health Services, North Carolina Department of Human Resources, Raleigh, North Carolina, the soils on the lot described above were found to be unsuitable for the installation of an individual septic tank - soil absorption system, due to the following reason:

Limited area of Provisionally Suitable soils.

Please submit plot plans of proposed construction.

John R. Adkisson

John R. Adkisson, Environmentalist