Date Received 7-6-83

RECEIVED
JUL
ENVIRONMENTAL HEALTH

SIR No. 19841

T. C. No. 217-062-01

Map Date

MECKLENBURG COUNTY
DEPARTMENT OF ENVIRONMENTAL HEALTH

APPLICATION FOR SOIL INVESTIGATION

1) NAME OF OWNER 80 ENTERPRISES c/o JACK AUSTIN (LAST / FIRST / MIDDLE)

2) ADDRESS OF OWNER RT. 1 BOX 88 PINEVILLE NC ZIP 28134

3) PHONE NO Home 588-2088 Office


4) LOCATION OF PROPERTY McKEE RD. OFF YOUNGBLOOD (STREET OR COUNTY ROAD)

5) SUBDIVISION McKEE FARM LOT NO BLOCK NO

MAP BOOK NO PAGE NO

6) DEED REFERENCE DEED BOOK PAGE NO

Application is hereby made to the Mecklenburg County Department of Environmental Health for the conduct of a soil investigation and an on site inspection of the lot hereinabove described for the purpose of determining if the lot is suitable for the installation of an individual septic tank wastewater treatment system with subsurface soil absorption effluent discharge

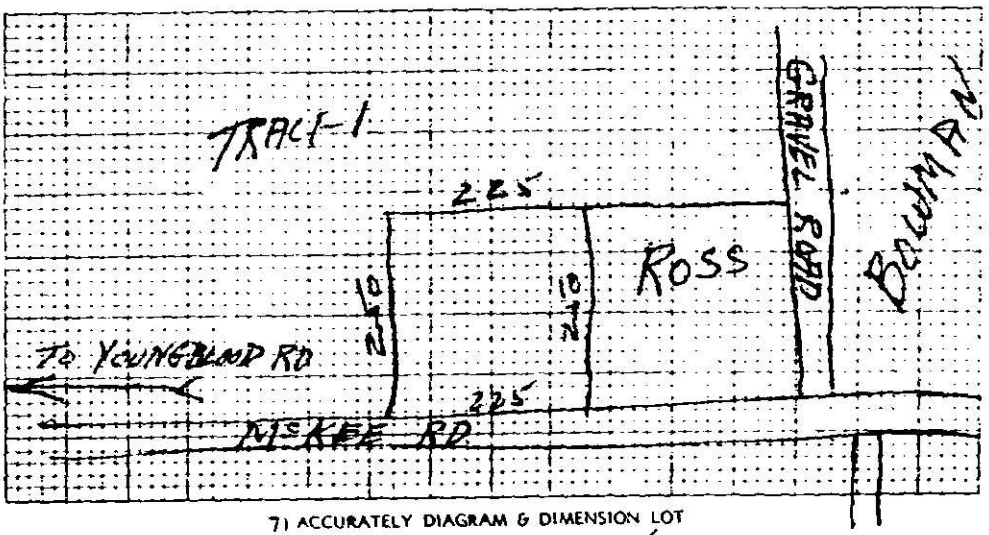

7) ACCURATELY DIAGRAM & DIMENSION LOT

80 Enterprises
OWNER Jack Austin

EHO-5-76

Environmental Health Department's Copy

DEPARTMENT OF ENVIRONMENTAL HEALTH
MECKLENBURG COUNTY, NORTH CAROLINA

SITE EVALUATION

S.I.R. NO. 19841

T.C. NO. 217-062-01

(Ground Absorption Sewage Disposal)

OWNER: 80 Enterprises % Jack Austin
ADDRESS: R-1 Box 88 Pineville 28134

PLAT NO:
LOT SIZE: 1.1

LOCATION OF SITE: McKee Rd

FACTORS	AREA 1	AREA 2	AREA 3	AREA 4
1. SLOPE (%)	S (PS) U: 2-12	S PS (U): Complex slopes	S (PS) U: 2-6	S PS U
2. SOIL TEXTURE (12-36 inches) Sandy, Loamy, Clayey (Note 2-1 Clay)	S (PS) U: clayey	S (PS) U: Clayey	S PS (U): Mixed Clay	S PS U
3. SOIL STRUCTURE (12-36 inches)	S (PS) U: Blocky	S (PS) U: Blocky	S PS (U): weak Blocky	S PS U
4. SOIL DEPTH (inches)	S (PS) U: 40-45	S PS (U): 0-20	S PS (U): 20-35	S PS U
5. RESTRICTIVE HORIZONS (Inches) (Impervious strata, Rock)	S (PS) U: None	S (PS) U: None	S PS (U): Clay	S PS U
6. SOIL DRAINAGE/GROUNDWATER (external and internal)	S (PS) U: Adequate	S (PS) U: Adequate	S PS (U): Slow	S PS U
7. OTHER (Specify) Restricted Area	S PS (U)	S PS U	S PS U	S PS U
8. SOIL GROUP	IIb	IIa	IIe	
9. SITE CLASSIFICATION	Unsuitable	Unsuitable	Unsuitable	
10. SOIL SERIES	Cecil	Complex slopes in Cecil	Vance	

S - Suitable PS - Provisionally Suitable U - Unsuitable

**See Diagram on Back (includes: soil areas, property lines, roads, streams, gullies, wet areas, fill areas, wells, water bodies, slopes)


Recommendations/Comments:

Described by: W. B. Kennedy
Title: Sanitarian

Date: 3-14-83

EHD 539 (Revised: 6/82)

14

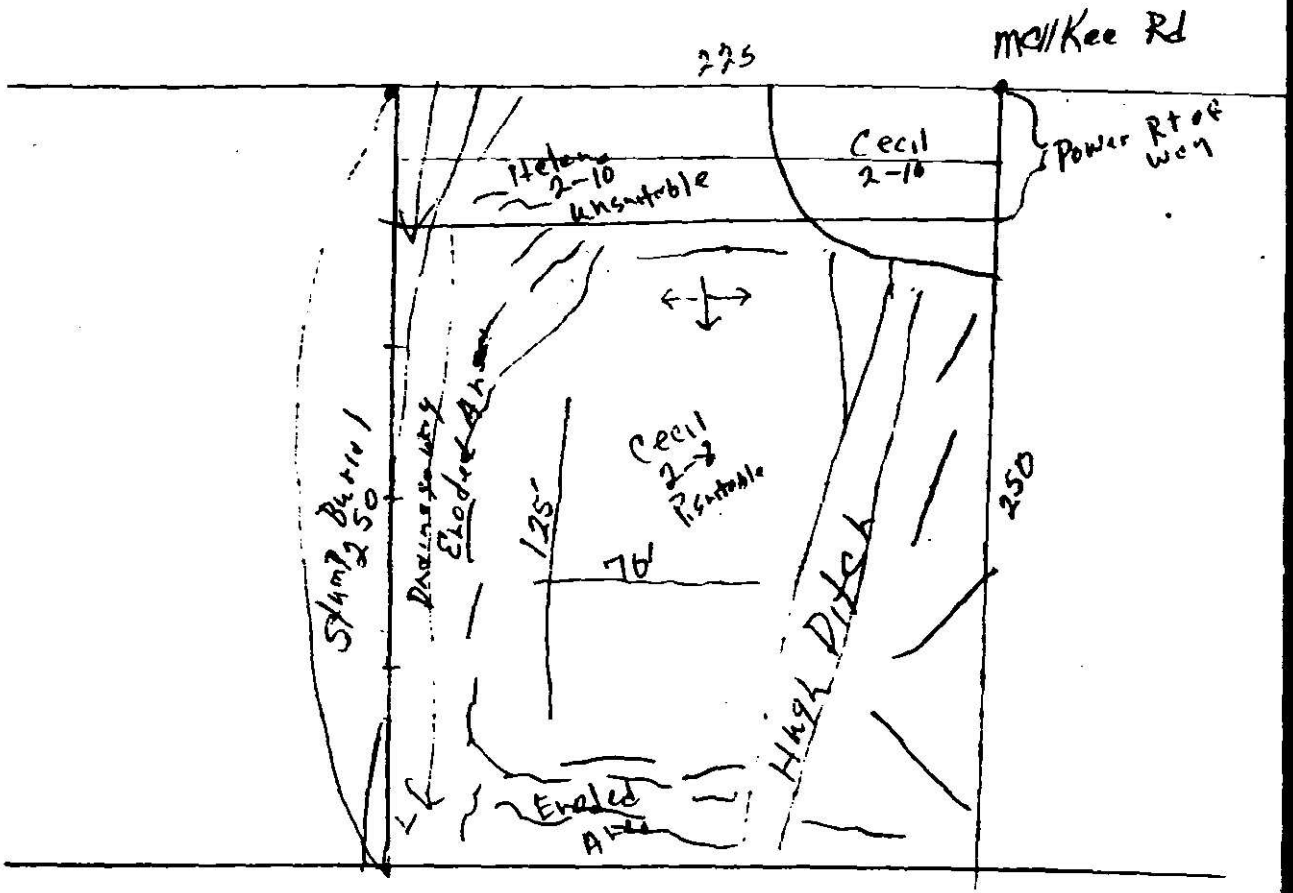
McKee Rd
225
Cecil
2-10
Power R/W
Cecil
2-10
Unsuitable
Cecil
2-10
Unsuitable
125'
70'
250
250
Ponded
Ponded
High Ditch